NACA TN No. 1545

2 0 MAY 1948

NATIONAL ADVISORY COMMITTEE FOR AERONAUTICS

TECHNICAL NOTE

No. 1545

WIND-TUNNEL INVESTIGATION OF SEVEN THIN NACA AIRFOIL SECTIONS

TO DETERMINE OPTIMUM DOUBLE-SLOTTED-FLAP CONFIGURATIONS

By Jones F. Cahill and Stanley F. Racisz

Langley Memorial Aeronautical Laboratory
Langley Field, Va.

Washington

April 1948

NATIONAL ADVISORY COMMITTEE FOR AERONAUTICS

TECHNICAL NOTE NO. 1545

WIND-TUNNEL INVESTIGATION OF SEVEN THIN NACA AIRFOIL SECTIONS

TO DETERMINE OPTIMUM DOUBLE-SLOTTED-FLAP CONFIGURATIONS

By Jones F. Cahill and Stanley F. Racisz

SUMMARY

An investigation was made to determine optimum double-slotted-flap configurations for seven thin NACA airfoil sections. The airfoils tested were the NACA 63-210, 64-208, 64-210, 64_1-212, 65-210, 66-210, and 1410 airfoil sections. Each of the airfoil sections tested was equipped with a main flap of 0.250 chord and a fore flap of 0.075 chord. In addition, the NACA 66-210 and the NACA 64-208 airfoil sections were also tested with a 0.100-chord and a 0.056-chord fore flap, respectively. Lift measurements were made at a Reynolds number of 2.4×10^6 to obtain the configuration giving the highest maximum section lift coefficient (ideal position) for each of the airfoil sections tested. The lift characteristics were measured for Reynolds numbers up to 9.0×10^6 in order to obtain an indication of the scale effects. The section pitching-moment characteristics and the effect of leading-edge roughness on the lift characteristics were measured for each of the airfoil sections at a Reynolds number of 6.0×10^6 for a double-slotted-flap position close to the ideal which also allowed the double slotted flap to be retracted as a unit into the wing contour (optimum).

The optimum fore-flap positions were generally found to be about 1 percent chord forward and about 2 percent chord below the slot lip. The optimum flap positions varied considerably. The deflections for which the highest maximum lift coefficients were measured were about 50° to 55° for the flap and about 25° to 30° for the fore flap.

The maximum section lift coefficient of the airfoil section with either a split or double slotted flap decreased as the position of minimum pressure was moved to the rear or as the airfoil thickness was decreased to 0.08 chord. In all cases, the maximum section lift coefficient increased as the Reynolds number was increased from 2.4×10^6 to 6.0×10^6 but generally decreased or remained constant as the Reynolds number was increased from 6.0×10^6 to 9.0×10^6.

Increasing the fore-flap chord provided increases in the maximum section lift coefficients of both the NACA 64-208 and the NACA 66-210 airfoil sections with double slotted flaps. The addition of standard roughness to the leading edges of the airfoils equipped with double slotted flaps generally decreased the maximum section lift coefficients by amounts slightly less than those obtained with the flaps retracted, decreased the variation of the maximum section lift coefficient with position of minimum pressure and with airfoil thickness, and caused the stalls to be less abrupt than those for the smooth condition. The ratio of increment of section pitching-moment coefficient to increment of section lift

coefficient at a section angle of attack of $0^\circ \left(\dfrac{\Delta c_m}{\Delta c_l} \right)_{\alpha_o = 0^\circ}$ based on the

total chord of the airfoil with the double slotted flap extended was approximately the same as that obtained for the airfoil with the split flap. An unstable pitching-moment break was encountered at the stall for each of the airfoils when equipped with the double slotted flaps and seemed to be peculiar to double slotted flaps.

INTRODUCTION

The use of thin wing sections to increase the critical speeds of high-speed, highly loaded airplanes has been accompanied by the need for suitable high-lift devices to be used for take-off and landing. An investigation was made in the Langley two-dimensional low-turbulence tunnels to determine high-lift trailing-edge flaps suitable for use on thin wing sections that are most likely to be used on high-speed aircraft. The first part of this investigation, reported in reference 1, covers the tests of four types of flap for the NACA 65-210 airfoil section. The double slotted flap, discussed in reference 1, gave maximum lift coefficients higher than any one of the three single slotted flaps tested. The second part of this investigation, reported herein, covers the tests of similar double-slotted-flap configurations for six other thin NACA airfoil sections. Data from reference 1 on the NACA 65-210 airfoil section with a double slotted flap are included to complete the comparison of the results obtained.

The seven thin NACA airfoil sections tested with double slotted flaps in the Langley two-dimensional low-turbulence tunnels are as follows: NACA 63-210, 64-208, 64-210, 64_1-212, 65-210, 66-210, and 1410 airfoil sections. Profiles of the plain airfoil sections are shown in figure 1.

The ideal maximum lift configurations were determined at a Reynolds number of 2.4×10^6 for each of the double slotted flaps which consisted of a 0.250-chord main flap and a 0.075-chord fore flap. The section lift and pitching-moment characteristics were then measured at higher

Reynolds numbers up to 9.0×10^6 for configurations that not only approximated the ideal maximum lift configurations but that also allowed the flap and fore flap to retract as a unit within the airfoil contour. The effects of leading-edge roughness on the section lift characteristics were determined at a Reynolds number of 6.0×10^6.

Data on the lift and pitching-moment characteristics of these airfoil sections equipped with 0.20-chord split flaps deflected 60° are included to show a comparison between the effects of the two types of flap.

SYMBOLS

α_o	section angle of attack, degrees
c	airfoil chord with flap retracted
c_l	section lift coefficient
$c_{l_{max}}$	maximum section lift coefficient
$c_{m_{c/4}}$	section pitching-moment coefficient about quarter-chord point
δ_f	flap deflection (see fig. 2)
δ_{ff}	fore-flap deflection, measured between fore-flap chord line and airfoil chord line, degrees
x/c	distance along airfoil chord line, fraction of chord
t/c	airfoil thickness, fraction of chord
x_1, y_1	horizontal and vertical positions, respectively, of the fore-flap reference point measured from trailing edge of slot lip in percent chord (x positive forward and y positive down)(fig. 2)
x_2, y_2	horizontal and vertical positions, respectively, of flap reference point measured from trailing edge of fore flap in percent chord (x positive forward and y positive down) (fig. 2)
R	Reynolds number

Δc_l increment of section lift coefficient

Δc_m increment of section pitching-moment coefficient

MODELS

Each of the models tested had a chord of 24 inches and completely
spanned the 3-foot-wide test sections of the two tunnels. The main
part of each model ahead of the flap was constructed of laminated
mahogany, and the flaps were constructed of steel. A typical airfoil
with double slotted flap, including the essential dimensions, is shown
in figure 2. Ordinates for the plain airfoil sections are given in
tables 1 to 7.

Each of the main flaps was of 0.250 chord and was obtained by
scaling the ordinates of the main flap tested on the NACA 65-210 airfoil
section (reference 1) in proportion to the airfoil thickness at each
station along the chord. Ordinates of the flaps tested are given in
tables 8 to 14. Each of the flaps was tested in combination with the
0.075c fore flap used in reference 1. In addition, the NACA 64-208
airfoil was tested with a 0.056c fore flap and the NACA 66-210 airfoil
was tested with a 0.100c fore flap. Sketches of the three fore flaps
are presented as figure 3, and their ordinates are given in tables 15 to
17. The flaps and fore flaps were attached to the main parts of the
models at the ends in such a manner that they could be set at any desired
positions and deflections. The flap and fore-flap positions were measured
from their reference points, which are defined as the intersection of
their chord lines with their leading edges. (See fig. 2.)

For tests of each model in the smooth condition, the model was sanded
with No. 400 carborundum paper to produce aerodynamically smooth surfaces.
For tests of the airfoil with leading-edge roughness, the surfaces were
the same as for the smooth condition except that 0.011-inch carborundum
grains were applied over a surface length of 0.16 chord centered at the
chord line. This leading-edge-roughness condition corresponds to the
standard roughness described in reference 2.

APPARATUS AND TESTS

The investigation was made in the Langley two-dimensional low-
turbulence tunnel and the Langley two-dimensional low-turbulence pressure
tunnel.

Section lift characteristics were obtained from static-pressure measurements along the floor and ceiling of the tunnel test section, and section pitching-moment characteristics were determined from deflections of a torque tube. Details of the test methods and the methods used in correcting the data to free-air conditions are given in reference 2.

Lift measurements were made at a Reynolds number of 2.4×10^6 in the Langley two-dimensional low-turbulence tunnel to obtain the ideal configurations. The ideal configurations (those giving the highest maximum lift coefficients) were determined by first determining the ideal position of the flap relative to the fore flap for several combinations of flap and fore-flap deflections. The configuration giving the highest maximum lift was, if necessary, altered slightly to allow the flap and fore flap to be retracted as a unit within the wing contour. With the position of the flap thus fixed relative to the fore flap, lift measurements were made to obtain the best position of the flap and fore-flap combination. This resulting position is called the optimum position. The optimum positions developed in the Langley two-dimensional low-turbulence tunnel at each of several deflections were then tested in the Langley two-dimensional low-turbulence pressure tunnel at a Reynolds number of 6.0×10^6. For the configuration giving the highest maximum lift coefficient at a Reynolds number of 6.0×10^6, pitching-moment characteristics and the effect of leading-edge roughness on the lift characteristics were also determined at a Reynolds number of 6.0×10^6, and the lift characteristics were determined at Reynolds numbers of 3.0×10^6 and 9.0×10^6. The maximum free-stream Mach number attained during any of these tests was less than 0.18.

PRESENTATION OF RESULTS

The data obtained for the airfoil section with a double slotted flap at a Reynolds number of 2.4×10^6 are presented as contours of maximum lift coefficient for various flap and fore-flap positions. These data indicate the maximum section lift coefficient that may be obtained for a given flap position and deflection, or the loss in maximum section lift coefficient that may result if flap positions other than the ideal are selected.

The lift characteristics at a Reynolds number of 6.0×10^6 are presented for several of the more promising double-slotted-flap configurations for each airfoil section. The section pitching-moment characteristics for the smooth condition and also the lift characteristics for the condition with leading-edge roughness are presented for the

configuration having the highest maximum lift coefficient at a Reynolds
number of 6.0×10^6. Additional data are presented showing the lift
and pitching-moment characteristics of the plain airfoil section at
several Reynolds numbers and the lift and pitching-moment character-
istics at a Reynolds number of 6.0×10^6 for the airfoil section with a
0.20-chord split flap deflected 60°. The data for the plain airfoil
section and the airfoil with a split flap were obtained from reference 2.
In some cases, data for the airfoil section with a split flap were
available for several additional Reynolds numbers and are also included.

The figures in which the data are presented for each of the airfoil
sections tested are listed in the following table:

NACA airfoil section	63-210	64-208	64-210	65-210	66-210	1410	64_1-212
Data	Figure						
Plain airfoil and split flaps	4	8	13	19	20	27	31
Contours of flap position for $c_{l_{max}}$	5	9	14	17	21 [b]24	28	32
Contours of fore-flap position for $c_{l_{max}}$	6	10	15	18	22 [b]25	29	33
Characteristics for optimum configuration	7	11 [a]12	16	19	23 [b]26	30	34

[a]0.056c fore flap.
[b]0.100c fore flap.

DISCUSSION

Maximum Lift

Effect of flap and fore-flap position.- The variation of the section
lift characteristics of the flapped airfoil section as the flap position
varies is primarily a result of changes in the slot shapes. A secondary
effect, resulting from the change in airfoil chord as the flap is moved
chordwise, also exists; but within the range of positions for these tests,
this effect is small. The ideal configurations are therefore the ones
for which the best slot shapes are formed at the flap and fore-flap
leading edges. The data shown on the contours of flap and fore-flap
position indicate that the ideal flap and fore-flap configuration for
maximum lift is one that forms converging nozzles and directs the air
flow downward over both the flap and fore flap.

For most of the ideal configurations with the 0.075c fore flap, the
fore flap was located approximately 1 percent chord forward of the slot
lip and approximately 2 percent chord below the slot lip. For the
NACA 63-210 airfoil section, however, (fig. 6) the ideal fore-flap position
was approximately 1 percent chord farther forward than the average.
Although the best position of the fore flap for the NACA 64_1-212 airfoil
is actually behind the slot lip (fig. 33), little difference exists between
the maximum lift coefficients obtained at the ideal position and at the
position corresponding to the average of the others. The flap positions
for the ideal configurations varied considerably for each of the airfoil
and flap combinations tested, as would probably be expected inasmuch as
each airfoil section was tested with the flap designed for that airfoil.
An indication of the ideal double-slotted-flap configurations for air-
foils and flaps similar to those tested in this investigation may be
obtained from the contours of flap position. These configurations, how-
ever, should not be applied to airfoil-flap combinations having shapes
radically different from those tested. In addition, an indication of the
loss in maximum section lift coefficient which may be caused by structural
deflections of the flap or by construction errors may be obtained from
the contours. For example, in the case of the NACA 63-210 airfoil section
(fig. 5(a)), a departure of 0.01c from the ideal flap position can
decrease the maximum section lift coefficient by as much as 0.3. For
most of the optimum configurations, the flap deflection was 50° or 55°
and the fore-flap deflection was 25° or 30°, although little difference
existed in the maximum lift coefficients measured for these deflections.
Increasing the deflection of the fore-flap aids both in forming a
converging slot and in directing the air flow downward over the flap.
A limit is reached in these effects, however, when the fore-flap deflection
becomes high enough to cause the flow over the upper surface of the fore
flap itself to separate. The use of the optimum flap positions rather
than the ideal positions in the tests which followed generally resulted in a

decrease in maximum lift coefficient of less than 0.1.

Effect of fore-flap chord.- The data presented in figures 23 and 26 show that increasing the fore-flap chord from 0.075c to 0.100c increased the maximum section lift coefficient of the NACA 66-210 airfoil section by approximately 0.1 at a Reynolds number of 6.0×10^6. A comparison of the data presented in figures 11 and 12 indicates that decreasing the fore-flap chord from 0.075c to 0.056c results in a slight decrease in the maximum section lift coefficient of the NACA 64-208 airfoil section with a double slotted flap. The data presented in reference 3 also show that increasing the fore-flap chord may be beneficial in increasing the maximum section lift coefficient. The increase in maximum section lift coefficient obtained by the use of larger fore flaps may be attributed to a combination of the increased area of the lifting surface and better slot shapes.

Effect of position of minimum pressure.- The variation of $c_{l_{max}}$ with the position of minimum pressure for several NACA 6-series airfoils of 10-percent thickness is presented in figure 35 for a Reynolds number of 6.0×10^6. Data presented in reference 2 indicate that for airfoil sections of thicknesses less than about 0.12c, the stall usually begins at the leading edge. Since the leading-edge radii of NACA 6-series airfoils decrease as the position of minimum pressure moves to the rear, this type of stall becomes more pronounced. The decrease in maximum lift coefficient with rearward movement of the position of minimum pressure, shown in figure 35, is therefore probably caused principally by the decrease in leading-edge radius. For thicker airfoil sections, where the stall begins over some rear part of the airfoil instead of near the leading edge, the decrease in the leading-edge radius with rearward movement of the position of minimum pressure is expected to have a smaller effect on the maximum section lift coefficient. The increment in section lift coefficient caused by the addition of the double slotted flap to the NACA 6-series plain airfoil section having a maximum thickness of 10 percent chord remained substantially constant (approx. 1.4) over the range of minimum pressure positions tested.

Effect of airfoil thickness.- The variation of maximum lift coefficient with airfoil thickness for the three NACA 64-series airfoils tested is shown in figure 35. The data in figure 35 show that for airfoil thicknesses between 0.12c and 0.08c the maximum lift coefficients of the plain airfoils and the airfoils with both split and double slotted flaps decrease as the airfoil thickness is decreased, although not all in the same manner. The increment of maximum lift coefficient caused by the double slotted flap decreases at a nearly constant rate as the thickness is decreased, while the increment in maximum lift coefficient caused by the split flap decreases as the thickness is decreased from 0.12c to 0.10c and then increases again as the thickness is further decreased to 0.08c.

Data in reference 2 have shown that the maximum lift coefficients of most airfoil sections decrease as the airfoil thickness is increased above about 0.12c although the maximum lifts of these same airfoils when equipped with split flaps continue to increase up to a thickness as high as 0.16c or 0.18c. Previous scattered data have shown that the maximum lift coefficients of airfoil sections equipped with double slotted flaps follow the same general trend. The data in figure 35 extend these previous results down to a thickness of 0.08c.

The maximum lift coefficient of the NACA 1410 airfoil, also shown in figure 35, is approximately the same as the maximum lift coefficient for the NACA 64_1–212 airfoil section.

Reynolds number effect.— The variation of maximum section lift coefficient with Reynolds number is shown in figure 36. In all cases, increasing the Reynolds number from 2.4×10^6 to 6.0×10^6 resulted in large increases in the maximum section lift coefficients. Increasing the Reynolds number from 6.0×10^6 to 9.0×10^6, however, caused slight decreases or no change in the maximum lift coefficients of each of the airfoil sections with double slotted flap except the NACA 64–210 section. Figure 11 indicates that the NACA 64–208 section followed the same trend as the NACA 64–210 section.

An explanation of scale effect on the maximum lift of airfoil sections is given in reference 4, and this explanation is usually applicable to airfoils with flaps. Variations of the lift with Reynolds number are generally apparent only in regions of incipient stall (high angles of attack), but for these thin airfoil sections with double slotted flaps the lift decreases with increase in Reynolds number in the linear part of the lift curve (low angles of attack). This decrease in lift coefficient is probably caused by changes in the flow conditions through the slots as the Reynolds number is varied. Therefore, a new ideal configuration could probably be developed at higher Reynolds numbers, and slightly higher maximum lifts might be obtained.

Effect of flap on angle of attack for maximum lift.— A comparison of the data for the plain airfoil sections and that for the airfoils with flaps deflected shows that the stall occurs at a considerably lower angle of attack when the flap is deflected. The deflection of a trailing-edge flap causes an incremental load distribution which consists of an incremental basic load distribution and an incremental additional load distribution. (See reference 5.) The decrease in the angle of attack at which the stall occurs is attributed to the fact that the additional load, which comprises a large part of the incremental load distribution, increases the adverse pressure gradient in the vicinity of the airfoil leading edge; and, therefore, the critical pressure gradient is attained

at a lower angle of attack.

Effect of leading-edge roughness.— The addition of standard roughness
to the leading edge of the airfoil decreased the maximum lift coef-
ficients of all the airfoil configurations in such a way that only a
slight variation of maximum lift coefficient with position of minimum
pressure occurred. (See fig. 35.)

The maximum lift coefficients of the plain airfoil and the airfoil
with either of the flaps in the rough condition, increased as the air-
foil thickness was increased but not so rapidly as in the smooth con-
dition. For the airfoil with either a split or a double slotted flap,
the decrement in maximum section lift coefficient caused by leading-
edge roughness was less than that obtained for the plain airfoil section
with the exception of the NACA 1410 and the NACA 64_1–212 airfoils which
gave slightly higher decrements with the double slotted flap deflected.

A comparison of the lift curves for the smooth condition with those
for the condition with leading-edge roughness indicates that for thin
airfoil sections, leading-edge roughness tends to give a less abrupt
stall than that obtained for the smooth condition. This change in the
type of stall can be attributed to the manner in which the stall occurs.
For a smooth thin airfoil section, the stall first occurs in the vicinity
of the leading edge; whereas with leading-edge roughness the stall occurs
over some rear part of the airfoil and progresses forward.

Pitching Moments

Glauert has shown in reference 6 that for plain trailing-edge hinged
flaps, the incremental pitching moment caused by the deflection of a
flap is a linear function of the incremental lift coefficient. The
rather meager data in figure 37 show that this linear relation is
probably also true for airfoils with split or double slotted flaps. If
the ratio $\left(\dfrac{\Delta c_m}{\Delta c_l}\right)_{\alpha_0 = 0^\circ}$ is calculated on the basis of the total chord of
the model with the double slotted flap extended, reasonably good agreement
is shown for the double slotted flap and the split flap on these airfoil
sections. The total chord with the flap extended is equal to the sum of
the flap chord and the distance from the airfoil leading edge to the flap
leading edge.

For each of these airfoil sections equipped with the double slotted
flap, an unstable break in the pitching-moment curve (decrease in
negative pitching moment) occurs at the stall. This unstable break seems
to be peculiar to the double slotted flaps since it occurs in no case for
the plain airfoil or for the airfoil with the split flap. The actual

cause of this phenomenon is not clear and an analysis of pressure-distribution data would be required to shown what flow changes determine the stability of the section at the stall.

CONCLUSIONS

Seven thin NACA airfoil sections — the NACA 63–210, 64–208, 64–210, 64_1–212, 65–210, 66–210, and 1410 airfoil sections — equipped with double slotted flaps were tested. Each airfoil was tested with a double slotted flap consisting of a 0.250–chord main flap and 0.075–chord fore flap. In addition, the NACA 66–210 airfoil was tested with a 0.100–chord fore flap and the NACA 64–208 airfoil was tested with a 0.056–chord fore flap. The results of the tests provided the following conclusions:

1. The optimum fore–flap positions for these airfoils were generally about 1 percent chord forward and 2 percent chord below the slot lip. The optimum flap positions varied considerably. The deflections for which the highest maximum lift coefficients were measured were about 50° to 55° for the flap and about 25° to 30° for the fore flap.

2. For the airfoil section with either a split or double slotted flap, the maximum section lift coefficient decreased as the position of minimum pressure was moved to the rear and as the airfoil thickness was decreased to 0.08 chord.

3. In all cases, the maximum section lift coefficient increased appreciably as the Reynolds number was increased from 2.4×10^6 to 6.0×10^6 but generally decreased slightly or remained constant as the Reynolds number was increased from 6.0×10^6 to 9.0×10^6.

4. Increasing the fore–flap chord provided increases in the maximum section lift coefficients of the NACA 64–208 and the NACA 66–210 airfoil sections with double slotted flaps.

5. The addition of standard roughness to the leading edges of the airfoils equipped with double slotted flaps caused decrements in maximum lift coefficient that were generally slightly less than those with flaps retracted, caused a decrease in the variation of maximum lift coefficient with position of minimum pressure and with airfoil thickness, and caused the stalls to be less abrupt than those for the airfoil in the smooth condition.

6. The ratio of increment of section pitching-moment coefficient to increment of section lift coefficient at a section angle of attack of 0° $\left(\dfrac{\Delta c_m}{\Delta c_l}\right)_{\alpha_0=0^{\circ}}$ based on the total chord of the airfoil with the double slotted flap extended was approximately the same as that obtained for the airfoil with the split flap.

7. An unstable pitching-moment break is encountered at the stall for each of the airfoils when equipped with the double slotted flaps and seems to be peculiar to double slotted flaps.

Langley Memorial Aeronautical Laboratory
    National Advisory Committee for Aeronautics
        Langley Field, Va. November 5, 1947.

<div align="center">REFERENCES</div>

1. Cahill, Jones F.: Two-Dimensional Wind-Tunnel Investigation of Four Types of High-Lift Flap on an NACA 65-210 Airfoil Section. NACA TN No. 1191, 1947.

2. Abbott, Ira H., von Doenhoff, Albert E., and Stivers, Louis S., Jr.: Summary of Airfoil Data. NACA ACR No. L5C05, 1945.

3. Braslow, Albert L., and Loftin, Laurence K., Jr.: Two-Dimensional Wind-Tunnel Investigation of an Approximately 14-Percent-Thick NACA 66-Series-Type Airfoil Section with a Double Slotted Flap. NACA TN No. 1110, 1946.

4. Jacobs, Eastman N., and Sherman, Albert: Airfoil Section Characteristics as Affected by Variations of the Reynolds Number. NACA Rep. No. 586, 1937.

5. Allen, H. Julian: Calculation of the Chordwise Load Distribution over Airfoil Sections with Plain, Split, or Serially Hinged Trailing-Edge Flaps. NACA Rep. No. 634, 1938.

6. Glauert, H.: Theoretical Relationships for an Aerofoil with Hinged Flap. R. & M. No. 1095, British A.R.C., 1927.

TABLE 1

ORDINATES FOR NACA 63-210 AIRFOIL

[Stations and ordinates given in percent airfoil chord]

Upper surface		Lower surface	
Station	Ordinate	Station	Ordinate
0	0	0	0
.430	.876	.570	-.776
.669	1.107	.831	-.967
1.162	1.379	1.338	-1.165
2.398	1.939	2.602	-1.567
4.886	2.753	5.114	-2.121
7.382	3.372	7.618	-2.524
9.882	3.877	10.118	-2.843
14.890	4.665	15.110	-3.319
19.902	5.240	20.098	-3.648
24.917	5.647	25.083	-3.857
29.933	5.910	30.067	-3.966
34.951	6.030	35.049	-3.970
39.968	6.009	40.032	-3.867
44.985	5.861	45.015	-3.671
50.000	5.599	50.000	-3.393
55.013	5.235	54.987	-3.045
60.024	4.786	59.976	-2.644
65.032	4.264	64.968	-2.204
70.036	3.684	69.964	-1.740
75.038	3.061	74.962	-1.271
80.056	2.414	79.964	-.822
85.030	1.761	84.970	-.415
90.021	1.121	89.979	-.087
95.010	.530	94.990	.102
100.000	0	100.000	0

L.E. radius: 0.770
Slope of radius through L.E.: 0.084

TABLE 2

ORDINATES FOR NACA 65-210 AIRFOIL

[Stations and ordinates given in percent airfoil chord]

Upper surface		Lower surface	
Station	Ordinate	Station	Ordinate
0	0	0	0
.435	.819	.565	-.719
.678	.999	.822	-.859
1.169	1.273	1.331	-1.059
2.408	1.757	2.592	-1.385
4.898	2.491	5.102	-1.859
7.394	3.069	7.606	-2.221
9.894	3.555	10.106	-2.521
14.899	4.338	15.101	-2.992
19.909	4.938	20.091	-3.346
24.921	5.397	25.079	-3.607
29.936	5.732	30.064	-3.788
34.951	5.954	35.049	-3.894
39.968	6.067	40.032	-3.925
44.984	6.058	45.016	-3.868
50.000	5.915	50.000	-3.709
55.014	5.625	54.986	-3.435
60.027	5.217	59.973	-3.075
65.036	4.712	64.964	-2.652
70.043	4.128	69.957	-2.184
75.045	3.479	74.955	-1.689
80.044	2.783	79.956	-1.191
85.038	2.057	84.962	-.711
90.028	1.327	89.972	-.293
95.014	.622	94.986	.010
100.000	0	100.000	0

L.E. radius: 0.687
Slope of radius through L.E.: 0.084

TABLE 3

ORDINATES FOR NACA 66-210 AIRFOIL

[Stations and ordinates given in percent airfoil chord]

Upper surface		Lower surface	
Station	Ordinate	Station	Ordinate
0	0	0	0
.436	.806	.564	-.706
.679	.980	.821	-.840
1.171	1.245	1.329	-1.031
2.412	1.699	2.588	-1.327
4.902	2.401	5.098	-1.769
7.399	2.958	7.601	-2.110
9.898	3.432	10.102	-2.389
14.903	4.202	15.097	-2.856
19.912	4.796	20.088	-3.204
24.924	5.257	25.076	-3.467
29.937	5.608	30.063	-3.664
34.952	5.862	35.048	-3.802
39.968	6.024	40.032	-3.882
44.984	6.095	45.016	-3.905
50.000	6.074	50.000	-3.868
55.016	5.960	54.984	-3.770
60.030	5.736	59.970	-3.594
65.042	5.332	64.958	-3.272
70.051	4.759	69.949	-2.815
75.056	4.071	74.944	-2.281
80.055	3.289	79.945	-1.697
85.049	2.445	84.951	-1.099
90.037	1.570	89.963	-.536
95.019	.724	94.981	-.092
100.000	0	100.000	0

L.E. radius: 0.662
Slope of radius through L.E.: 0.084

TABLE 4

ORDINATES FOR NACA 1410 AIRFOIL

[Stations and ordinates given in percent airfoil chord]

Upper surface		Lower surface	
Station	Ordinate	Station	Ordinate
0	0	0	0
1.174	1.639	1.326	-1.515
2.398	2.297	2.602	-2.055
4.870	3.194	5.130	-2.728
7.358	3.837	7.642	-3.157
9.854	4.338	10.146	-3.462
14.861	5.062	15.139	-3.844
19.880	5.531	20.120	-4.031
24.907	5.809	25.093	-4.091
29.937	5.940	30.063	-4.064
40.000	5.836	40.000	-3.836
50.025	5.385	49.975	-3.439
60.042	4.692	59.958	-2.914
70.051	3.804	69.949	-2.304
80.049	2.741	79.951	-1.629
90.034	1.513	89.966	-.901
95.021	.832	94.979	-.512
100.000	.105	100.000	-.105

L.E. radius: 1.10
Slope of radius through L.E.: 0.05

NATIONAL ADVISORY
COMMITTEE FOR AERONAUTICS

TABLE 5

ORDINATES FOR NACA 64-208 AIRFOIL

Stations and ordinates given
in percent airfoil chord

Upper surface		Lower surface	
Station	Ordinate	Station	Ordinate
0	0	0	0
.445	.706	.555	-.606
.688	.862	.812	-.722
1.180	1.110	1.320	-.896
2.421	1.549	2.579	-1.177
4.912	2.189	5.088	-1.557
7.410	2.681	7.590	-1.833
9.909	3.089	10.091	-2.055
14.915	3.741	15.085	-2.395
19.924	4.232	20.076	-2.640
24.935	4.598	25.065	-2.808
29.948	4.856	30.052	-2.912
34.961	5.009	35.039	-2.949
39.974	5.063	40.026	-2.921
44.988	4.978	45.012	-2.788
50.000	4.787	50.000	-2.581
55.011	4.506	54.989	-2.316
60.020	4.152	59.980	-2.010
65.027	3.733	64.973	-1.673
70.031	3.265	69.969	-1.319
75.032	2.749	74.968	-.959
80.031	2.200	79.969	-.608
85.027	1.634	84.973	-.288
90.019	1.067	89.981	-.033
95.010	.522	94.990	.110
100.000	0	100.000	0

L.E. radius: 0.455
Slope of radius through L.E.: 0.084

TABLE 6

ORDINATES FOR NACA 64-210 AIRFOIL

Stations and ordinates given
in percent airfoil chord

Upper surface		Lower surface	
Station	Ordinate	Station	Ordinate
0	0	0	0
.431	.867	.569	-.767
.673	1.056	.827	-.916
1.163	1.354	1.337	-1.140
2.401	1.884	2.599	-1.512
4.890	2.656	5.110	-2.024
7.387	3.248	7.613	-2.400
9.887	3.736	10.113	-2.702
14.894	4.514	15.106	-3.168
19.905	5.097	20.095	-3.505
24.919	5.533	25.081	-3.743
29.934	5.856	30.066	-3.892
34.951	6.010	35.049	-3.950
39.968	6.059	40.032	-3.917
44.985	5.938	45.015	-3.748
50.000	5.689	50.000	-3.483
55.014	5.333	54.987	-3.143
60.025	4.891	59.975	-2.749
65.033	4.375	64.967	-2.315
70.038	3.799	69.962	-1.855
75.040	3.176	74.960	-1.386
80.038	2.518	79.962	-.926
85.033	1.849	84.968	-.503
90.024	1.188	89.977	-.154
95.012	.564	94.988	.068
100.000	0	100.000	0

L.E. radius: 0.720
Slope of radius through L.E.: 0.084

TABLE 7

ORDINATES FOR NACA 64_1-212 AIRFOIL

Stations and ordinates given
in percent airfoil chord

Upper surface		Lower surface	
Station	Ordinate	Station	Ordinate
0	0	0	0
.418	1.025	.582	-.925
.659	1.245	.841	-1.105
1.147	1.593	1.353	-1.779
2.382	2.218	2.618	-1.846
4.868	3.123	5.132	-2.491
7.364	3.815	7.636	-2.967
9.865	4.386	10.135	-3.352
14.872	5.291	15.128	-3.945
19.886	5.968	20.114	-4.376
24.903	6.470	25.097	-4.680
29.921	6.815	30.079	-4.871
34.941	7.008	35.059	-4.948
39.961	7.052	40.039	-4.910
44.982	6.893	45.018	-4.703
50.000	6.583	50.000	-4.377
55.016	6.151	54.984	-3.961
60.029	5.619	59.971	-3.477
65.039	5.004	64.961	-2.944
70.045	4.322	69.955	-2.378
75.047	3.590	74.953	-1.800
80.045	2.825	79.955	-1.233
85.038	2.054	84.962	-.708
90.027	1.303	89.973	-.269
95.013	.604	94.987	.028
100.000	0	100.000	0

L.E. radius: 1.040
Slope of radius through L.E.: 0.084

NATIONAL ADVISORY
COMMITTEE FOR AERONAUTICS

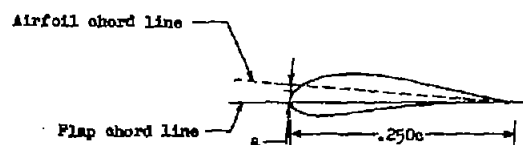Airfoil chord line · Flap chord line · a · .250c
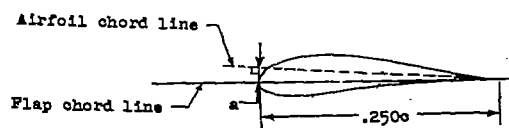
TABLE 8

FLAP ORDINATES FOR 63-210 AIRFOIL

[Stations and ordinates given from flap chord line in percent airfoil chord]

Upper surface		Lower surface	
Station	Ordinate	Station	Ordinate
0	0	0	0
.25	.74	.25	-.35
.50	.95	.50	-.50
1.00	1.24	1.00	-.68
2.00	1.60	2.00	-.83
3.00	1.78	2.50	-.85
4.00	1.88	3.00	-.79
5.00	1.95	6.00	-.56
6.00	1.99	9.00	-.35
7.00	1.99	12.00	-.15
8.00	1.98	15.00	.01
9.00	1.94	18.00	.11
10.00	1.86	21.00	.16
12.00	1.62	24.00	.06
15.00	1.21	25.00	0
18.00	.82		
21.00	.47		
24.00	.12		
25.00	0		

L.E. radius: 0.562
L.E. radius center: 0.201 above flap chord line
Dimension a: 0.200

TABLE 9

FLAP ORDINATES FOR 65-210 AIRFOIL

[Stations and ordinates given from flap chord line in percent airfoil chord]

Upper surface		Lower surface	
Station	Ordinate	Station	Ordinate
0	0	0	0
.28	.92	.28	-.41
.56	1.19	.56	-.62
1.12	1.56	1.12	-.88
1.69	1.83	1.69	-1.00
2.22	1.99	2.48	-1.03
3.38	2.22	4.98	-.83
4.50	2.33	7.48	-.63
5.61	2.38	9.98	-.44
7.00	2.40	12.48	-.27
9.00	2.35	14.98	-.12
11.00	2.16	17.48	.01
12.51	1.91	19.99	.10
15.01	1.50	22.49	.12
17.51	1.10	25.00	0
20.00	.711		
22.50	.341		
25.00	0		

L.E. radius: 0.800
L.E. radius center: 0.240 above flap chord line
Dimension a: 0.400

TABLE 10

FLAP ORDINATES FOR 66-210 AIRFOIL

[Stations and ordinates given from flap chord line in percent airfoil chord]

Upper surface		Lower surface	
Station	Ordinate	Station	Ordinate
0	0	0	0
.25	1.09	.25	-.50
.50	1.35	.50	-.75
1.00	1.76	1.00	-1.05
2.00	2.30	2.00	-1.27
3.00	2.65	2.50	-1.30
4.00	2.84	3.00	-1.26
5.00	2.95	6.00	-.98
6.00	3.00	9.00	-.72
7.00	3.02	12.00	-.46
8.00	3.00	15.00	-.21
9.00	2.94	18.00	-.02
10.00	2.85	21.00	.06
12.00	2.50	24.00	.04
15.00	1.85	25.00	0
18.00	1.25		
21.00	.71		
24.00	.18		
25.00	0		

L.E. radius: 1.207
L.E. radius center: 0.295 about flap chord line
Dimension a: 0.752

TABLE 11

FLAP ORDINATES FOR 1410 AIRFOIL

[Stations and ordinates given from flap chord line in percent airfoil chord]

Upper surface		Lower surface	
Station	Ordinate	Station	Ordinate
0	0	0	0
.25	.89	.25	-.38
.50	1.14	.50	-.62
1.00	1.48	1.00	-.92
2.00	1.93	2.00	-1.14
3.00	2.20	2.50	-1.15
4.00	2.36	3.00	-1.13
5.00	2.48	6.00	-1.01
6.00	2.55	9.00	-.88
7.00	2.59	12.00	-.77
8.00	2.58	15.00	-.63
9.00	2.56	18.00	-.47
10.00	2.50	21.00	-.30
12.00	2.27	24.00	-.14
15.00	1.81	25.00	-.11
18.00	1.33		
21.00	.80		
24.00	.28		
25.00	.11		

L.E. radius: 0.831
L.E. radius center: 0.249 above flap chord line
Dimension a: 0.700

NATIONAL ADVISORY
COMMITTEE FOR AERONAUTICS

Airfoil chord line

Flap chord line

a | .250c

TABLE 12

FLAP ORDINATES FOR 64-208 AIRFOIL

[Stations and ordinates given from flap chord line in percent airfoil chord]

Upper surface		Lower surface	
Station	Ordinate	Station	Ordinate
0	0	0	0
.25	.65	.25	-.27
.50	.78	.50	-.42
1.00	1.06	1.00	-.58
2.00	1.37	2.00	-.71
3.00	1.54	2.50	-.73
4.00	1.67	3.00	-.69
5.00	1.73	6.00	-.48
6.00	1.75	9.00	-.29
7.00	1.75	12.00	-.14
8.00	1.73	15.00	0
9.00	1.70	18.00	.11
10.00	1.64	21.00	.12
12.00	1.45	24.00	.05
15.00	1.10	25.00	0
18.00	.75		
21.00	.43		
24.00	.13		
25.00	0		

L.E. radius: 0.411
L.E. radius center: 0.171 above flap chord line
Dimension a: 0.060

TABLE 13

FLAP ORDINATES FOR 64-210 AIRFOIL

[Stations and ordinates given from flap chord line in percent airfoil chord]

Upper surface		Lower surface	
Station	Ordinate	Station	Ordinate
0	0	0	0
.25	.78	.25	-.34
.50	1.01	.50	-.50
1.00	1.32	1.00	-.70
2.00	1.69	2.00	-.90
3.00	1.89	2.50	-.90
4.00	2.01	4.95	-.70
5.00	2.07	9.98	-.33
6.00	2.09	14.98	-.04
7.00	2.09	19.99	.13
9.00	2.05	25.00	0
11.00	1.88		
15.00	1.30		
20.02	.62		
25.00	0		

L.E. radius: 0.620
L.E. radius center: 0.170 above flap chord line
Dimension a: 0.288

TABLE 14

FLAP ORDINATES FOR 64$_1$-212 AIRFOIL

[Stations and ordinates given from flap chord line in percent airfoil chord]

Upper surface		Lower surface	
Station	Ordinate	Station	Ordinate
0	0	0	0
.25	.94	.25	-.44
.50	1.18	.50	-.63
1.00	1.53	1.00	-.85
2.00	1.97	2.00	-1.05
3.00	2.21	2.50	-1.05
4.00	2.35	3.00	-1.00
5.00	2.44	6.00	-.74
6.00	2.47	9.00	-.49
7.00	2.47	12.00	-.25
8.00	2.45	15.00	-.08
9.00	2.46	18.00	.09
10.00	2.31	21.00	.14
12.00	2.01	24.00	.05
15.00	1.52	25.00	0
18.00	1.02		
21.00	.58		
24.00	.14		
25.00	0		

L.E. radius: 0.870
L.E. radius center: 0.260 above flap chord line
Dimension a: 0.500

NATIONAL ADVISORY
COMMITTEE FOR AERONAUTICS

TABLE 15

ORDINATES FOR 0.056-CHORD FORE FLAP

[Stations and ordinates given from fore-flap chord line in percent airfoil chord]

Station	Upper ordinate	Lower ordinate
0	0	0
.42	.82	----
.83	1.10	----
1.25	1.25	-.85
1.67	1.31	-.59
2.08	1.31	-.33
2.50	1.27	-.15
3.33	1.10	.10
3.75	.97	.16
4.17	.81	.19
4.58	.61	.18
5.00	.40	.13
5.42	.15	.05
5.625	0	0

L.E. radius: 0.90
(on chord line)

TABLE 16

ORDINATES FOR 0.075-CHORD FORE FLAP

[Stations and ordinates given from fore-flap chord line in percent airfoil chord]

Station	Upper ordinate	Lower ordinate
0	0	0
.42	.95	-.93
.83	1.31	-1.14
1.25	1.52	-1.20
1.67	1.62	-1.11
2.08	1.72	-.85
2.92	1.74	-.36
3.75	1.64	-.02
4.58	1.43	.18
5.42	1.13	.27
6.25	.75	.25
7.08	.28	.11
7.50	0	0

L.E. radius: 1.20
(on chord line)

TABLE 17

ORDINATES FOR 0.100-CHORD FORE FLAP

[Stations and ordinates given from fore-flap chord line in percent airfoil chord]

Station	Upper ordinate	Lower ordinate
0	0	0
.50	1.12	-----
1.00	1.53	-----
1.50	1.81	-----
2.00	2.01	-----
2.50	2.14	-1.10
3.00	2.21	-.71
4.00	2.24	-.15
5.00	2.14	.22
6.00	1.94	.44
7.00	1.60	.51
8.00	1.16	.45
9.00	.62	.27
10.00	0	0

L.E. radius: 1.50
(on chord line)

NATIONAL ADVISORY
COMMITTEE FOR AERONAUTICS

64-208

63-210   64-210   65-210   66-210

64₁-212

1410
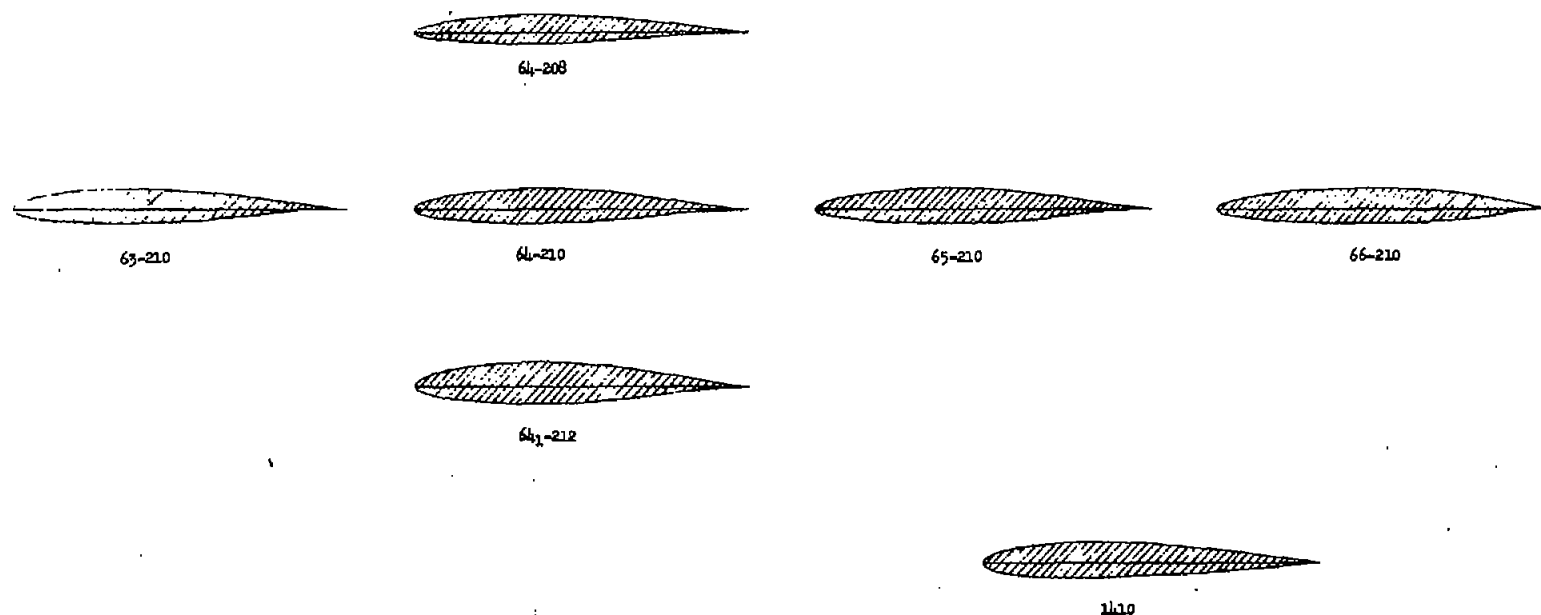
NATIONAL ADVISORY
COMMITTEE FOR AERONAUTICS

Figure 1.- Profiles of NACA airfoil sections tested with double slotted flaps.
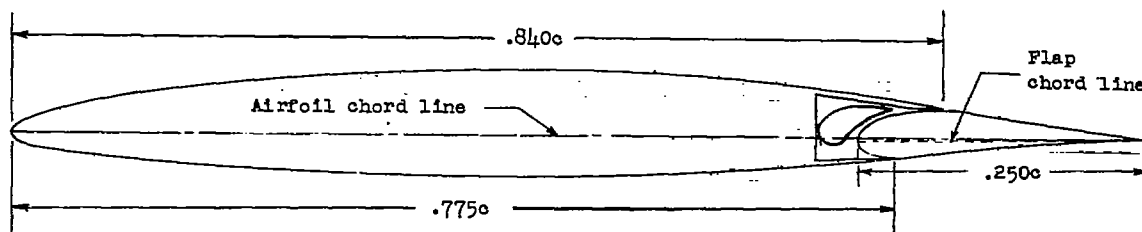
(a) Airfoil with flap.
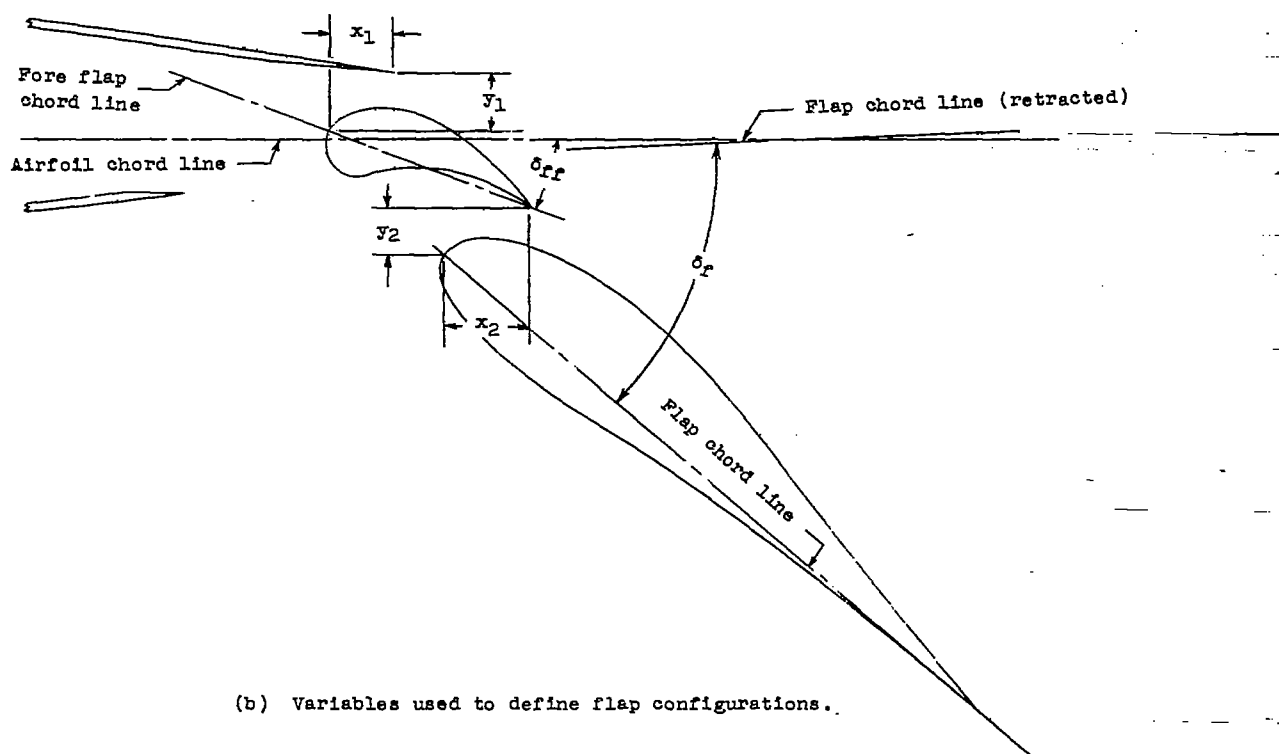
(b) Variables used to define flap configurations.

Figure 2 .- Typical airfoil and flap configuration.

NACA TN No. 1545

.056c

.075c

.100c
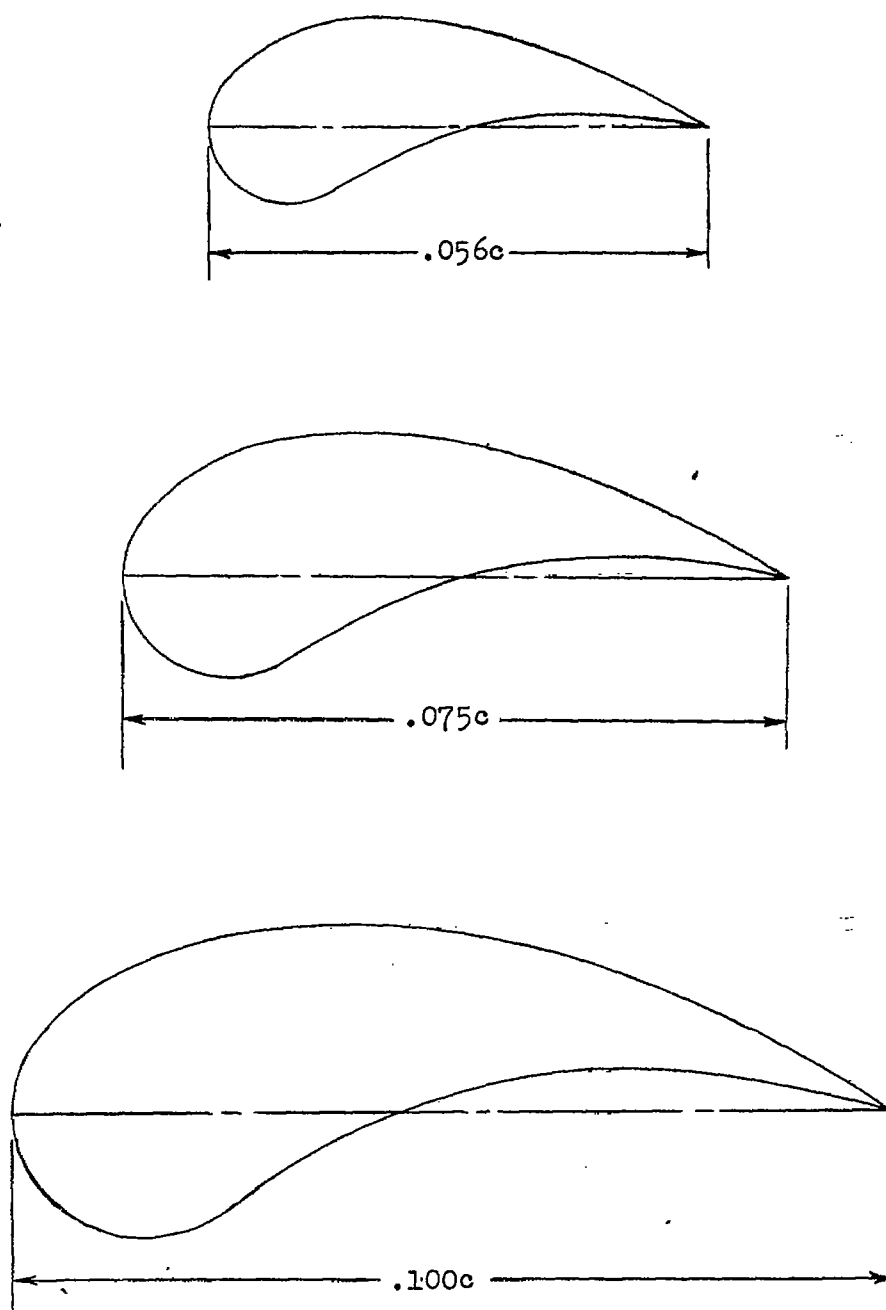
NATIONAL ADVISORY
COMMITTEE FOR AERONAUTICS

Figure 3 .- Profiles of the three fore flaps tested
in combination with 0.250c slotted flaps.
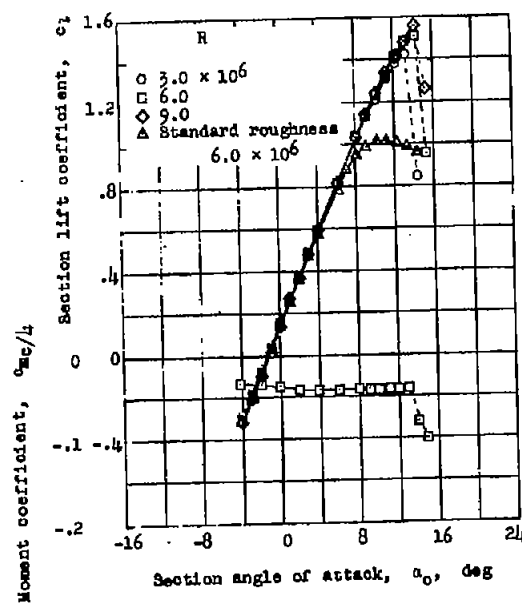
(a) Plain airfoil.
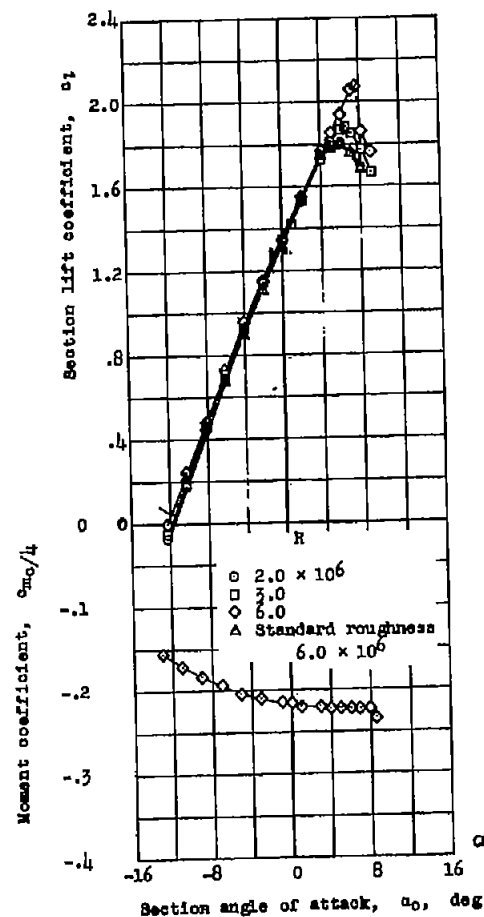
(b) Airfoil with split flap. $\delta_f = 60^\circ$.

Figure 4.- Section lift and pitching-moment characteristics of the NACA 63-210 airfoil section with and without a 0.20c split flap.

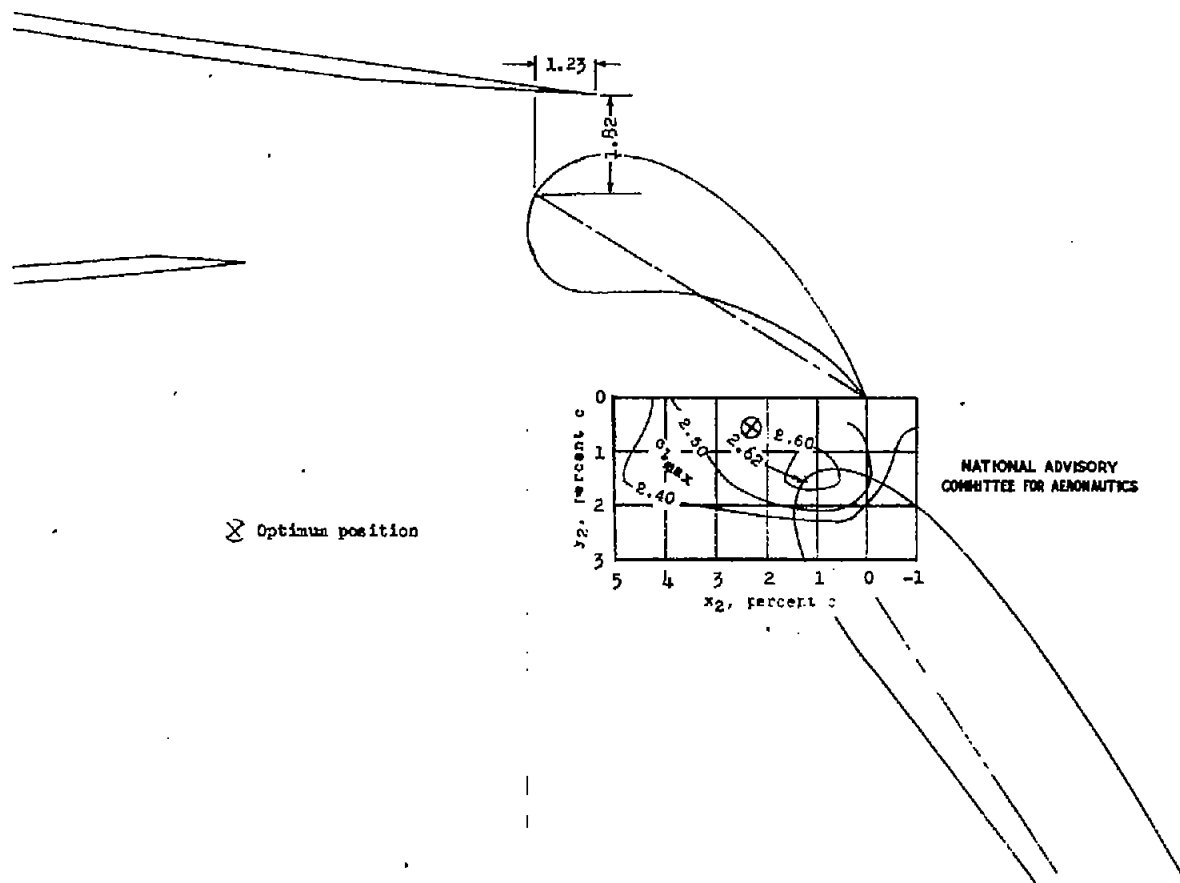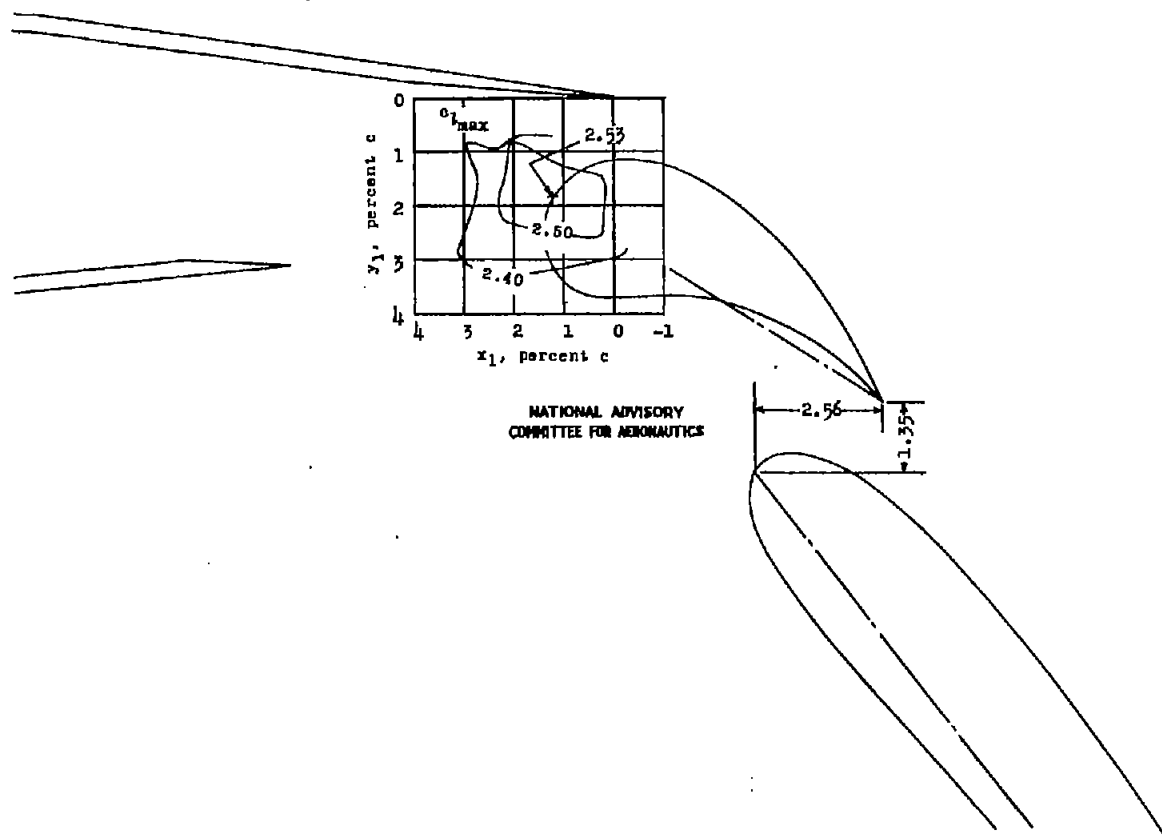⊗ Optimum position
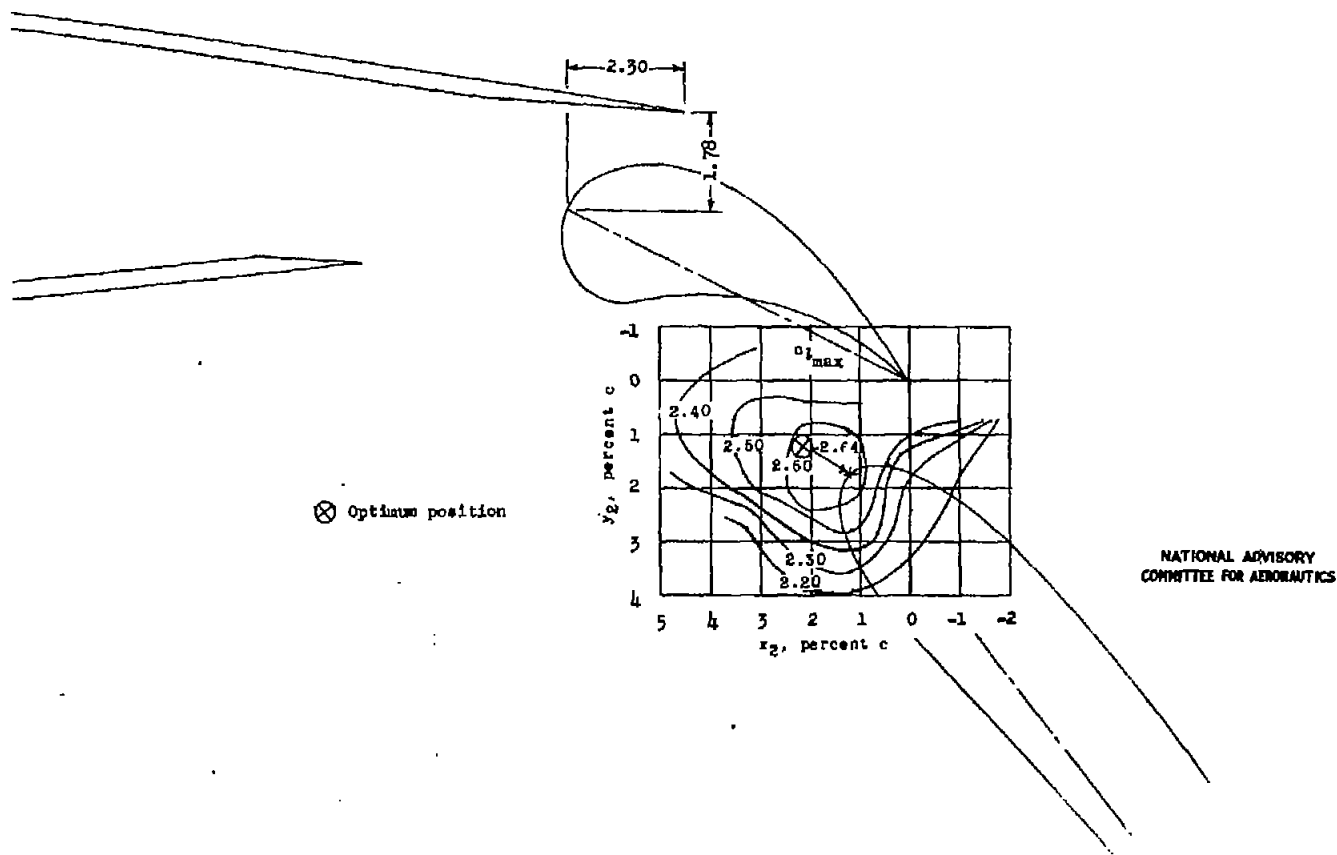
(a) $\delta_f = 50°$; $\delta_{ff} = 25°$.

Figure 5.- Contours of flap position for maximum lift of the NACA 63-210 airfoil section with a double slotted flap; 0.075c fore flap; 0.250c flap. $R = 2.4 \times 10^6$.

⊗ Optimum position

$c_{l_{max}}$

NATIONAL ADVISORY
COMMITTEE FOR AERONAUTICS

(b) $\delta_f = 50°$; $\delta_{ff} = 30°$.

Figure 5 .– Continued.

NACA 63-210

23

⊗ Optimum position

2.36

1.69

$c_{l_{max}}$

2.56

2.50   ⊗ 2.55

2.40

2.30

y_2, percent c

-1 0 1 2 3 4

x_2, percent c

5 4 3 2 1 0 -1 -2

NATIONAL ADVISORY
COMMITTEE FOR AERONAUTICS
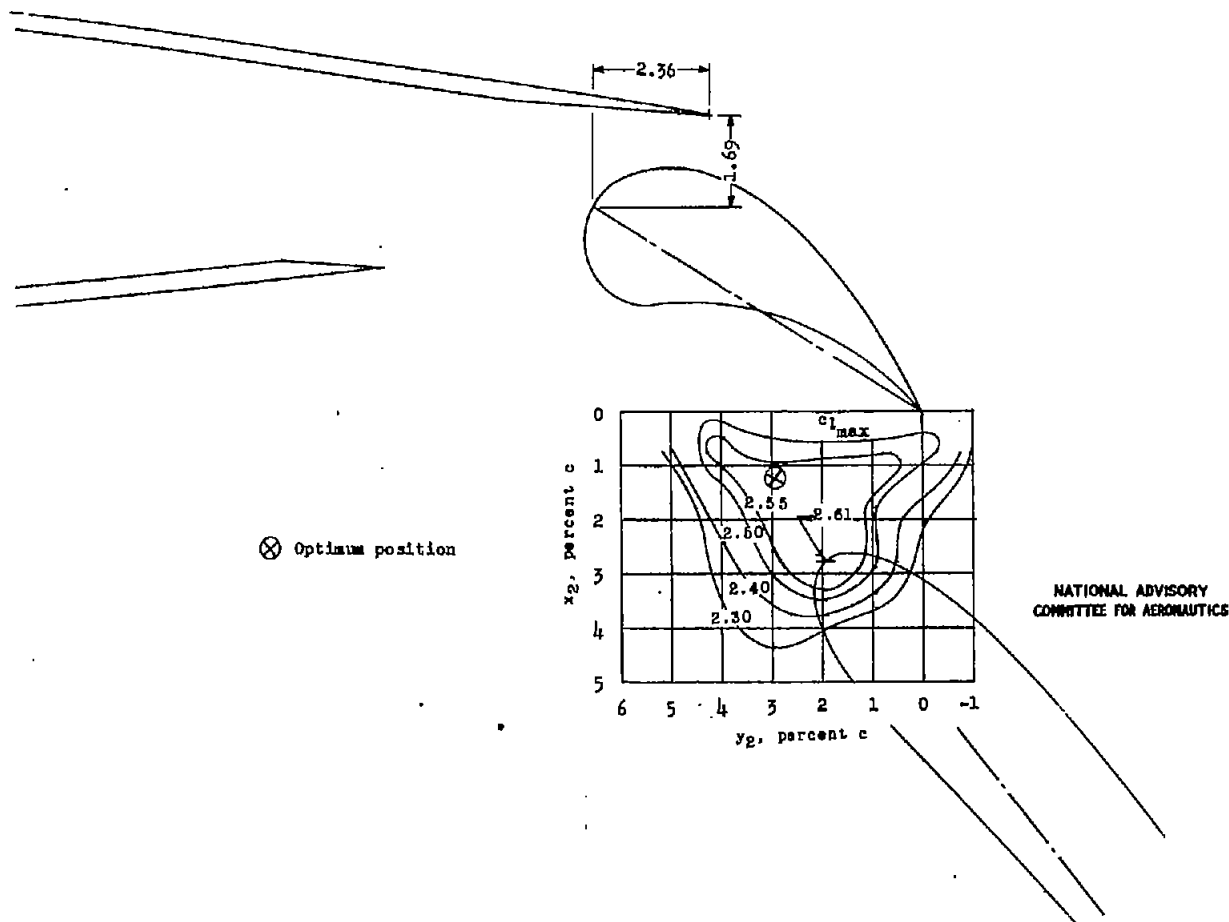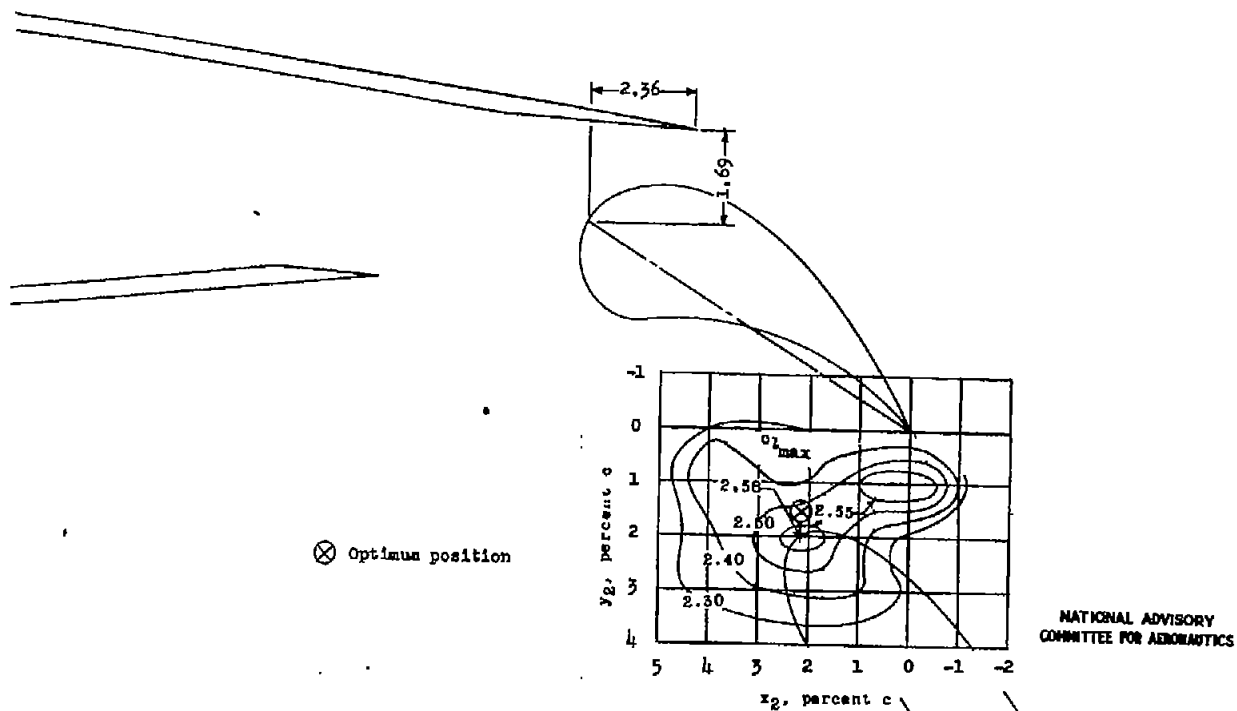
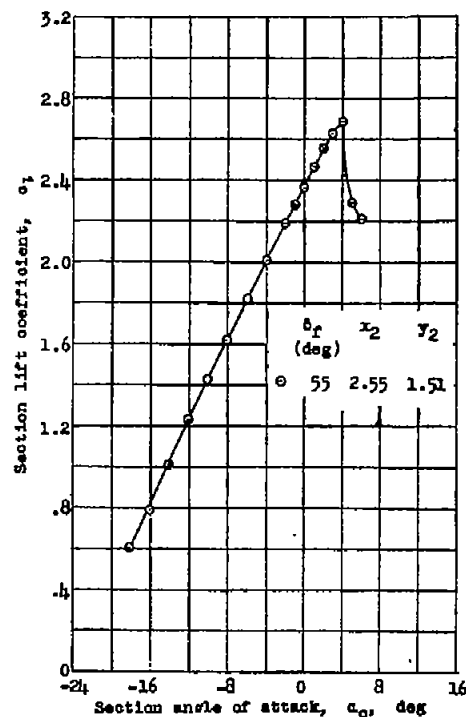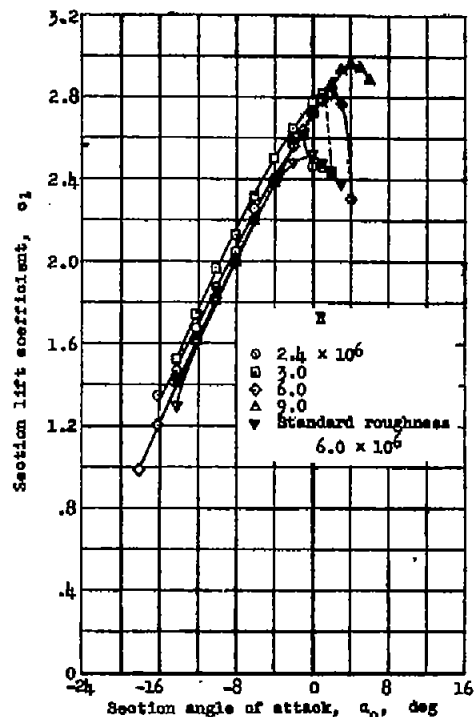(a) $\delta_f = 55^\circ$; $\delta_{ff} = 50^\circ$.

Figure 5 .- Concluded.
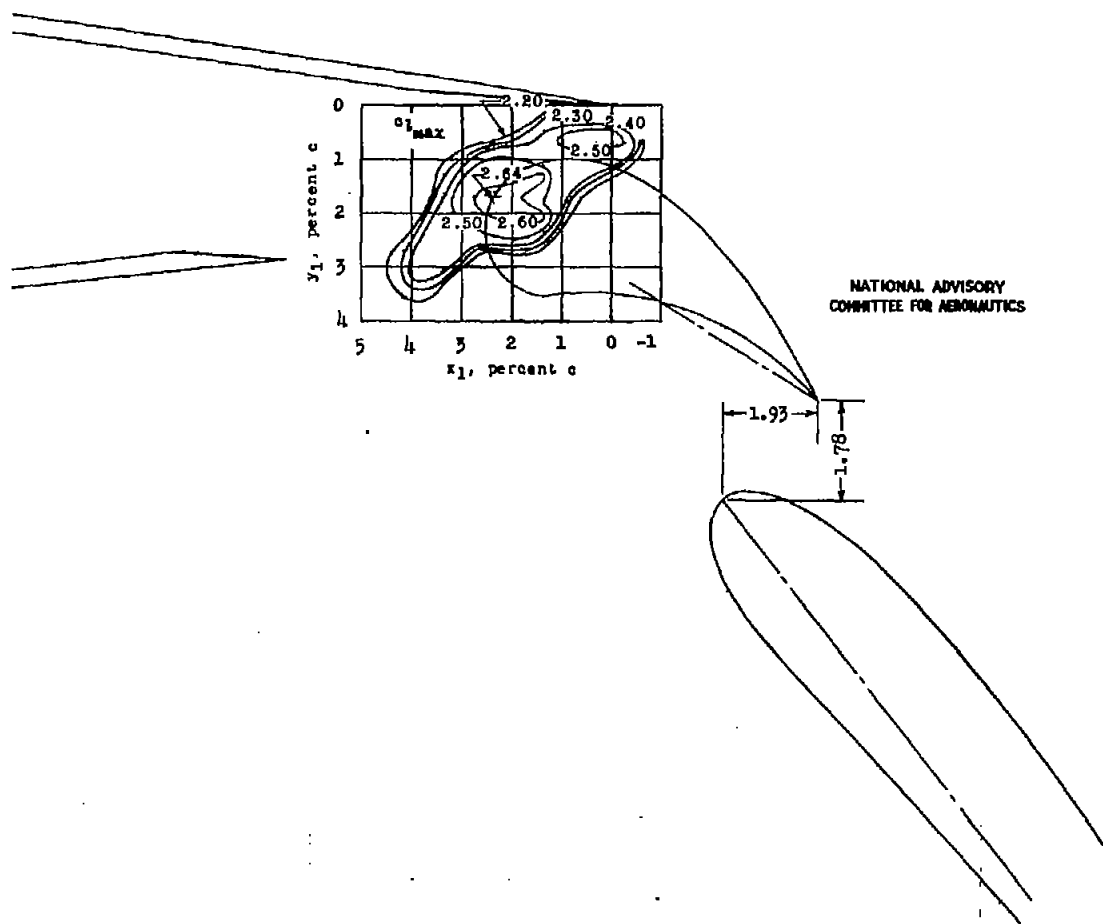
Figure 6.- Contours of flap and fore-flap position for maximum lift of the NACA 63-210 airfoil section with a double slotted flap; 0.075c fore flap; 0.250c flap. $\delta_f = 50^\circ$; $\delta_{ff} = 30^\circ$; $R = 2.4 \times 10^6$.
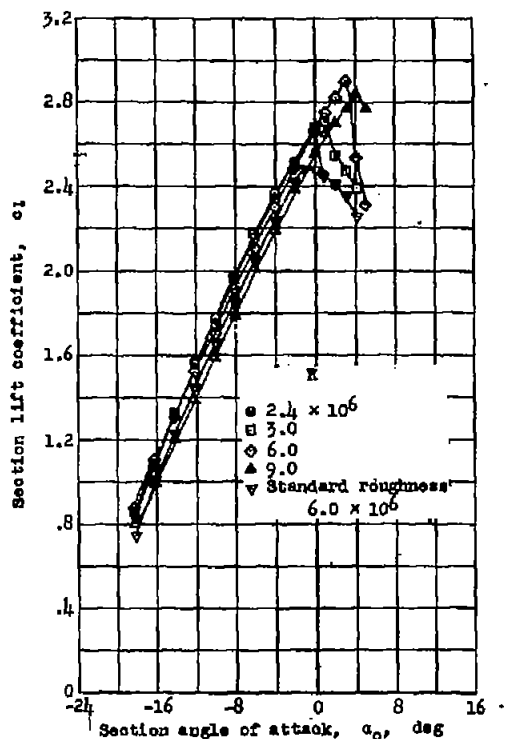
(a) $\delta_{ff} = 25^\circ$; $\delta_f = 50^\circ$. $x_1 = 2.30$; $y_1 = 1.78$; $x_2 = 2.17$; $y_2 = 1.23$.

δ_{ff} (deg)	δ_f (deg)	x_1	y_1	x_2	y_2
⊙ 25	50	2.30	1.78	2.17	1.23
▣ 30	50	2.36	1.69	2.93	1.28
◇ 30	55	2.36	1.69	2.18	1.50
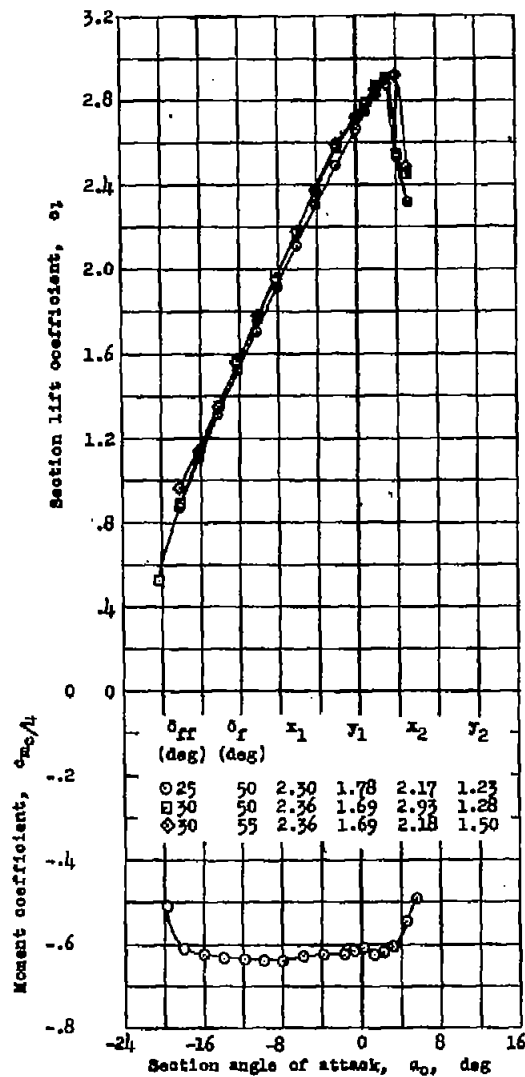
(b) $R = 6.0 \times 10^6$.

Figure 7.- Section lift and pitching-moment characteristics of the NACA 63-210 airfoil section with a double slotted flap. 0.075c fore flap; 0.250c flap.
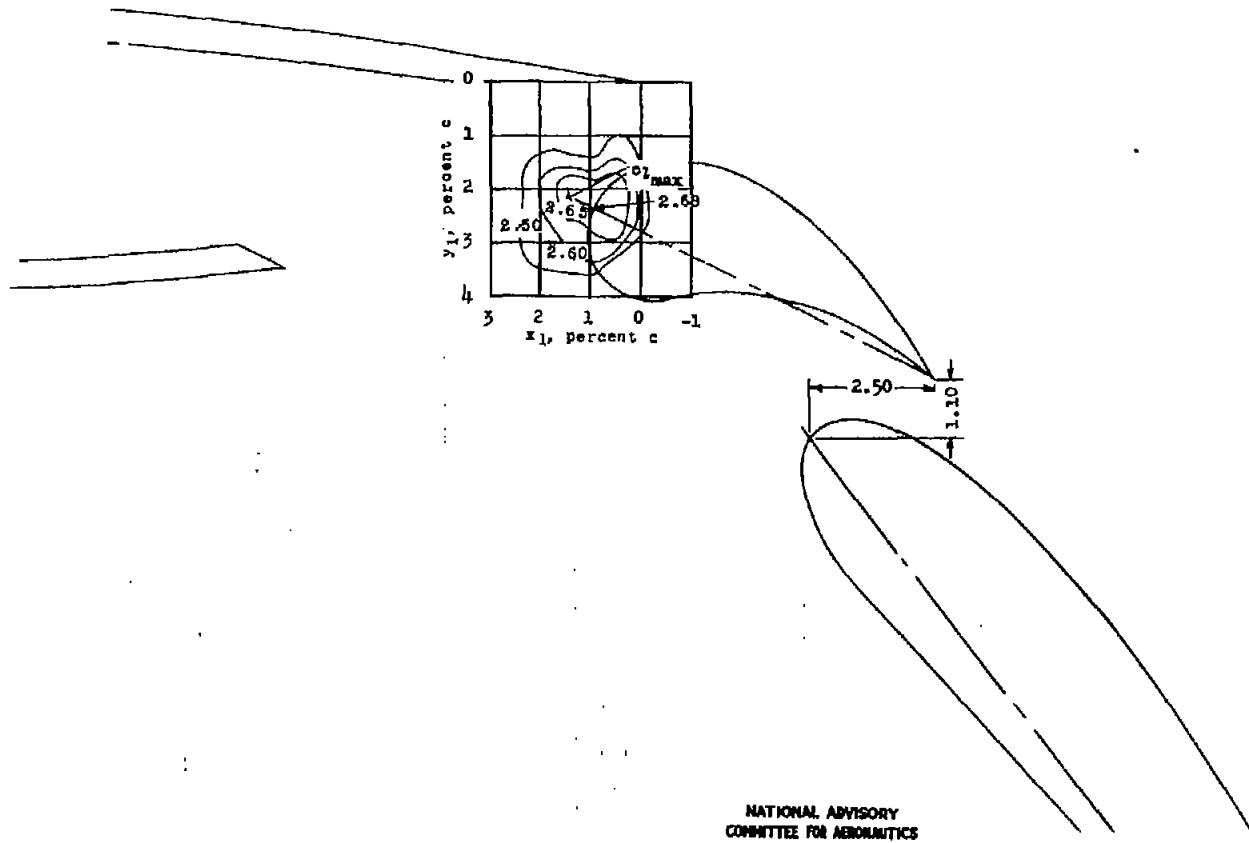
NATIONAL ADVISORY
COMMITTEE FOR AERONAUTICS

NACA TN No. 1545

NACA 63-210

(a) Plain airfoil.

(b) Airfoil with split flap; $\delta_f = 60°$.
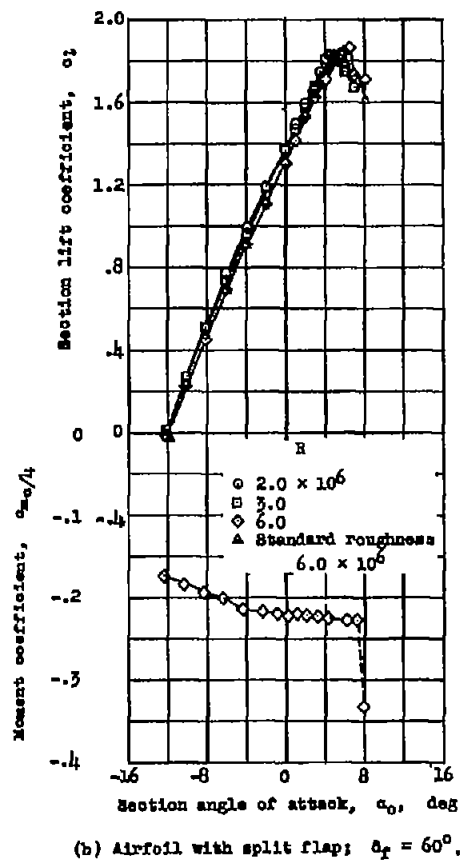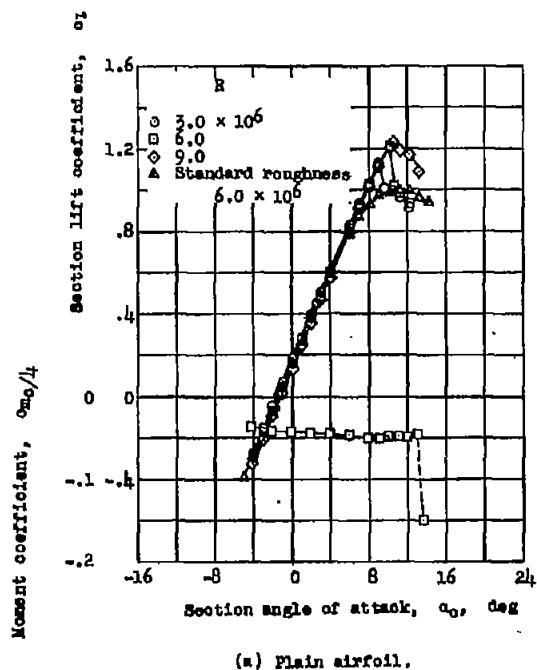
Figure 8.- Section lift and pitching-moment characteristics of the NACA 64-208 airfoil section with and without a 0.20c split flap.

NATIONAL ADVISORY
COMMITTEE FOR AERONAUTICS

⊗ Optimum position

1.39
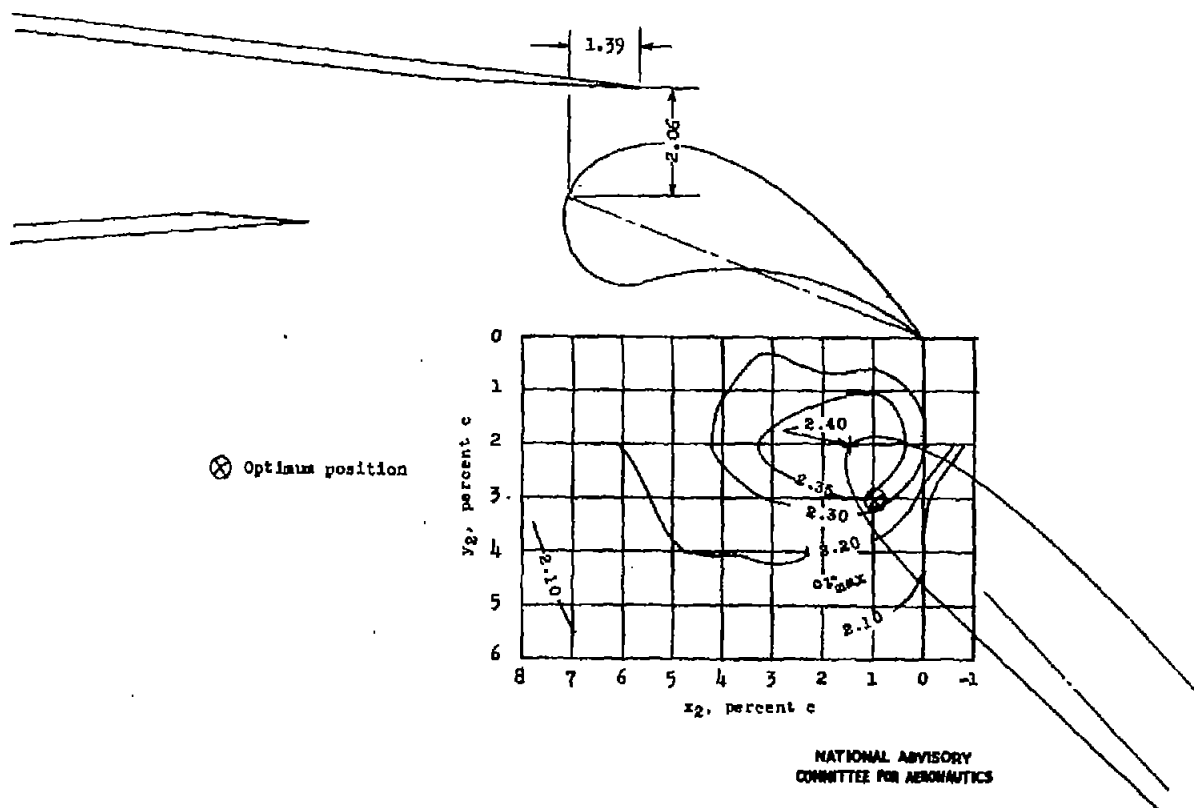
(a) $\delta_f = 49°$; $\delta_{ff} = 20°$.

Figure 9.- Contours of flap position for maximum lift of the NACA 64-208 airfoil section with a double slotted flap; 0.075c fore flap; 0.250c flap.   R = 2.4 × 10⁶.

NATIONAL ADVISORY
COMMITTEE FOR AERONAUTICS

(b) $\delta_f = 45°$; $\delta_{ff} = 25°$.

Figure 9 .- Continued.

1.43

1.97

$\otimes$ Optimum position

$c_{l_{max}}$

y_2, percent c

0

1

2

3

5   4   3   2   1   0   -1

x_2, percent c

2.45   2.40

2.30
2.20
2.10
2.00

NATIONAL ADVISORY
COMMITTEE FOR AERONAUTICS

(c) $\delta_f = 50°$; $\delta_{ff} = 25°$.

Figure 9 .- Continued.

1.48

1.88

⊗ Optimum position

$c_{l_{max}}$

2.44
2.40
2.30
2.20
2.10

2.10

y_2, percent c

0
1
2
3
4
5

7   6   5   4   3   2   1   0   -1

x_2, percent c

NATIONAL ADVISORY
COMMITTEE FOR AERONAUTICS

(d) $\delta_f = 45°$; $\delta_{ff} = 30°$.

Figure 9 .- Continued.

1.48

1.88

⊗ Optimum position

$c_{l_{max}}$

2.10
2.20

2.10

2.30
2.20
2.10

2.45
2.40

y_2, percent c

NATIONAL ADVISORY
COMMITTEE FOR AERONAUTICS

x_2, percent c

-1
0
1
2
3
4

6 5 4 3 2 1 0

(e) $\delta_f = 50°$; $\delta_{ff} = 30°$.

Figure 9 .- Continued.

1.48

.88

$c_{l_{max}}$

y_2, percent c

2.46

2.40

2.30

2.20

2.10

x_2, percent c

NATIONAL ADVISORY
COMMITTEE FOR AERONAUTICS

⊗ Optimum position
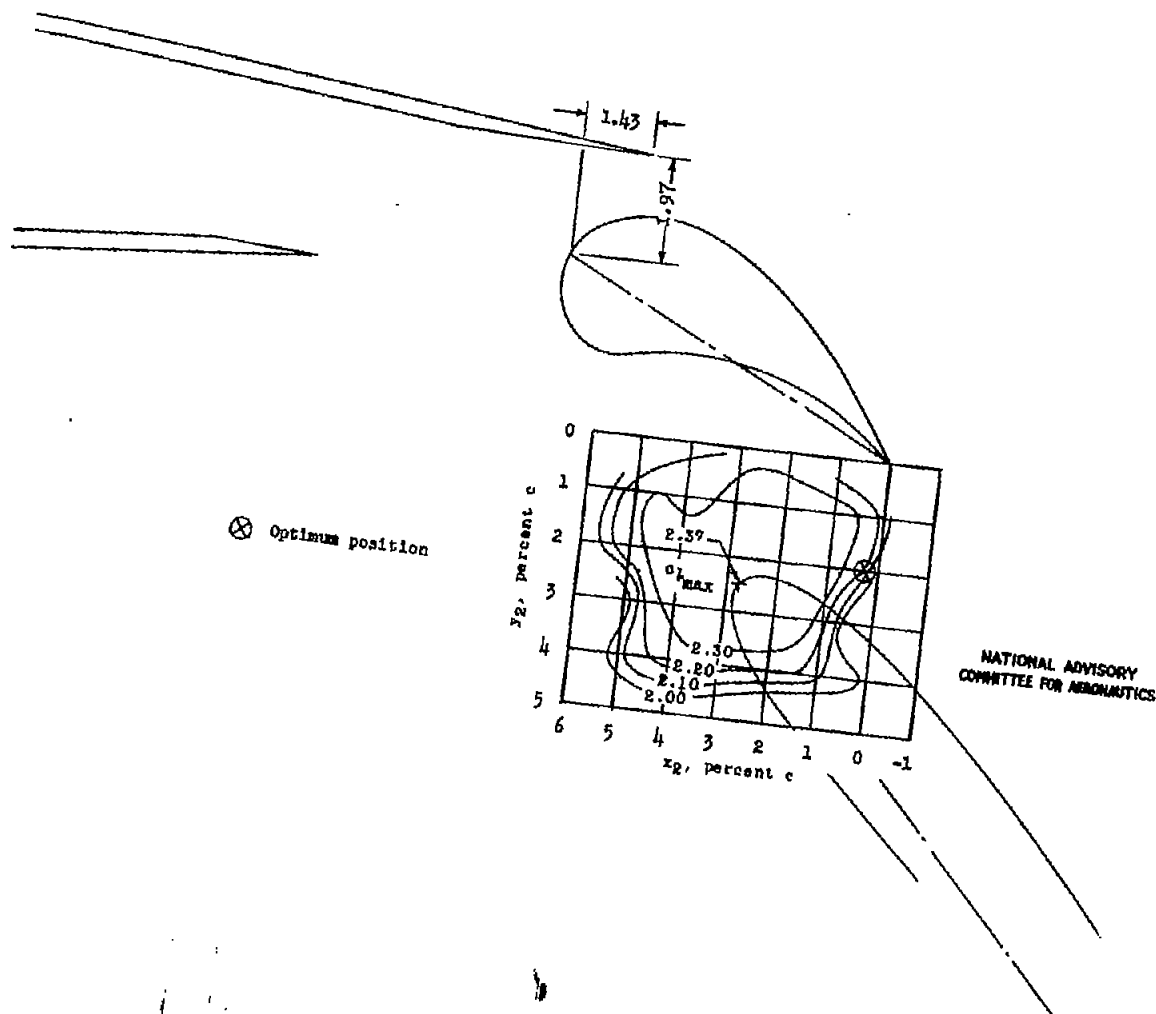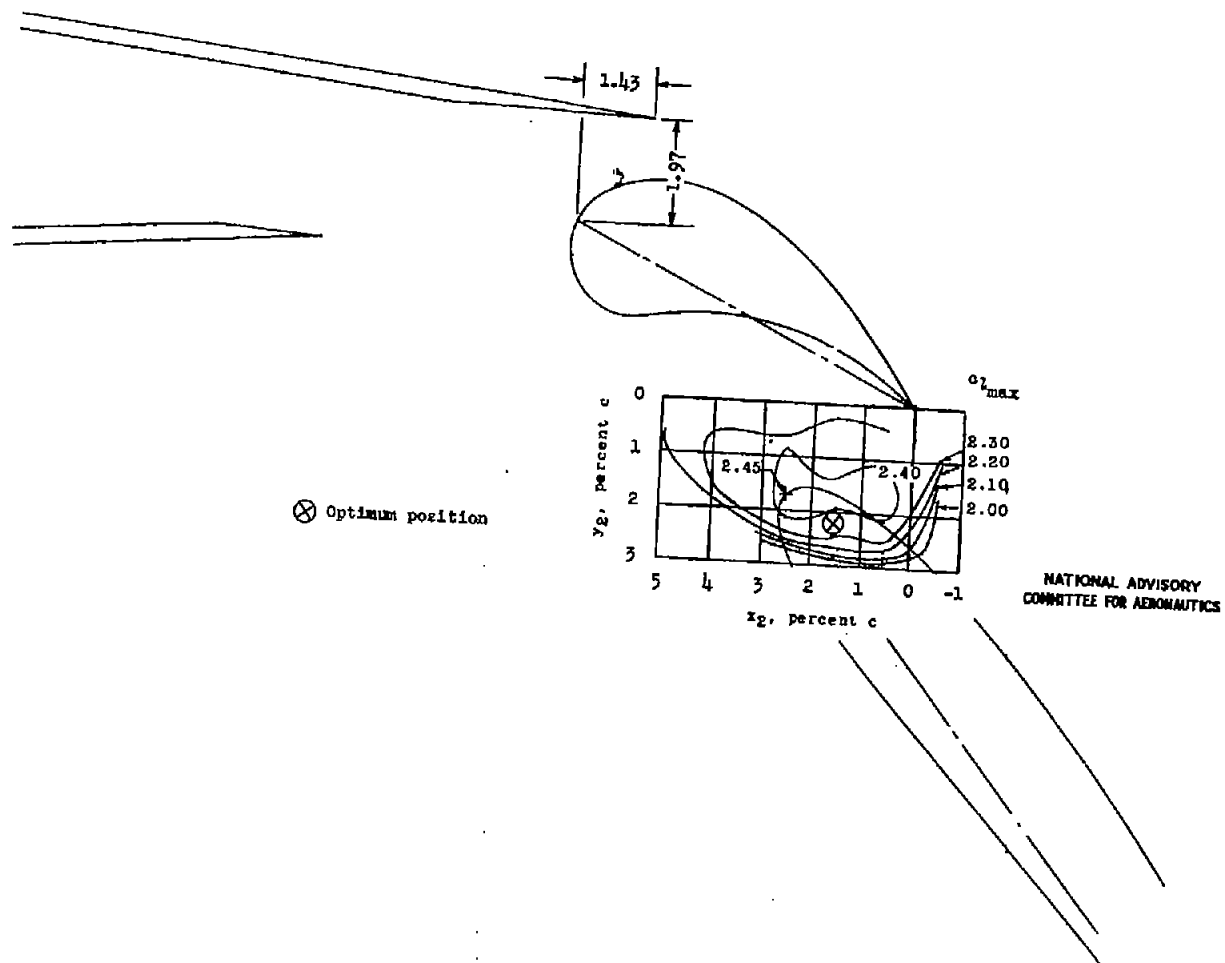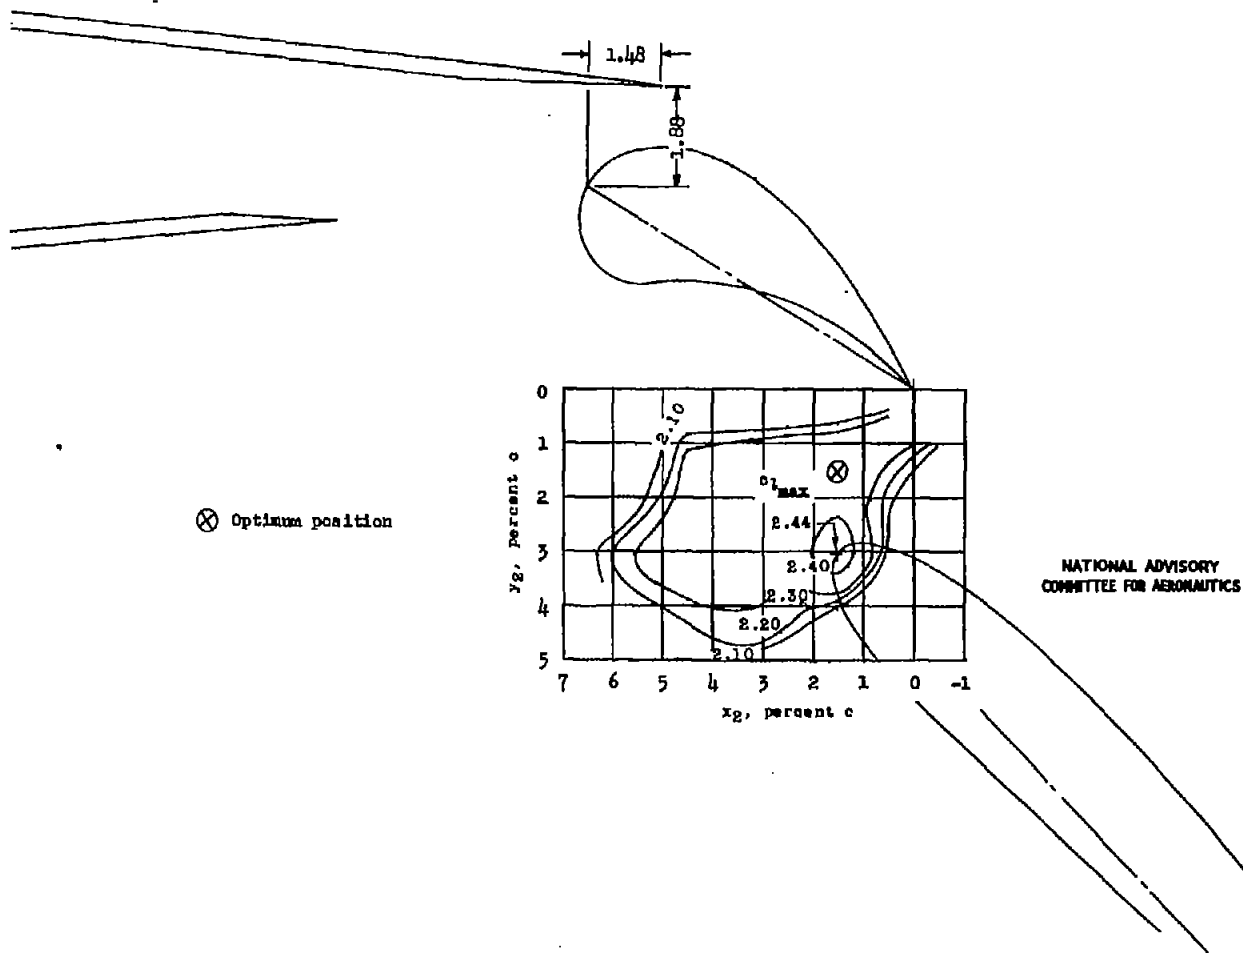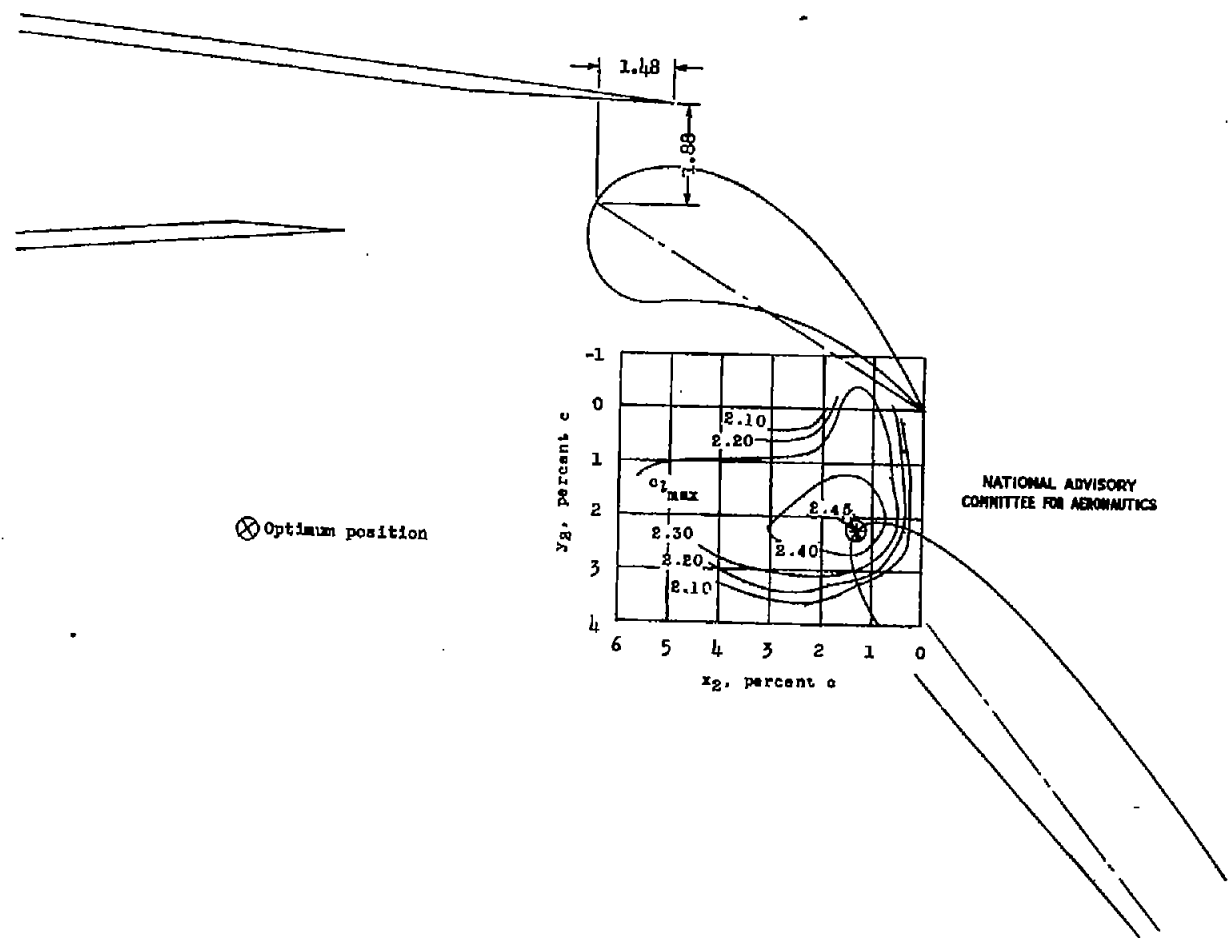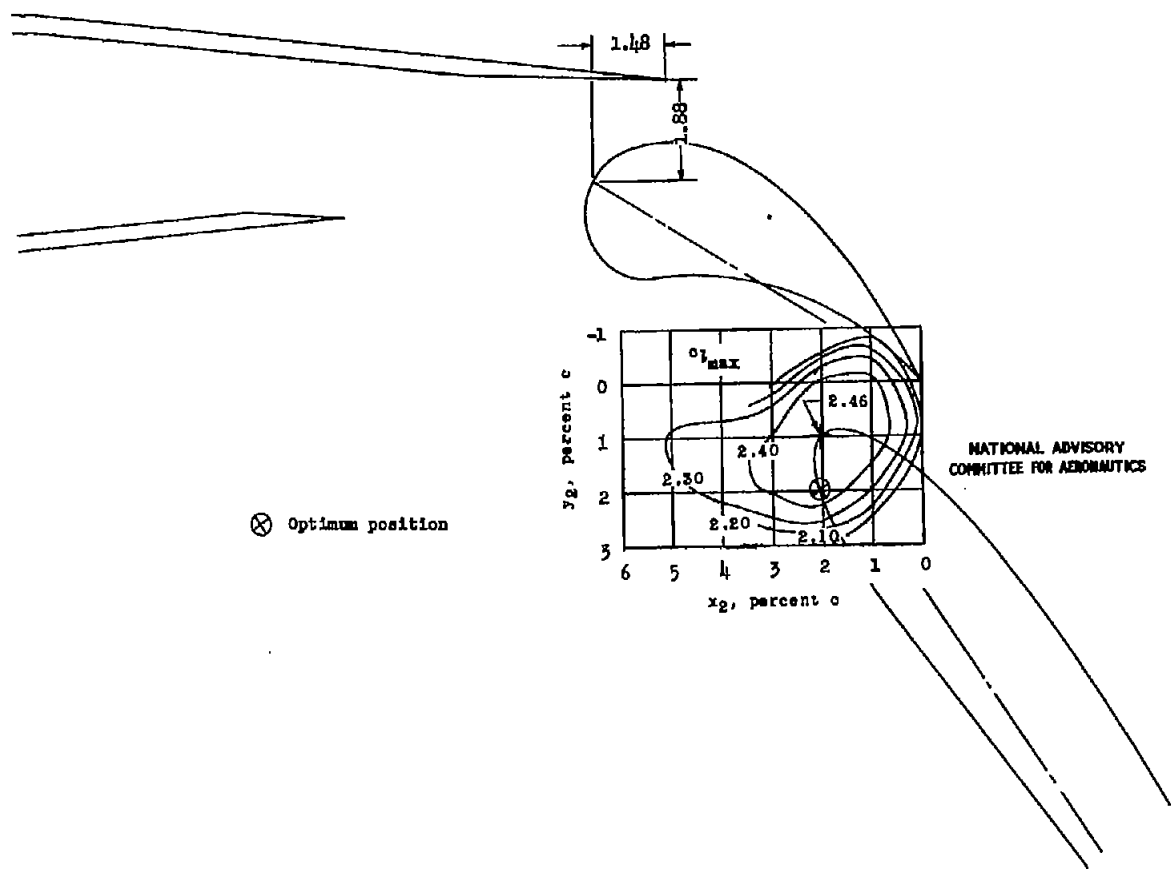
(f) $\delta_f = 55°$; $\delta_{ff} = 30°$.

Figure 9 .- Concluded.

Figure 10.— Contours of flap and fore-flap position for maximum lift of the NACA 64-208 airfoil section with a double slotted flap; 0.075c fore flap; 0.250c flap. $\delta_f = 45°$; $\delta_{ff} = 25°$; $R = 2.4 \times 10^6$.
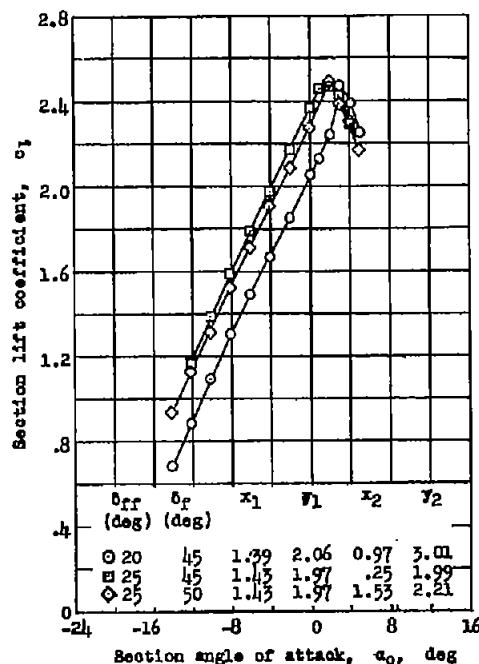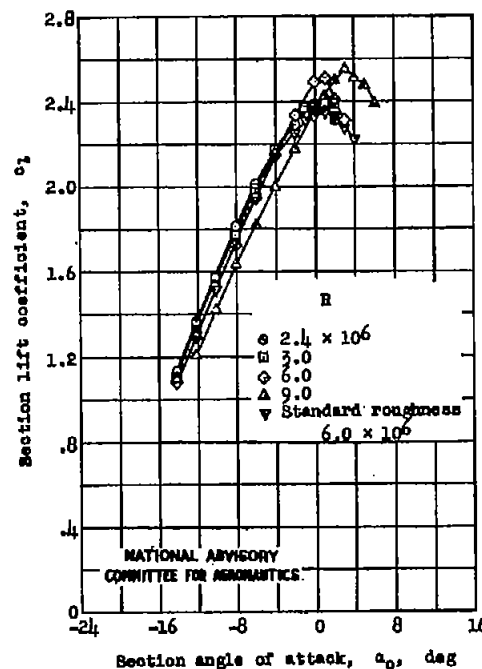
(a) $R = 6.0 \times 10^6$.

(b) $\delta_{ff} = 30°$; $\delta_f = 45°$. $x_1 = 1.48$; $y_1 = 1.88$; $x_2 = 1.51$; $y_2 = 1.52$.
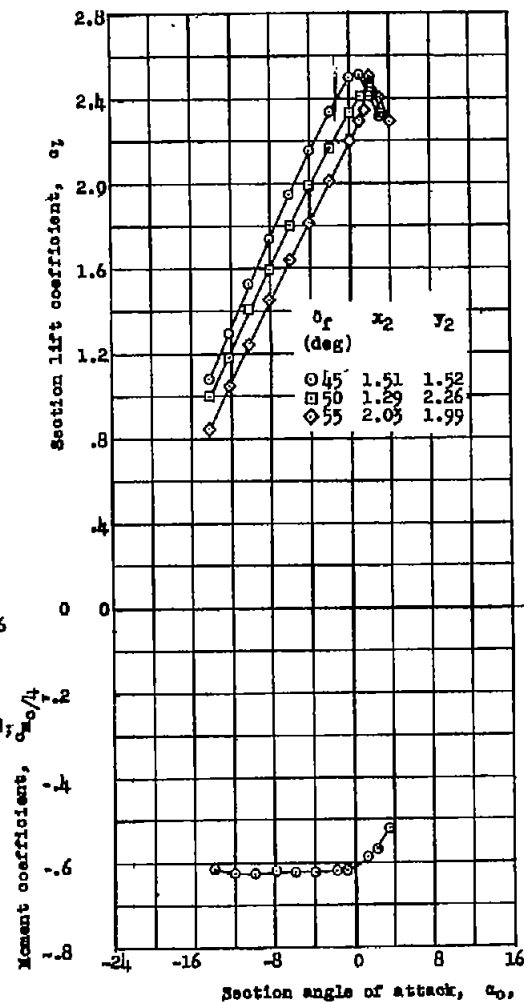
(c) $\delta_{ff} = 30°$; $x_1 = 1.48$; $y_1 = 1.88$; $R = 6.0 \times 10^6$.

Figure 11.- Section lift and pitching-moment characteristics of the NACA 64-208 airfoil section with a double slotted flap; 0.075c fore flap; 0.250c flap.

NACA 64-208

35
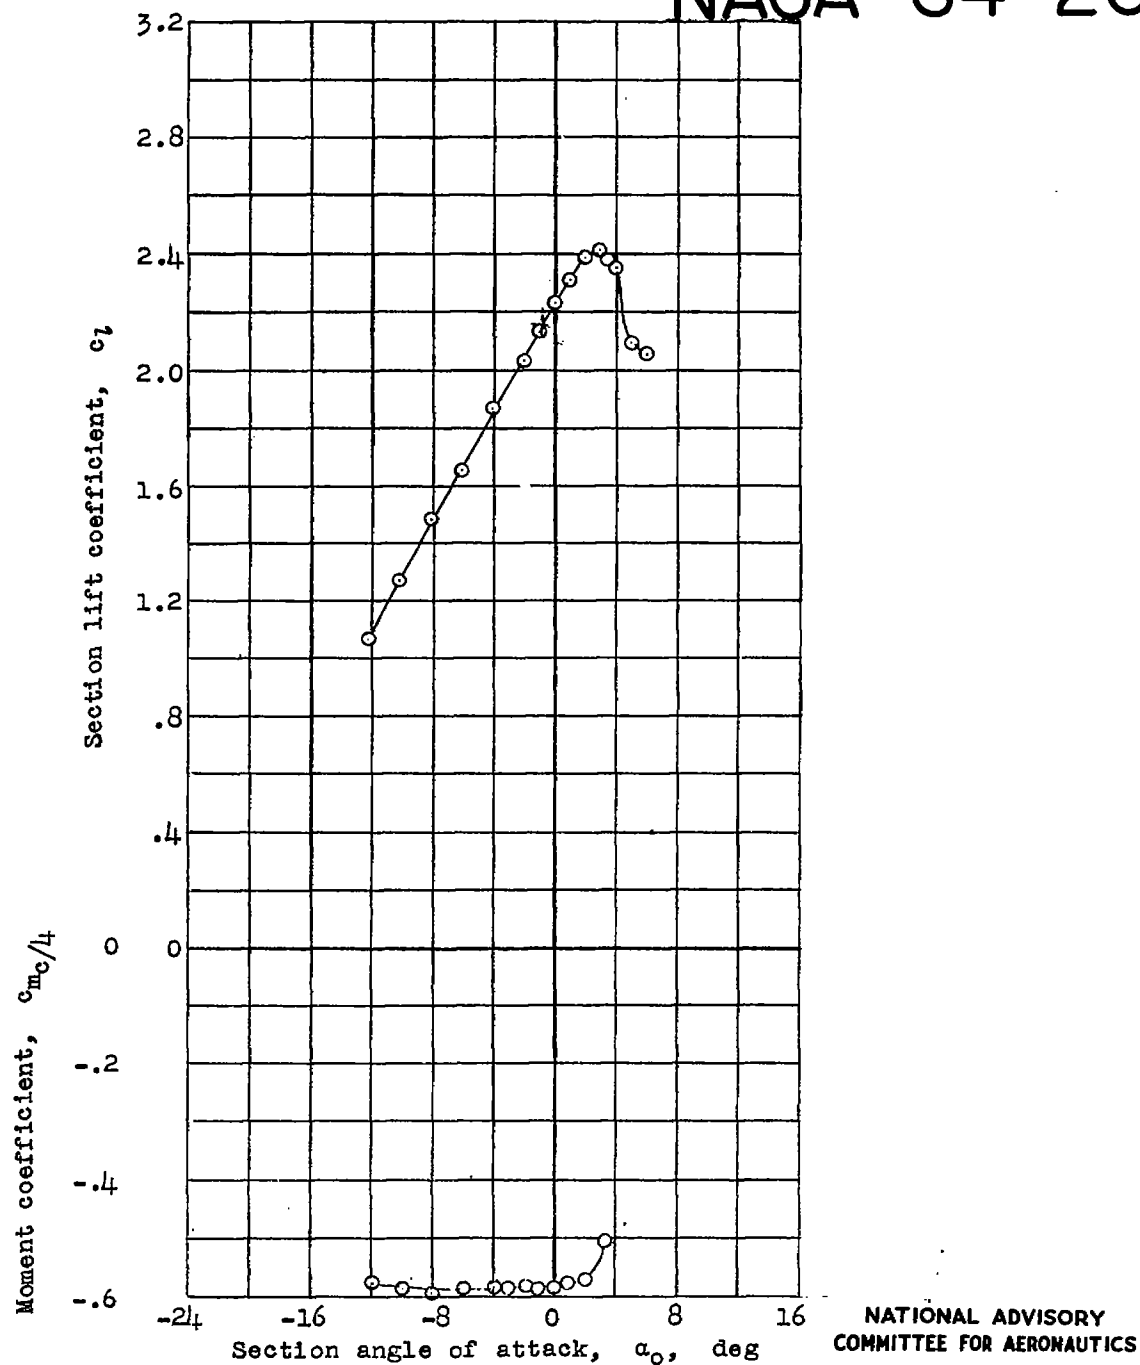
NACA 64-208

Figure 12.- Section lift and pitching-moment characteristics
of the NACA 64-208 airfoil section with a double slotted
flap; 0.056c fore flap; 0.250c flap. $\delta_{ff} = 25°$;
$\delta_f = 50°$; $x_1 = 1.47$; $y_1 = 2.36$; $x_2 = 1.78$; $y_2 = 1.41$;
$R = 6.0 \times 10^6$.
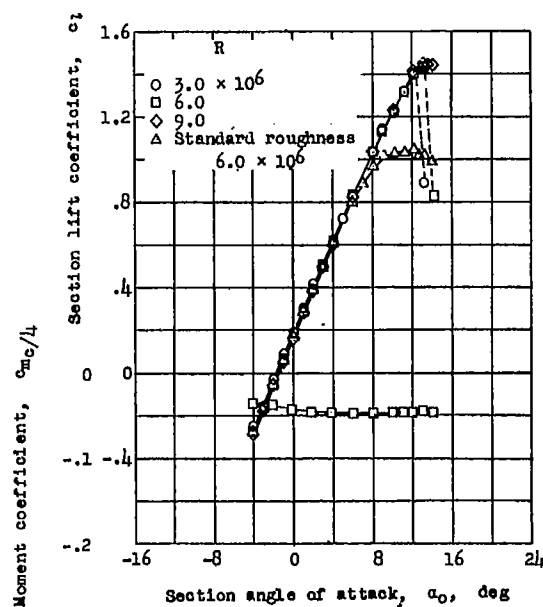
NATIONAL ADVISORY
COMMITTEE FOR AERONAUTICS

(a) Plain airfoil.

NATIONAL ADVISORY
COMMITTEE FOR AERONAUTICS
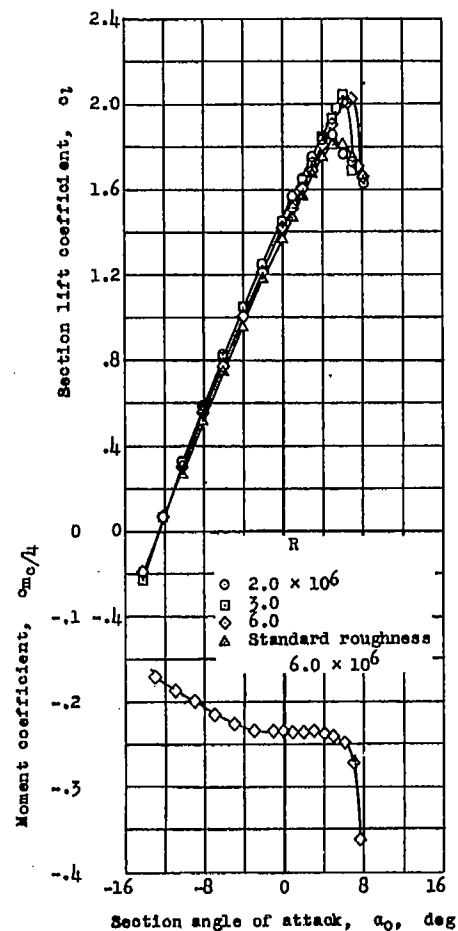
(b) Airfoil with split flap. $\delta_f = 60°$.

Figure 13.- Section lift and pitching-moment characteristics of the NACA 64-210 airfoil section with and without a 0.20c split flap.

NACA 64-210

⊗ Optimum position

NATIONAL ADVISORY
COMMITTEE FOR AERONAUTICS
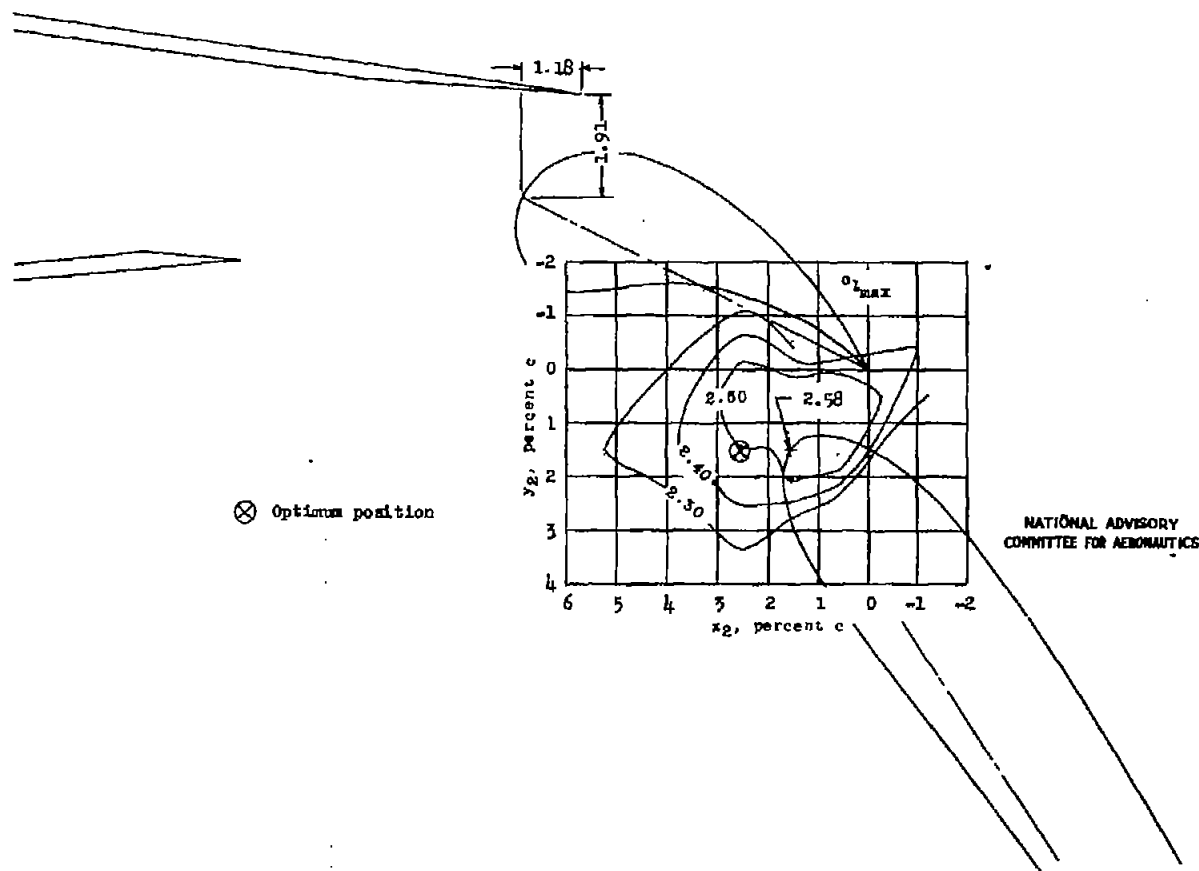
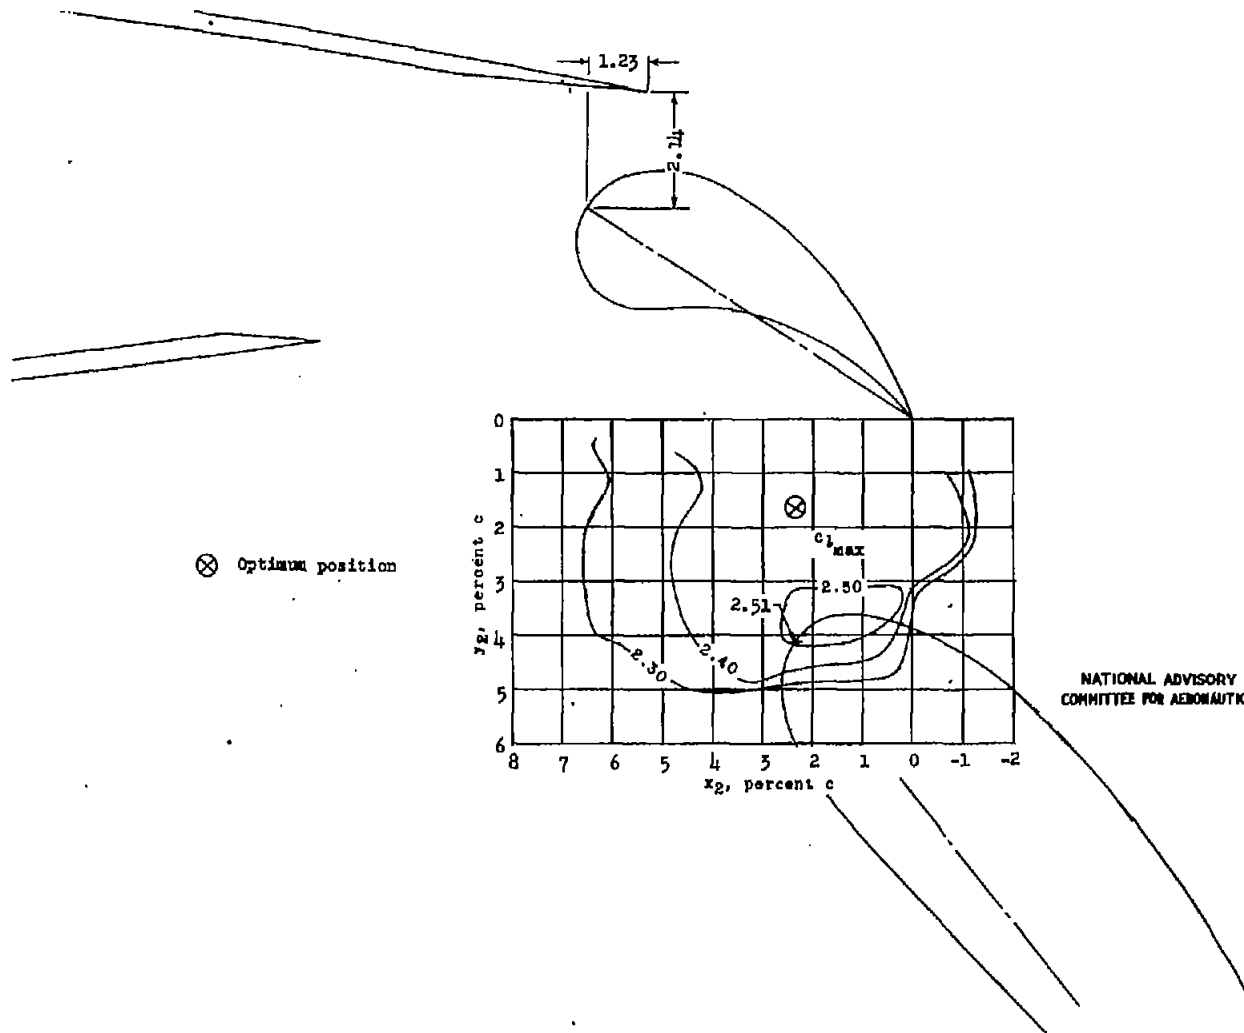(a) $\delta_f = 55°$; $\delta_{ff} = 25°$.

Figure 14.- Contours of flap position for maximum lift of the NACA 64-210 airfoil section with a double slotted flap; 0.075c fore flap; 0.250c flap. R = 2.4 × 10^6.

NACA TN No. 1545

NACA 64-210

⊗ Optimum position

$c_{l_{max}}$

2.60

2.55

2.40

2.30

y_2, percent c

x_2, percent c

1.23

1.82

NATIONAL ADVISORY
COMMITTEE FOR AERONAUTICS

(b) $\delta_f = 50°$; $\delta_{ff} = 30°$.

Figure 14.- Continued.
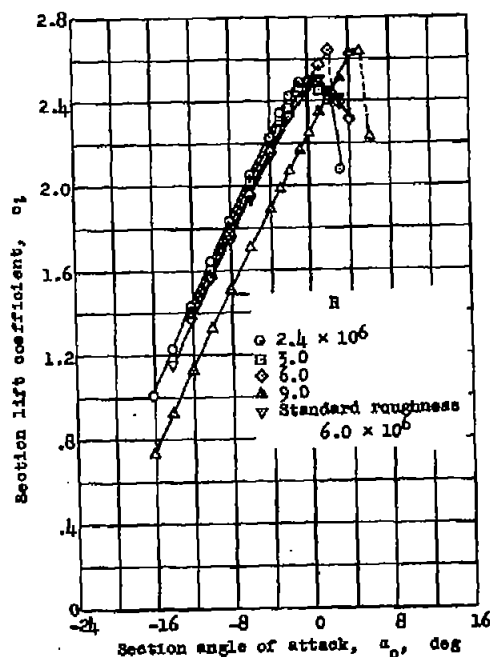
⊗ Optimum position

NATIONAL ADVISORY
COMMITTEE FOR AERONAUTICS

(c) $\delta_f = 55°$; $\delta_{ff} = 30°$.

Figure 14.- Concluded.
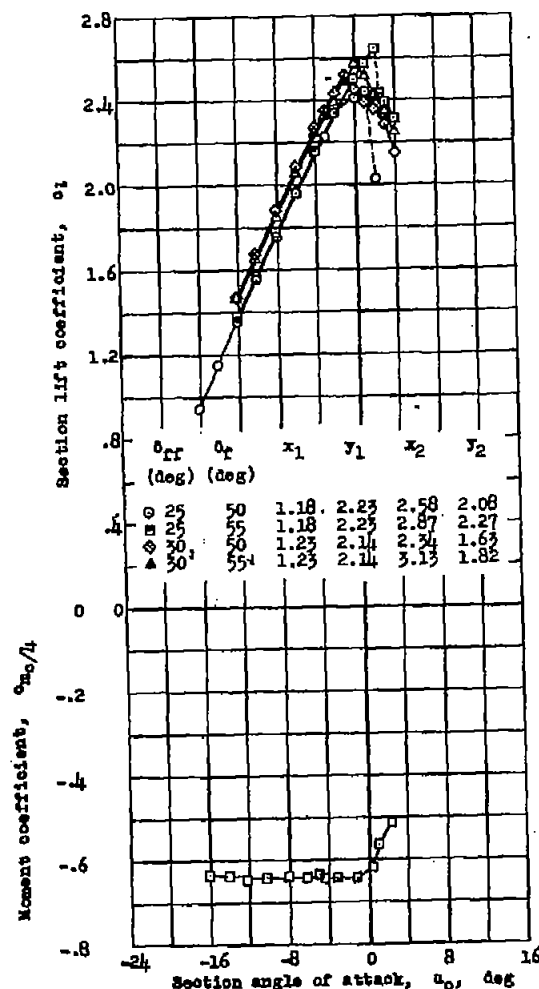
NATIONAL ADVISORY
COMMITTEE FOR AERONAUTICS

Figure 15.- Contours of flap and fore-flap position for maximum lift of the NACA 64-210 airfoil section with a double slotted flap; 0.075c fore flap; 0.250c flap. $\delta_f = 50^0$; $\delta_{ff} = 50^0$; $R = 2.4 \times 10^6$.

(a) $\delta_{ff} = 25°$; $x_1 = 1.18$; $y_1 = 1.91$; $R = 6.0 \times 10^6$.

(b) $\delta_{ff} = 30°$; $\delta_f = 55°$. $x_1 = 1.23$; $y_1 = 1.82$; $x_2 = 2.31$; $y_2 = 0.56$.

NATIONAL ADVISORY
COMMITTEE FOR AERONAUTICS
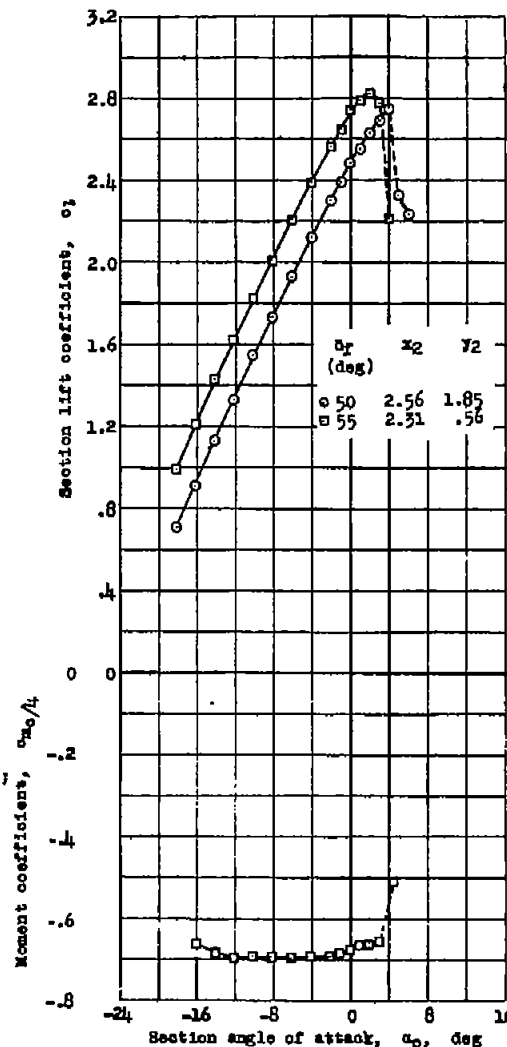
(c) $\delta_{ff} = 30°$; $x_1 = 1.23$; $y_1 = 1.82$; $R = 6.0 \times 10^6$.

Figure 16.— Section lift and pitching-moment characteristics of the NACA 64-210 airfoil section with a double slotted flap; 0.075c fore flap; 0.250c flap.
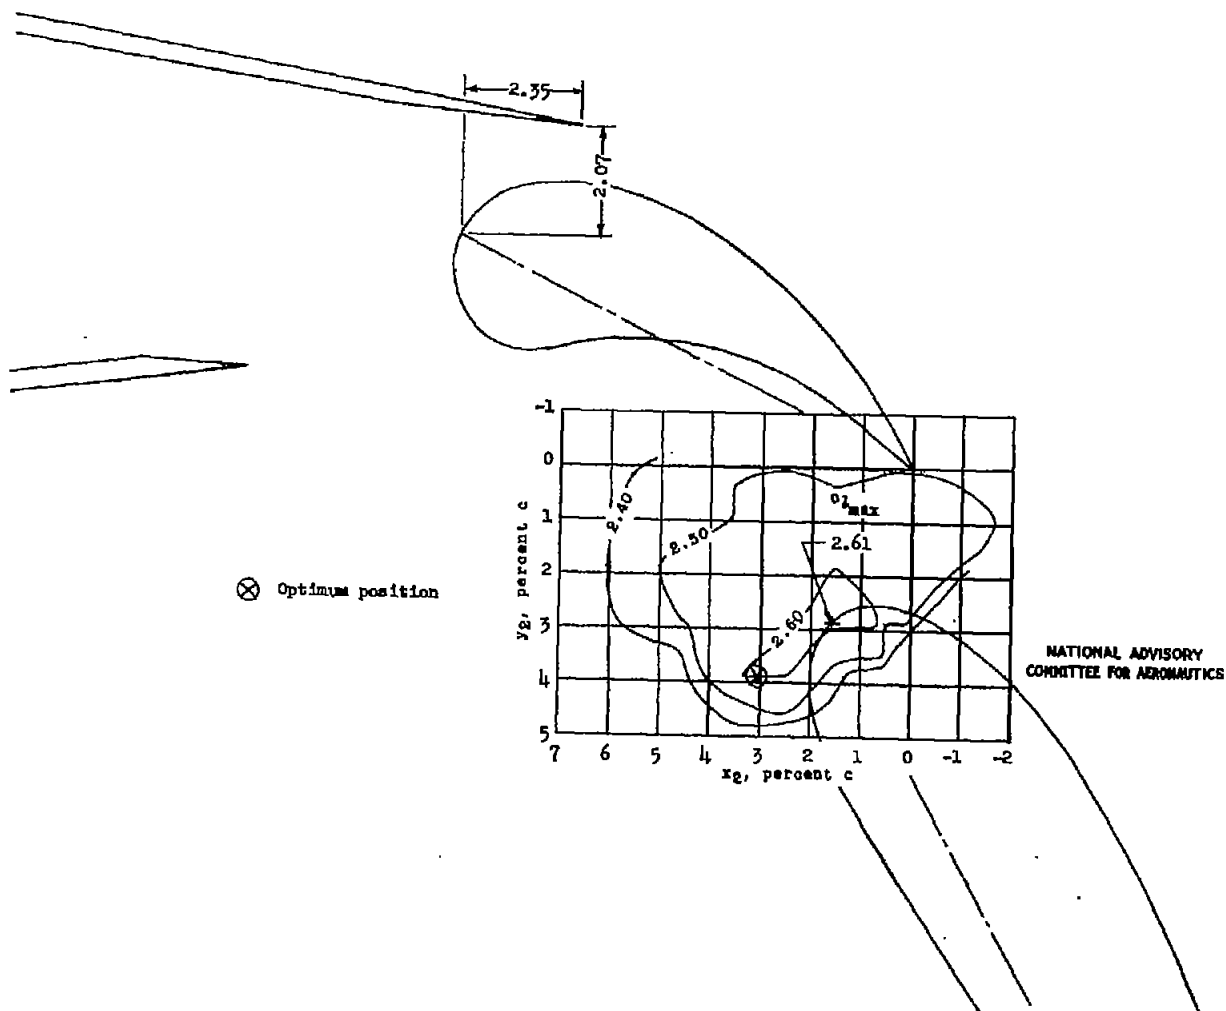
NACA 64-210

NACA TN No. 1545

$\leftarrow$0.90

-1.90
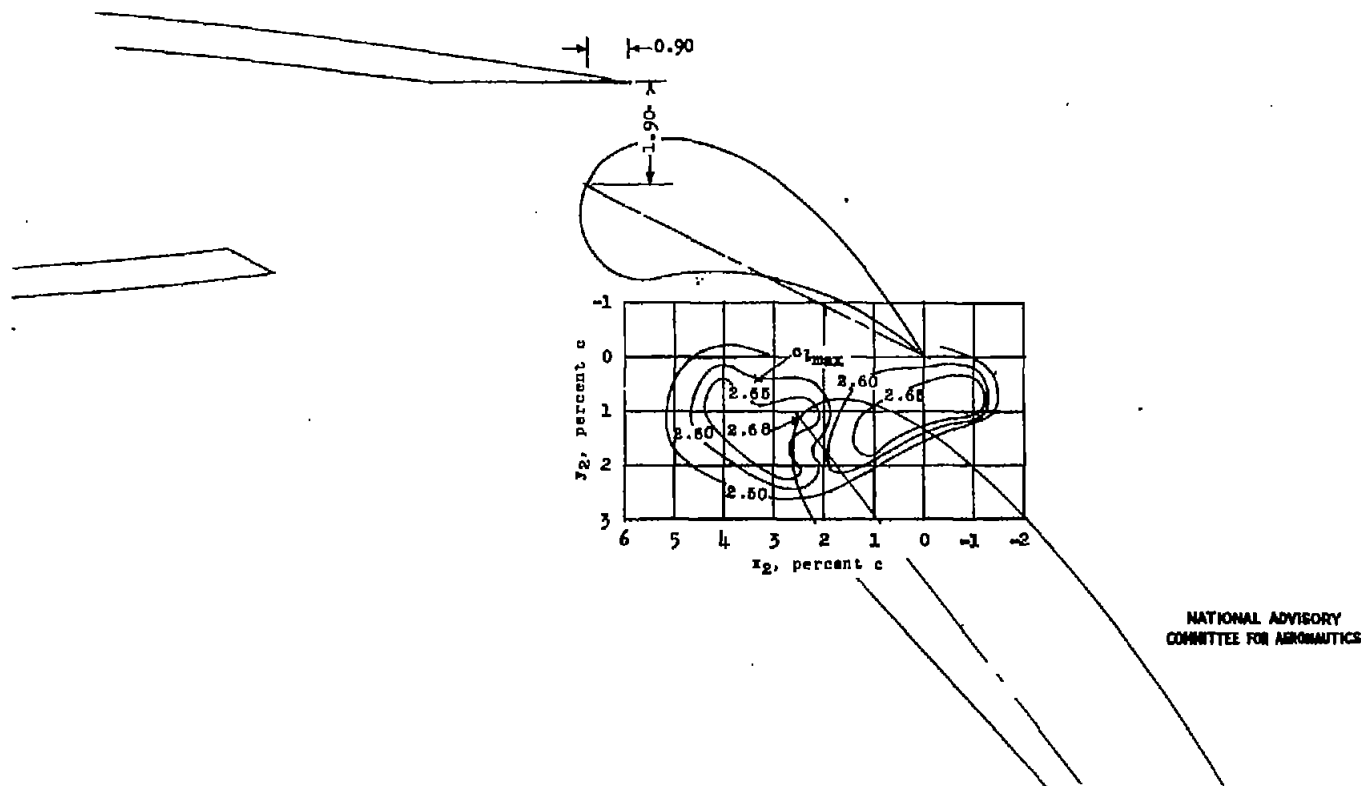
NATIONAL ADVISORY
COMMITTEE FOR AERONAUTICS

Figure 17.- Contours of flap position for maximum lift of the NACA 65-210 airfoil section with a double slotted flap; 0.075c fore flap; 0.250c flap. $\delta_f = 50^o$; $\delta_{ff} = 25^o$; $R = 2.4 \times 10^6$.

Figure 18.- Contours of flap and fore-flap position for maximum lift of the NACA 65-210 airfoil section with a double slotted flap; 0.075c fore flap; 0.250c flap. $\delta_f = 50°$; $\delta_{ff} = 25°$; $R = 2.4 \times 10^6$.

(a) Plain airfoil.

(b) Airfoil with 0.20c split flap; $\delta_f = 60^\circ$.

(c) Airfoil with double slotted flap; 0.25c flap; 0.075d fore flap; $\delta_{ff} = 25^\circ$; $\delta_f = 50^\circ$; $x_1 = 0.92$; $y_1 = 2.36$; $x_2 = 2.50$; $y_2 = 1.10$.
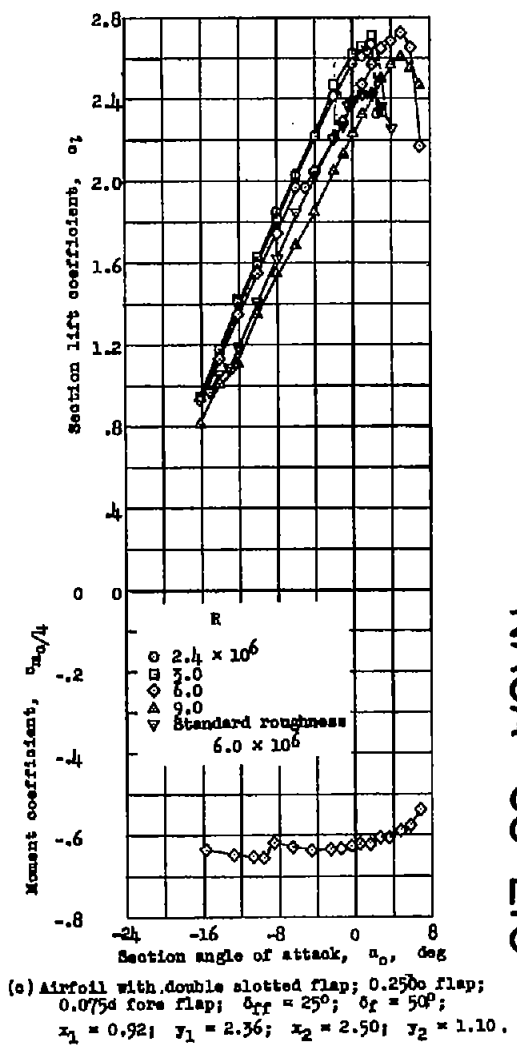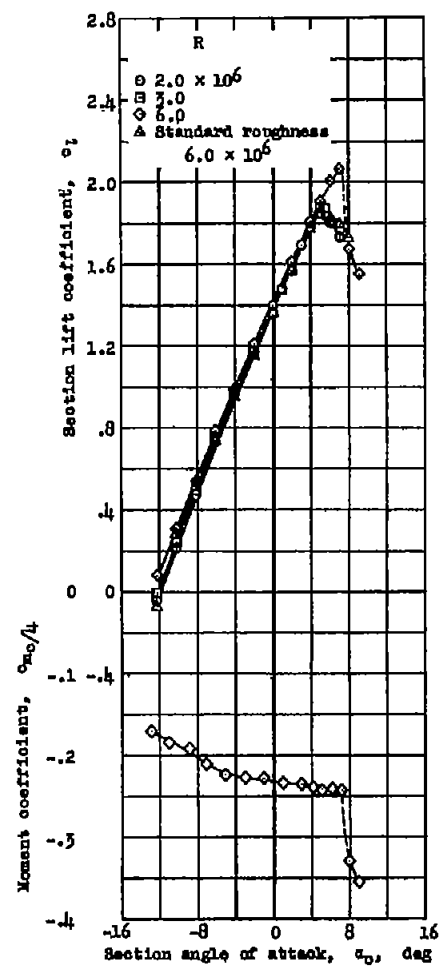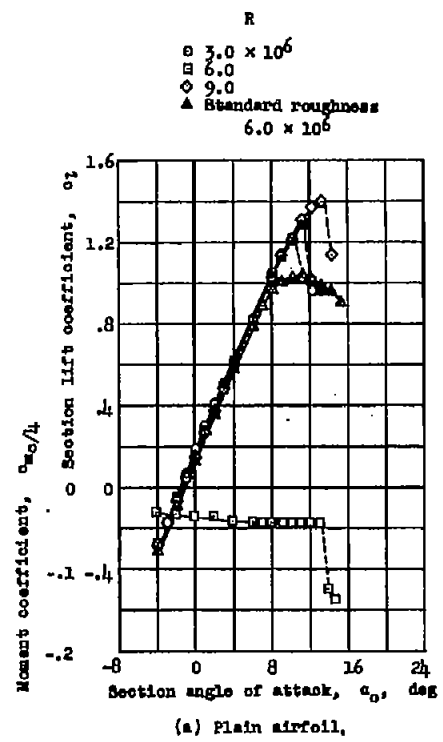
Figure 19.- Section lift and pitching-moment characteristics of the NACA 65-210 airfoil section with and without flap.

NATIONAL ADVISORY
COMMITTEE FOR AERONAUTICS

(a) Plain airfoil.

(b) Airfoil with split flap; $\delta_f = 60°$; $R = 6.0 \times 10^6$.
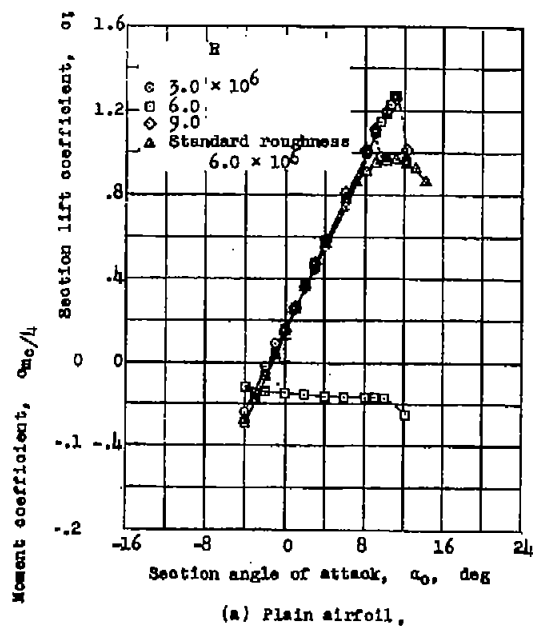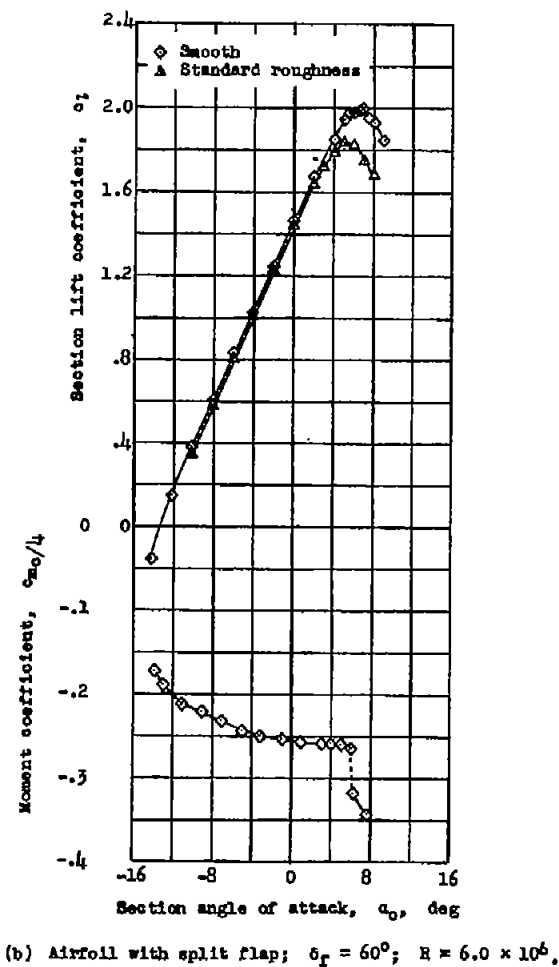
Figure 20.- Section lift and pitching-moment characteristics of the NACA 66-210 airfoil section with and without a 0.20c split flap.

NATIONAL ADVISORY
COMMITTEE FOR AERONAUTICS
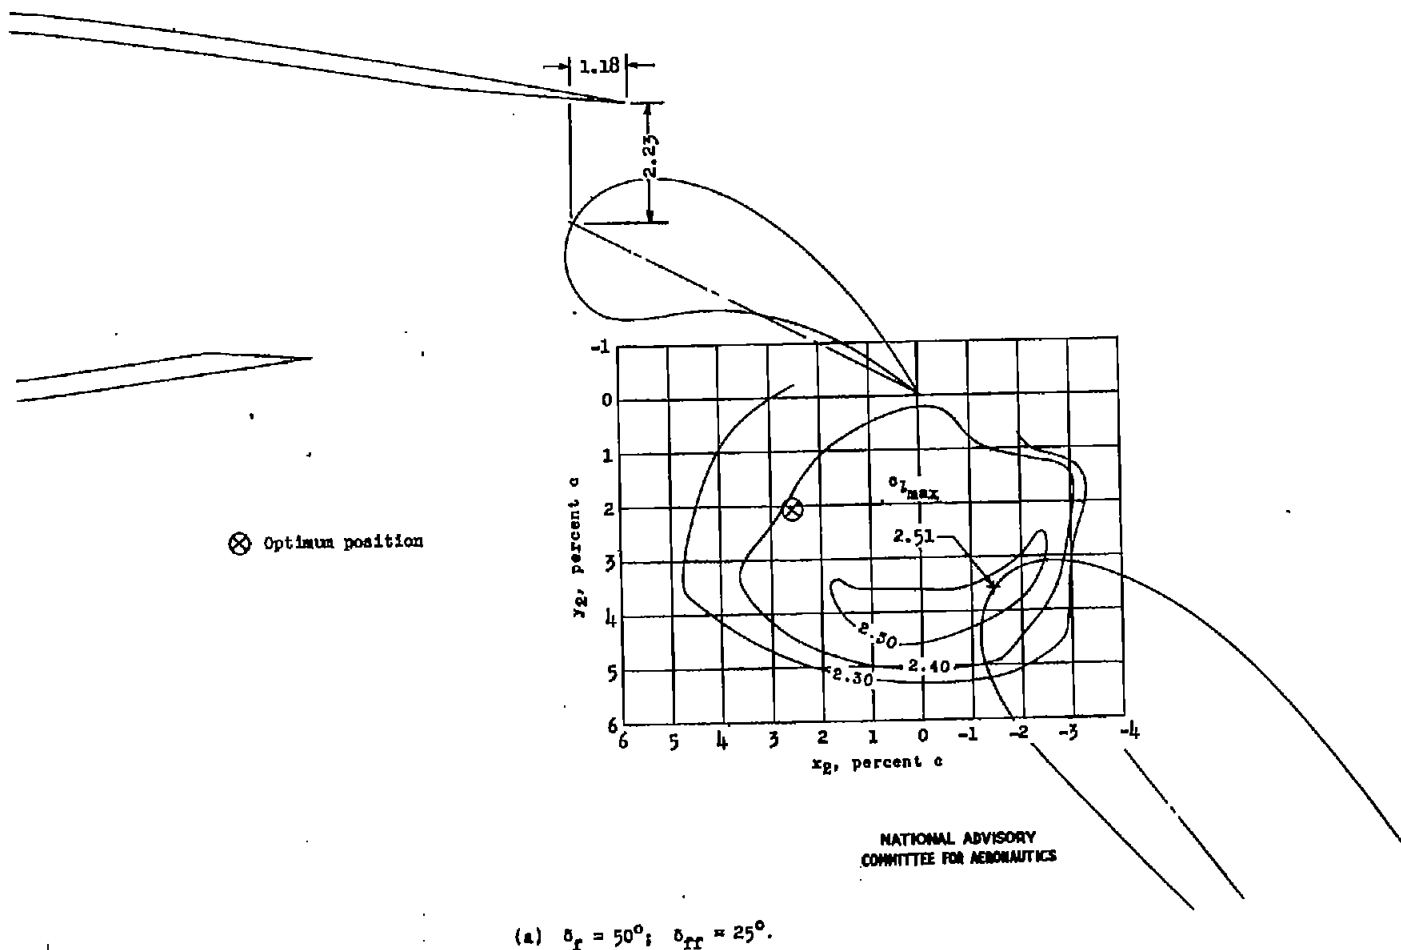
$\otimes$ Optimum position

(a) $\delta_f = 50°$; $\delta_{ff} = 25°$.

Figure 21.- Contours of flap position for maximum lift of the NACA 66-210 airfoil section with a double slotted flap; 0.075c fore flap; 0.250c flap. $R = 2.4 \times 10^6$.

NATIONAL ADVISORY
COMMITTEE FOR AERONAUTICS

⊗ Optimum position

(b) $\delta_f = 55°$; $\delta_{ff} = 25°$.

Figure 2/ .- Continued.

⊗ Optimum position

NATIONAL ADVISORY
COMMITTEE FOR AERONAUTICS

(c) $\delta_f = 50°$; $\delta_{ff} = 30°$.

Figure 21.- Continued.

$\otimes$ Optimum position

$c_{l_{max}}$

2.57

2.55

2.50

2.40

2.30

y_2, percent c

x_2, percent c
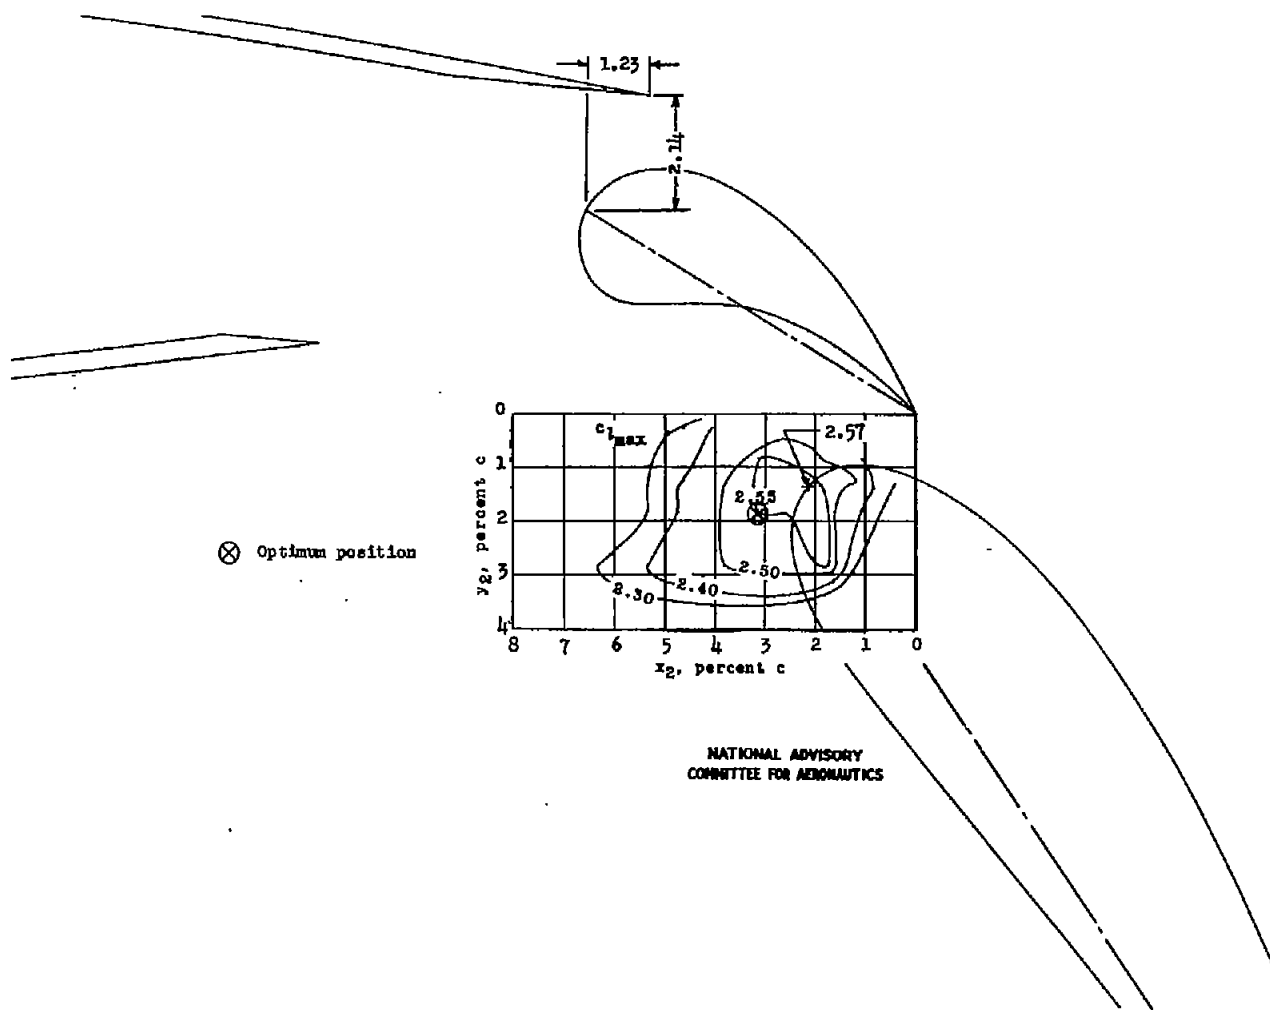
(d) $\delta_f = 55°$; $\delta_{ff} = 30°$.

Figure 21 .- Concluded.
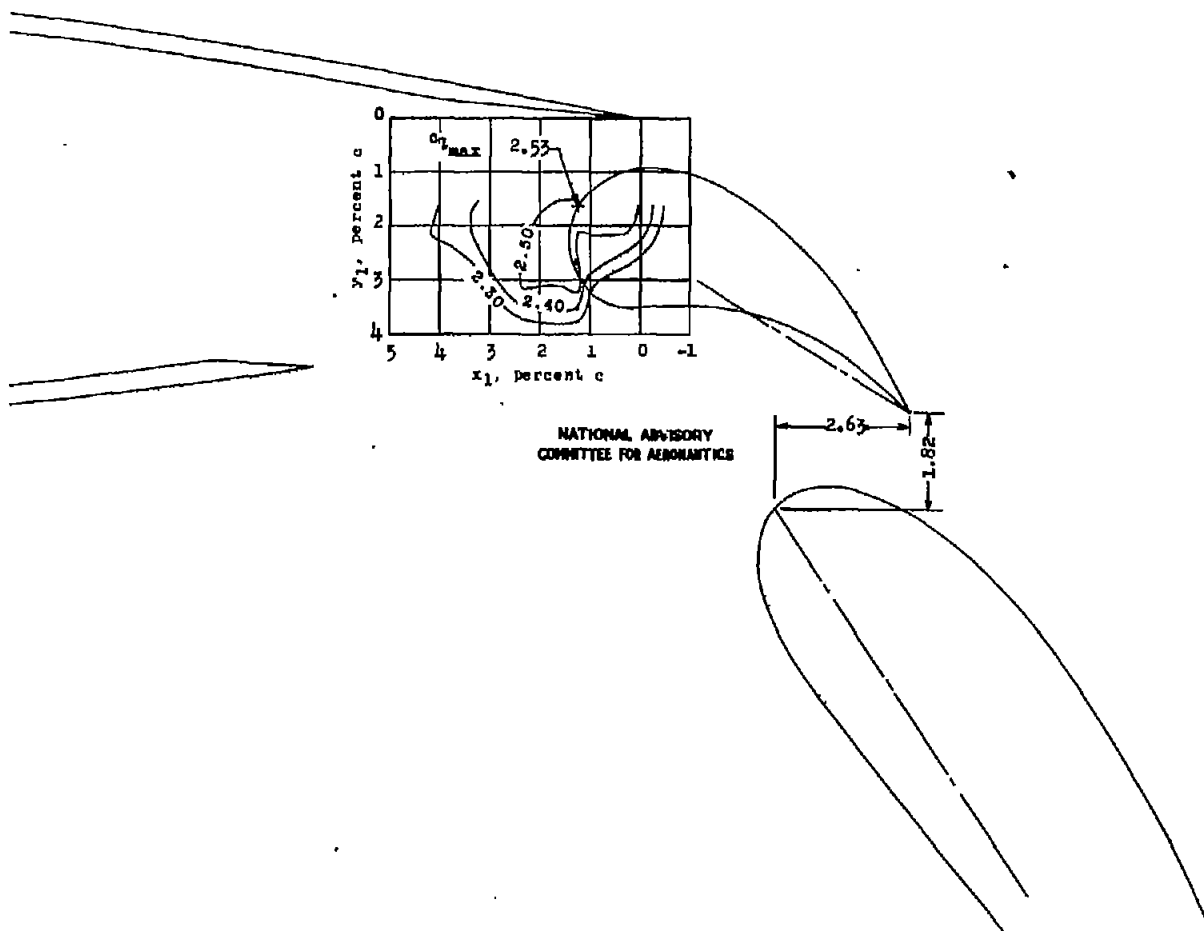
Figure 22.- Contours of flap and fore-flap position for maximum lift of the NACA 66-210 airfoil section with a double slotted flap; 0.075c fore flap; 0.250c flap. $\delta_f = 55°$; $\delta_{ff} = 30°$; $R = 2.4 \times 10^6$.

NACA 66-210

51

(a) $\delta_{ff} = 25°$; $\delta_f = 55°$. $x_1 = 1.18$; $y_1 = 2.23$;
$x_2 = 2.87$; $y_2 = 2.27$.

NATIONAL ADVISORY
COMMITTEE FOR AERONAUTICS

(b) $R \approx 6.0 \times 10^6$.

Figure 23.- Section lift and pitching-moment characteristics of the NACA 66-210 airfoil section with a double slotted flap; 0.075c fore flap; 0.250c flap.

⊗ Optimum position

y_g, percent c

x_g, percent c

2.40

$c_{l_{max}}$

2.61

2.50

2.60

NATIONAL ADVISORY
COMMITTEE FOR AERONAUTICS
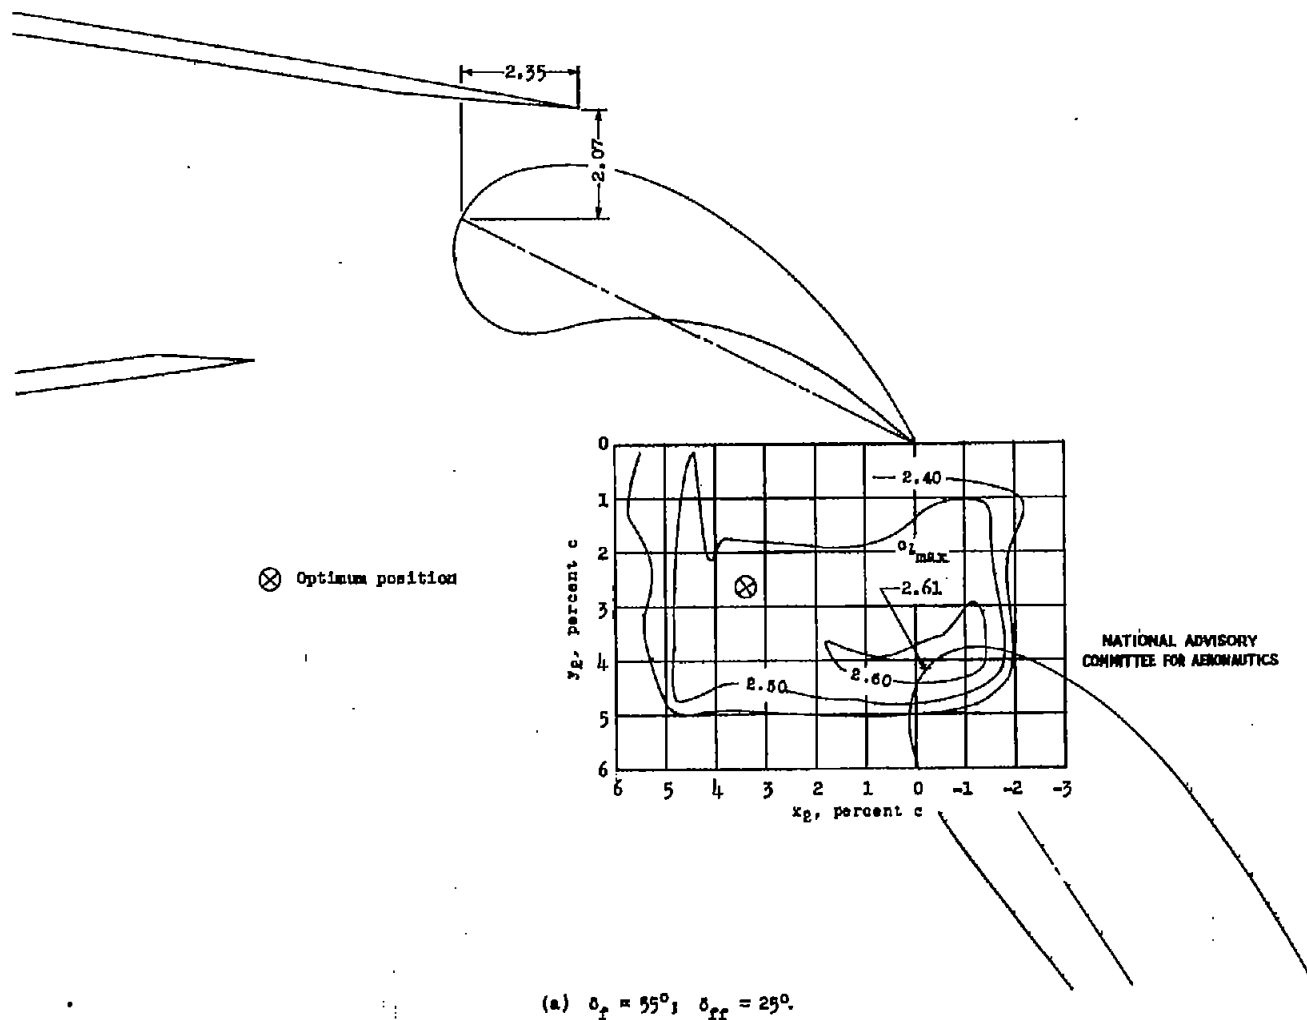
NACA 66-210

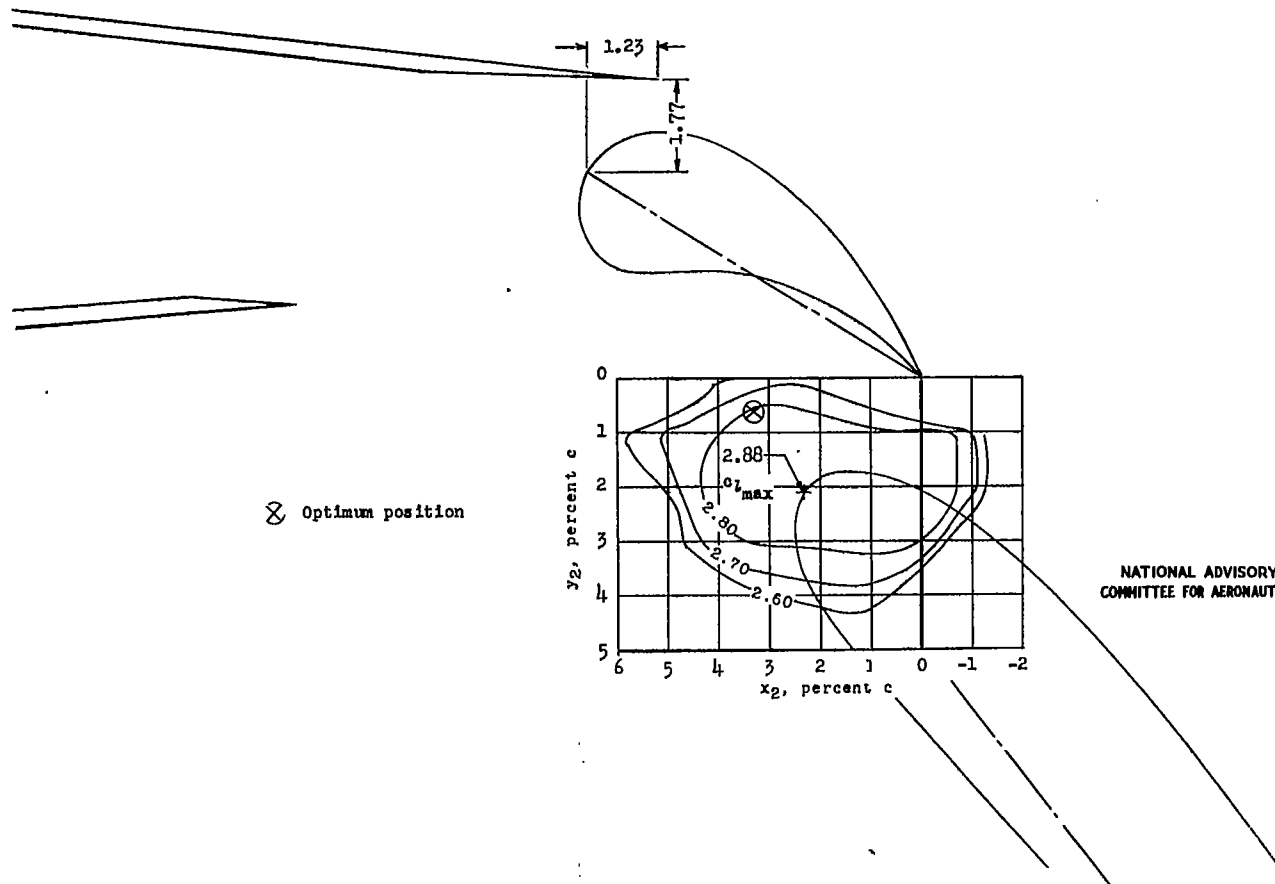(a) $\delta_f = 55°$; $\delta_{ff} = 25°$.

Figure 24.- Contours of flap position for maximum lift of the NACA 66-210 airfoil section with a double slotted flap.
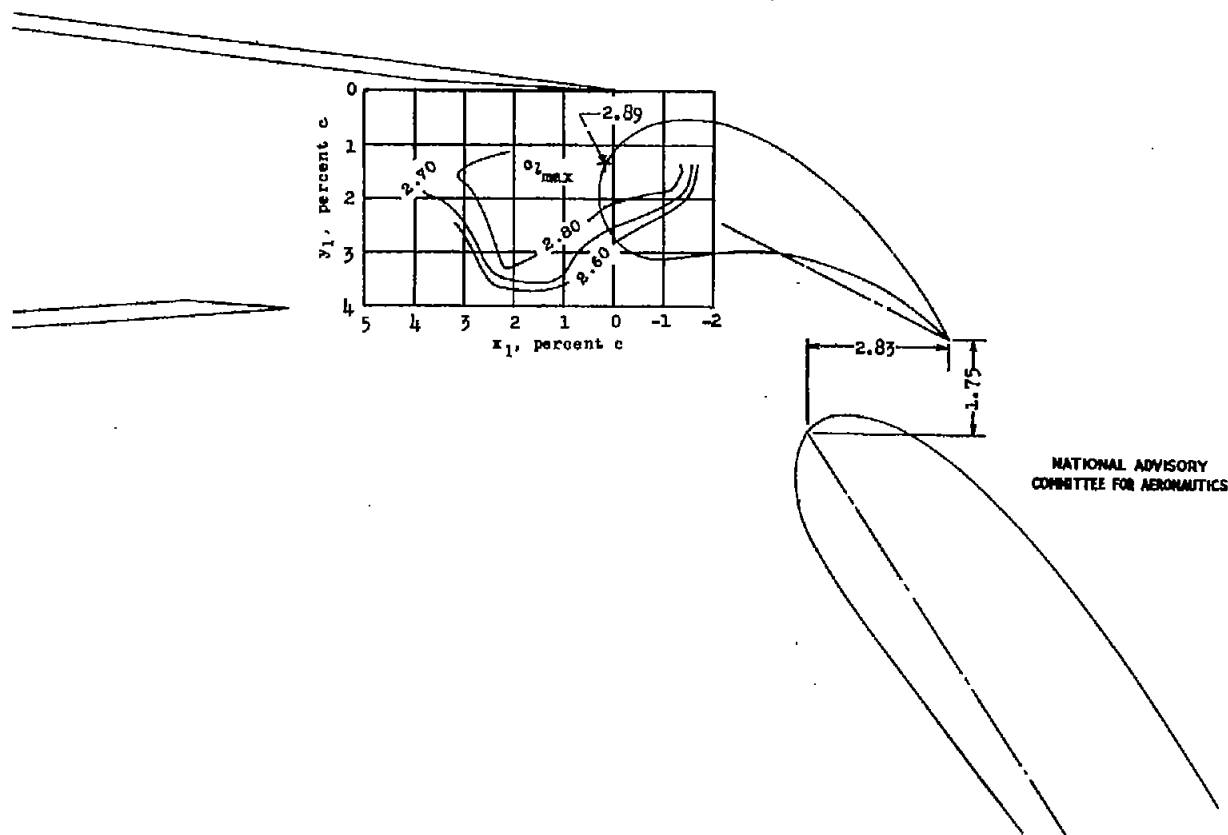0.100c fore flap; 0.250c flap.   R = 2.4 × 10⁶.

⊗ Optimum position

NATIONAL ADVISORY
COMMITTEE FOR AERONAUTICS

(b) $\delta_f = 60°$; $\delta_{ff} = 25°$.

Figure 24.- Continued.

|←— 2.40 —→|

1.96

⊗ Optimum position

x_g, percent c

x_g, percent c

$c_{l_{max}}$

2.40

2.50

2.60

2.60

2.40

2.50

⊗
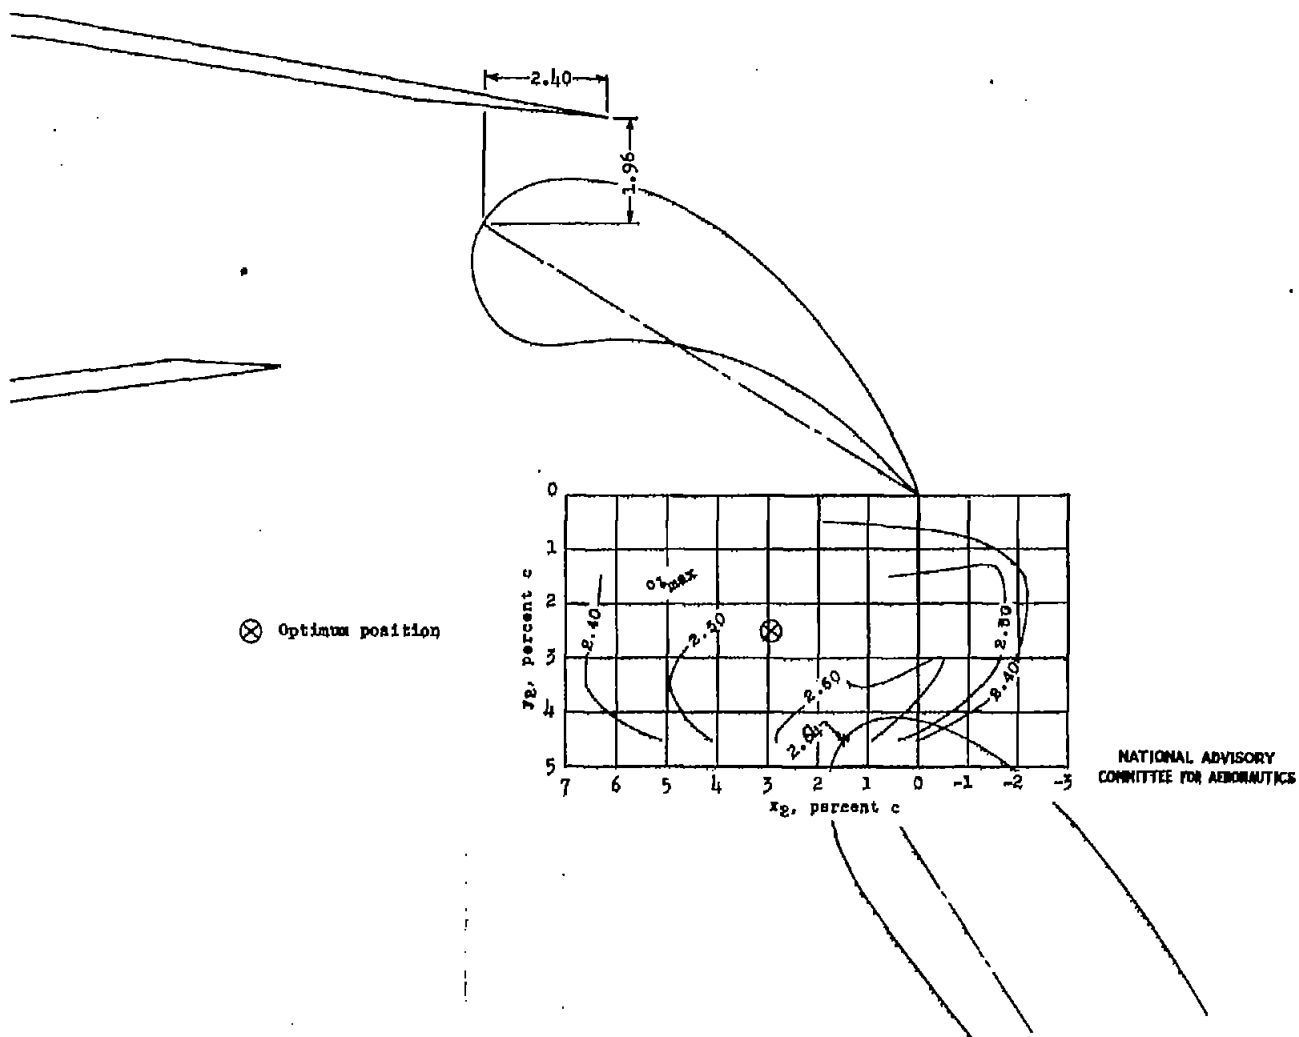
(c) $\delta_f = 55°$; $\delta_{ff} = 30°$.

Figure 24.- Concluded.

$c_{l_{max}}$

y_1, percent c

x_1, percent c

3.40

2.50

2.63

2.60

NATIONAL ADVISORY
COMMITTEE FOR AERONAUTICS

2.95

2.51
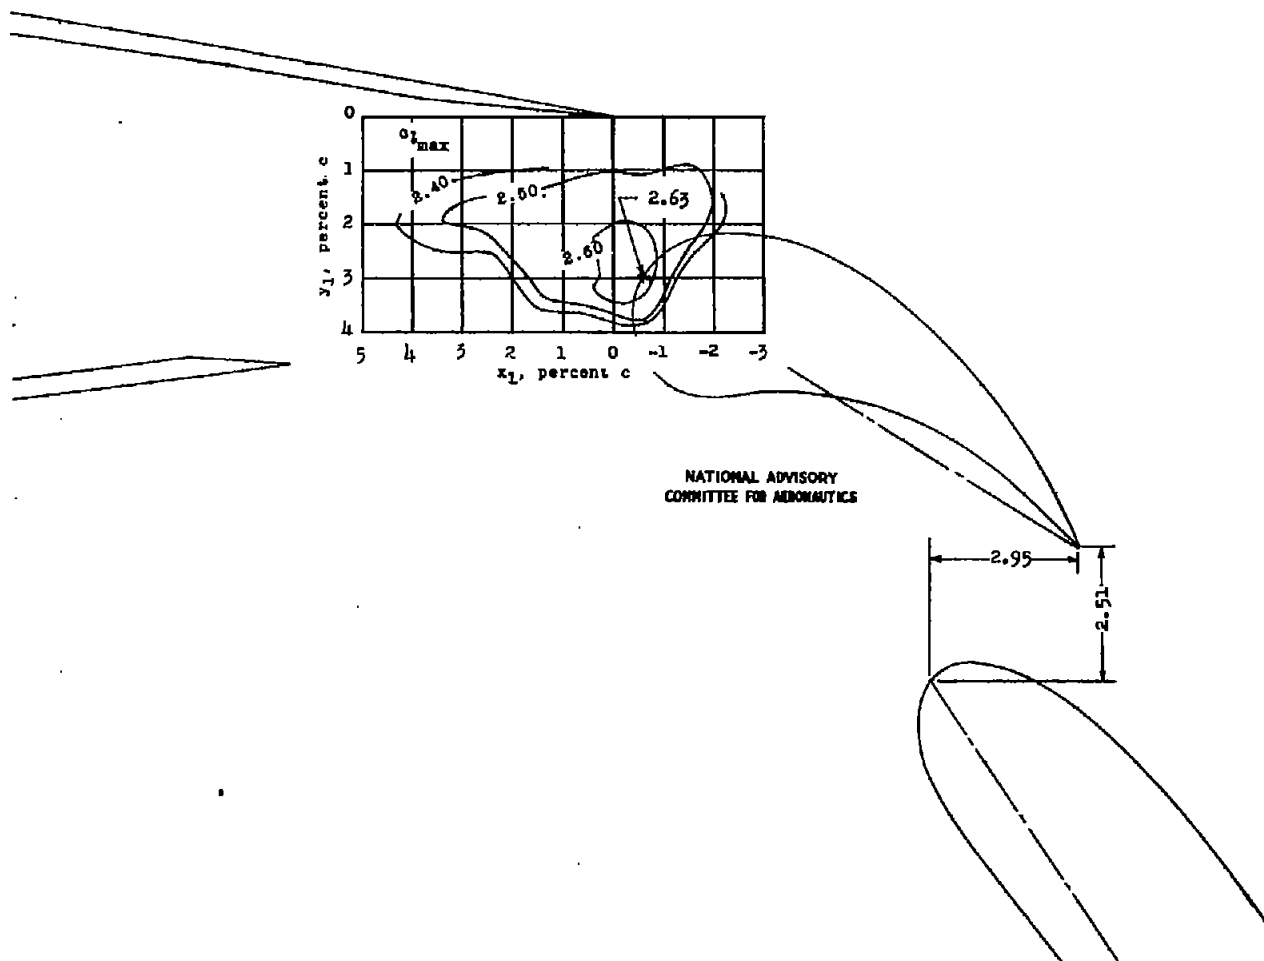
Figure 25.— Contours of flap and fore-flap position for maximum lift of the NACA 66-210 airfoil section with a double slotted flap; 0.100c fore flap; 0.250c flap. $\delta_f = 55°$; $\delta_{ff} = 30°$; $R = 2.4 \times 10^6$.
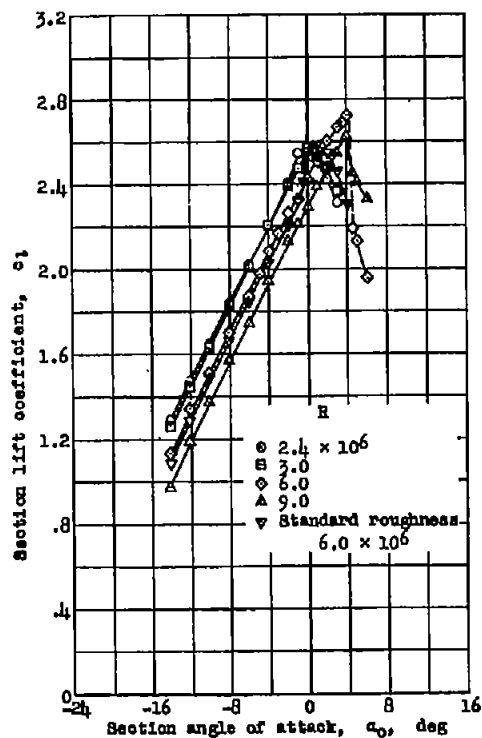
(a) $\delta_{ff} = 25^o$; $\delta_f = 60^o$. $x_1 = 2.35$; $y_1 = 2.07$; $x_2 = 3.07$; $y_2 = 3.88$.

NATIONAL ADVISORY
COMMITTEE FOR AERONAUTICS

δ_{ff} (deg)	δ_f (deg)	x_1	y_1	x_2	y_2
⊙ 25	55	2.35	2.07	3.31	2.67
⊟ 25	60	2.35	2.07	3.07	3.88
◇ 30	55	2.40	1.96	2.95	2.51

(b) $R = 6.0 \times 10^6$.
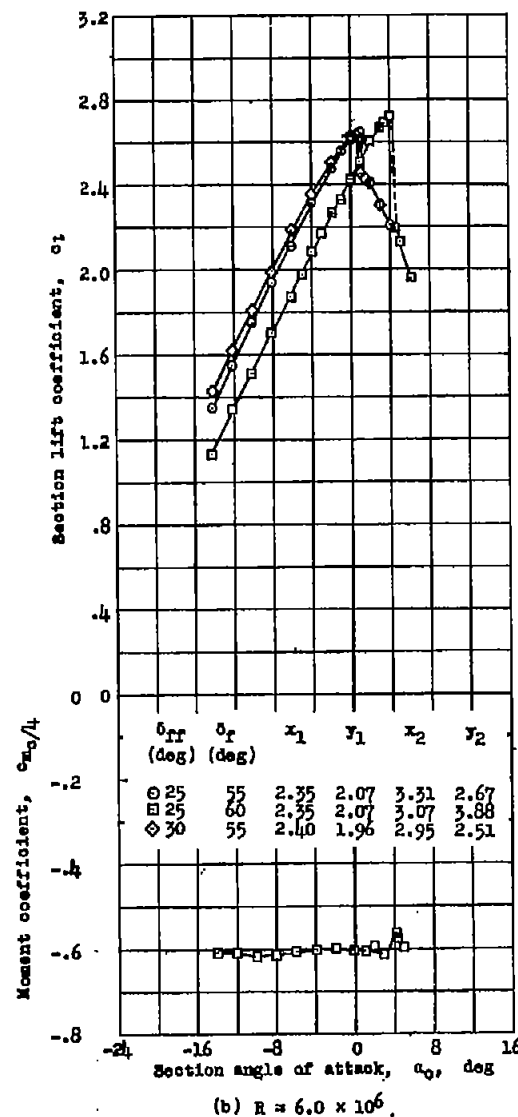
Figure 26.— Section lift and pitching-moment characteristics of the NACA 66-210 airfoil section with a double slotted flap; 0.100c fore flap; 0.250c flap.
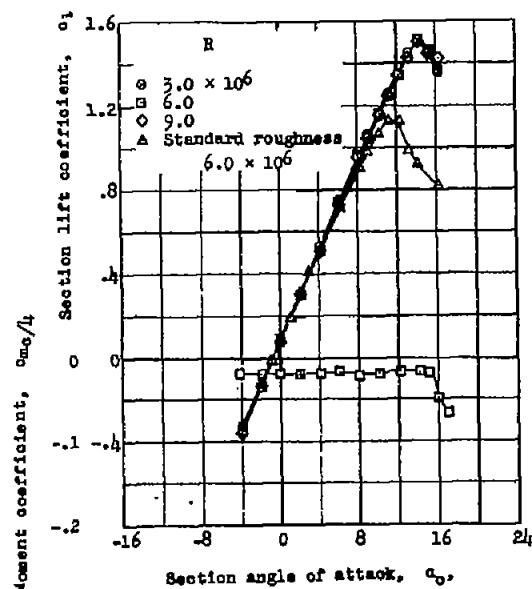
(a) Plain airfoil.

NATIONAL ADVISORY
COMMITTEE FOR AERONAUTICS
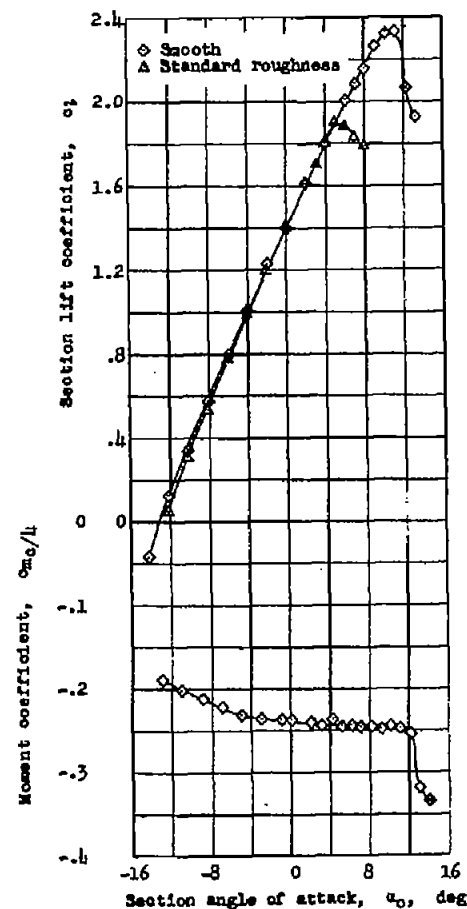
(b) Airfoil with split flap. $\delta_f = 60°$; $R = 6 \times 10^6$.

Figure 27.- Section lift and pitching-moment characteristics of the NACA 1410 airfoil section with and without a 0.20c split flap.

⊗ Optimum position

$c_{l_{max}}$

2.88

2.80

2.70

2.60

z_2, percent c

x_2, percent c

NATIONAL ADVISORY
COMMITTEE FOR AERONAUTICS
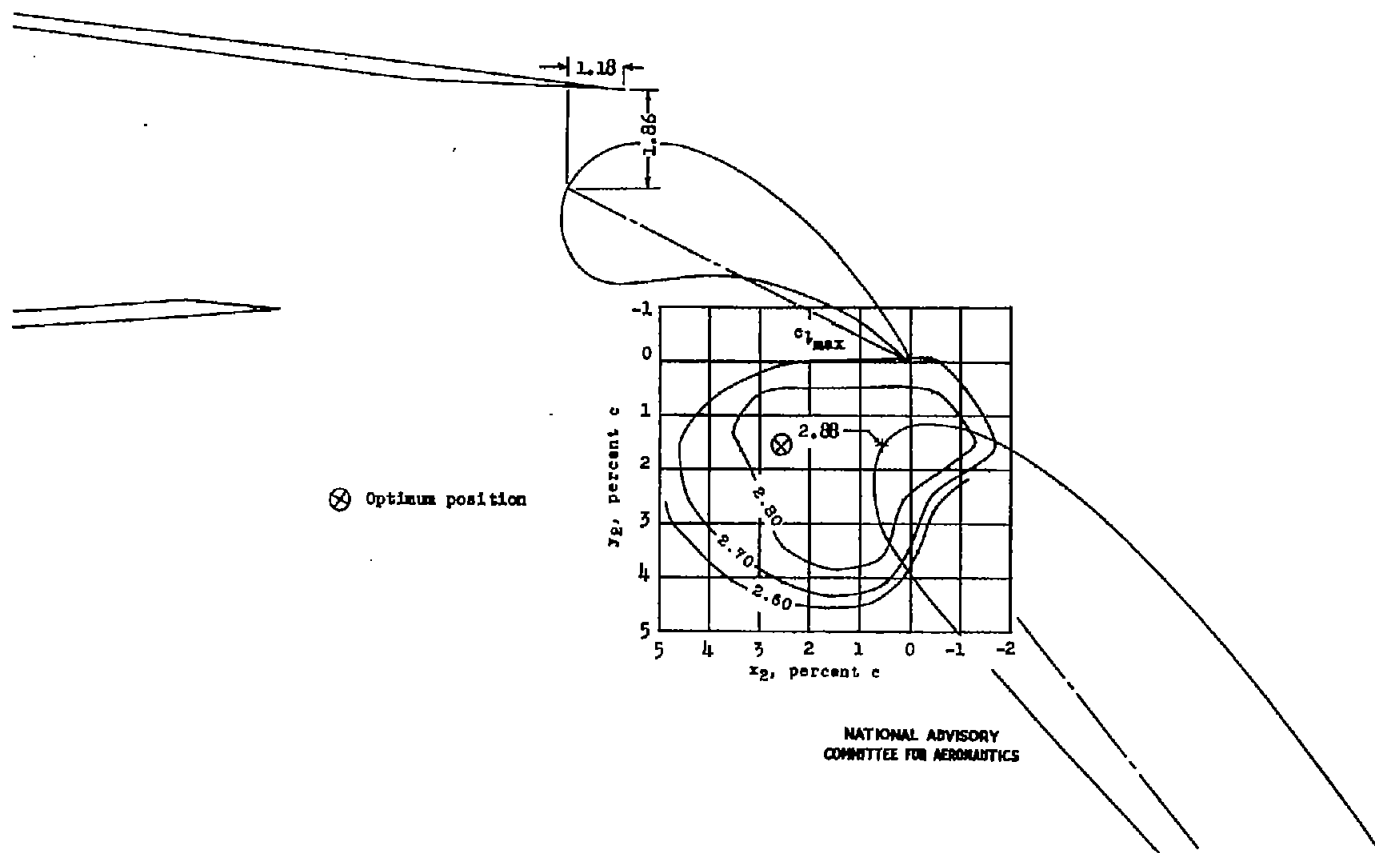
(a) $\delta_f = 50°$; $\delta_{ff} = 25°$

Figure 28.- Contours of flap position for maximum lift of the NACA 1410 airfoil section with a double slotted flap;
0.075c fore flap; 0.250c flap.   R = 2.4 × 10^6.

$\rightarrow$ 1.18 $\leftarrow$

1.86

⊗ Optimum position

y_2, percent c

cl_{max}

2.80

2.92

2.90

2.70

x_2, percent c

5   4   3   2   1   0   -1   -2

NATIONAL ADVISORY
COMMITTEE FOR AERONAUTICS
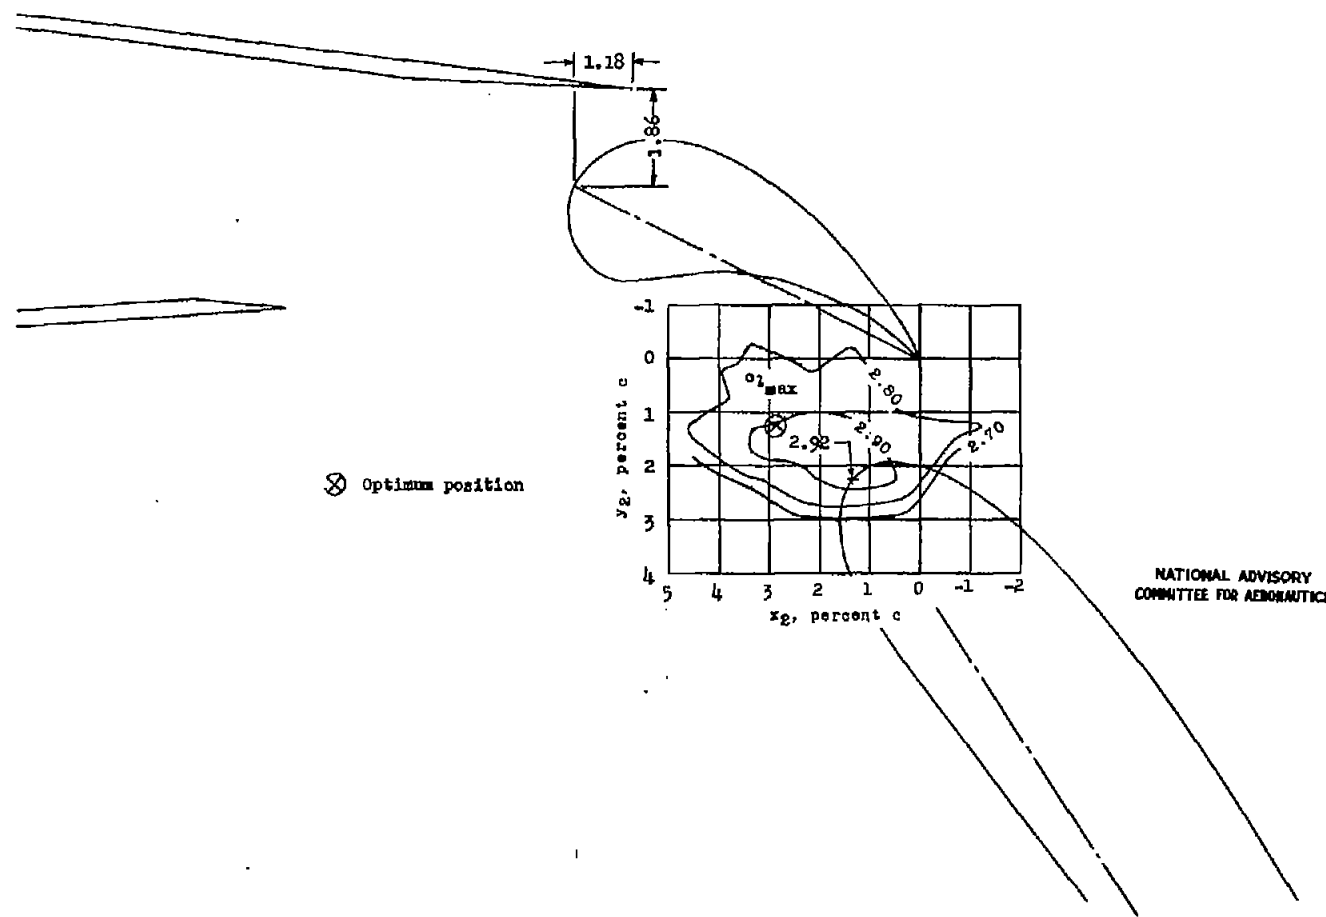
(b) $\delta_f = 55°$; $\delta_{ff} = 25°$.

Figure 28 .- Continued.

NACA TN No. 1545

NACA 1410

1.23

1.77

⊗ Optimum position

0
1
2
3
4
5

y_2, percent c

2.88
$c_{l_{max}}$
2.80
2.70
2.60

NATIONAL ADVISORY
COMMITTEE FOR AERONAUTICS

6 5 4 3 2 1 0 -1 -2
x_2, percent c

(c) $\delta_f = 50°$; $\delta_{ff} = 30°$.
Figure 28 .- Concluded.
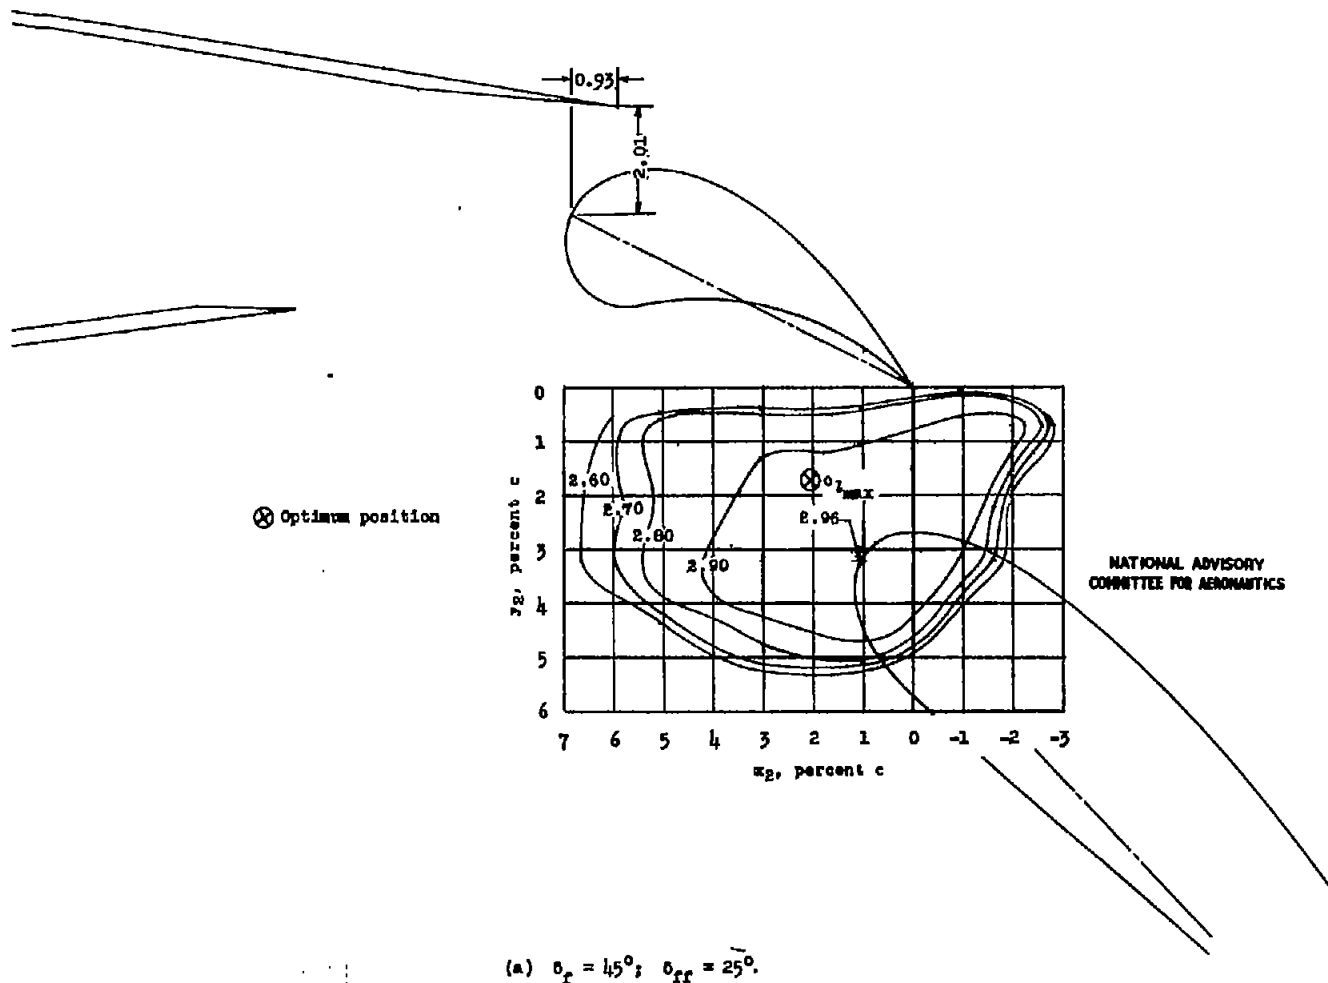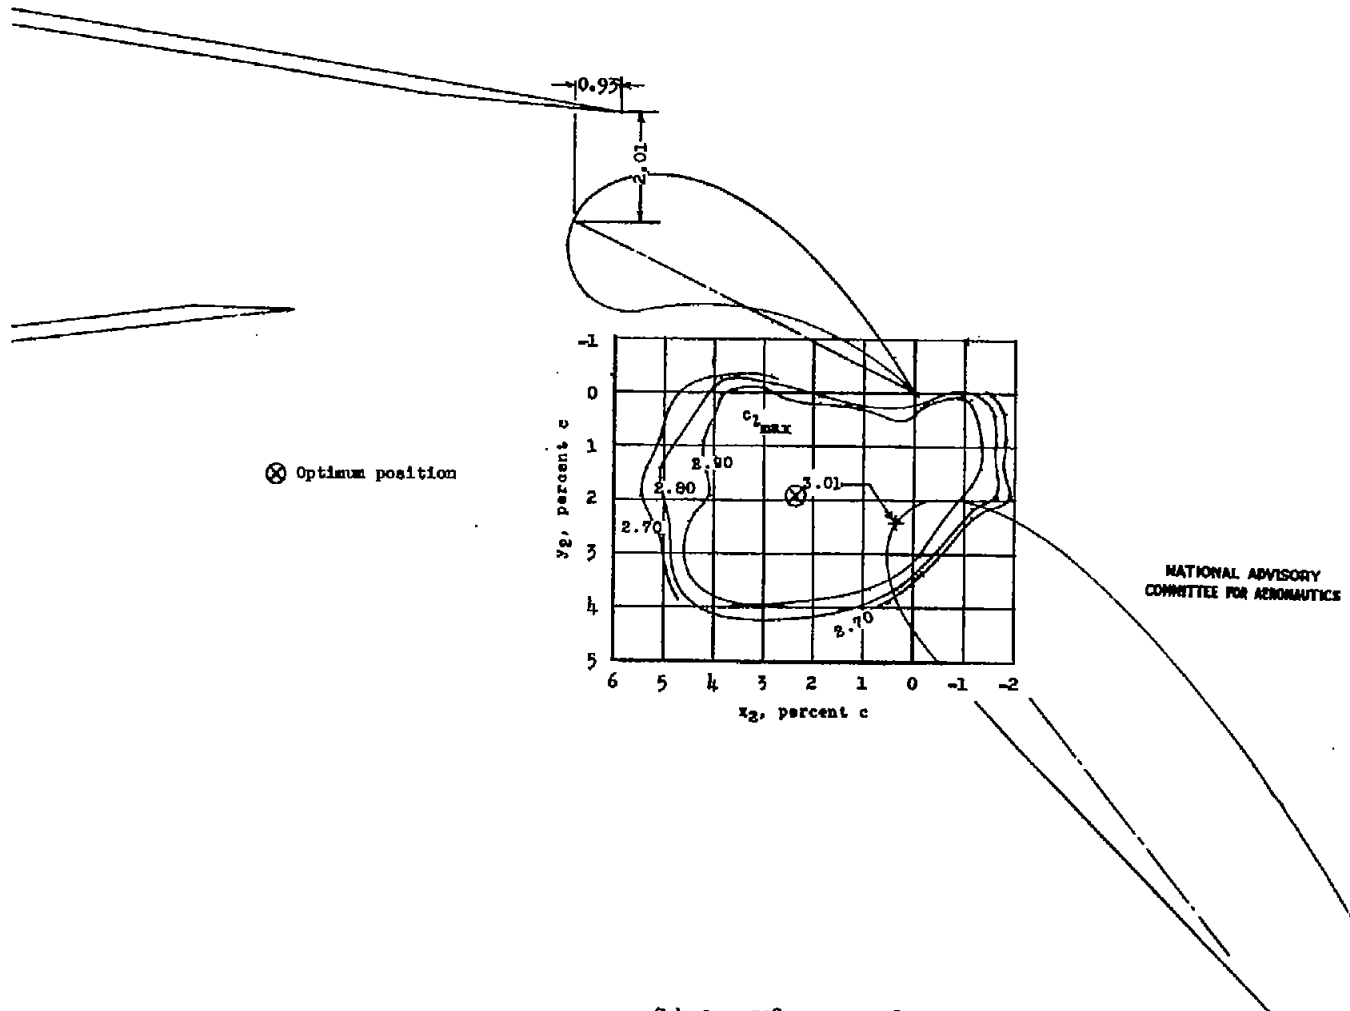
NATIONAL ADVISORY
COMMITTEE FOR AERONAUTICS

Figure 29.— Contours of flap and fore-flap position for maximum lift of the NACA 1410 airfoil section with a double slotted flap; 0.075c fore flap; 0.250c flap. $\delta_f = 55^0$; $\delta_{ff} = 25^0$; $R = 2.4 \times 10^6$.
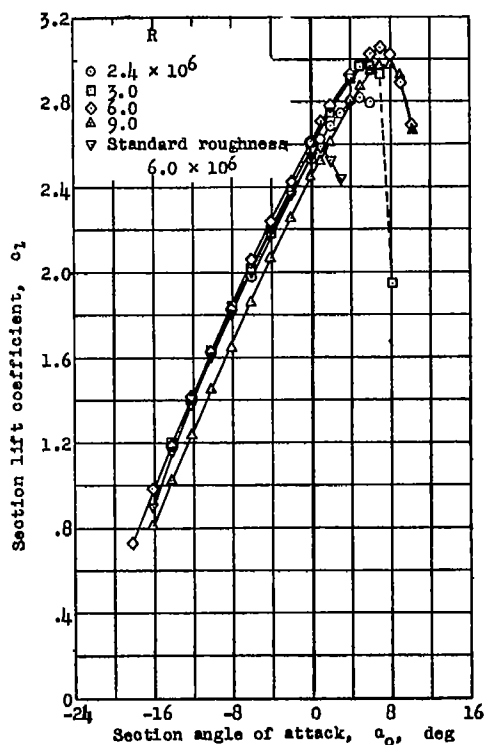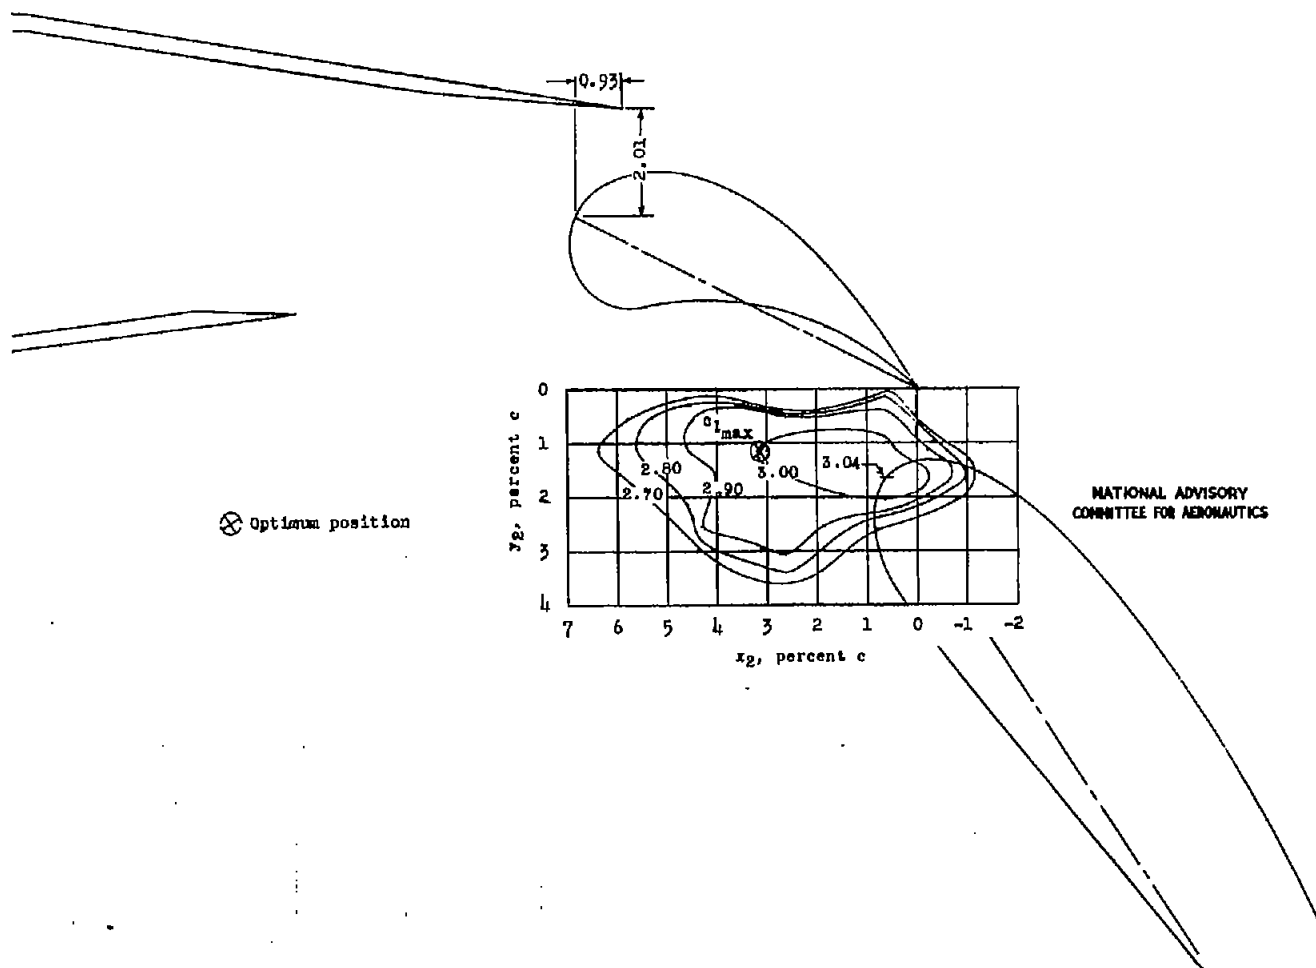
(a) $\delta_{ff} = 25°$; $\delta_f = 50°$. $x_1 = 1.18$; $y_1 = 1.86$;
$x_2 = 2.54$; $y_2 = 1.56$.
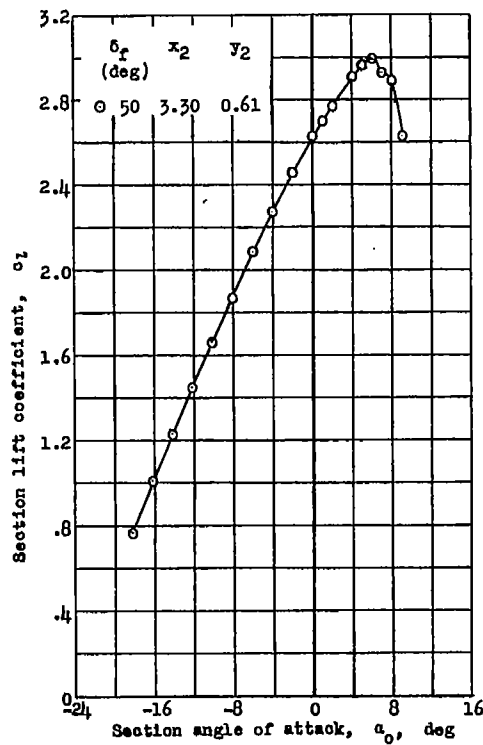
(b) $\delta_{ff} = 30°$; $x_1 = 1.23$; $y_1 = 1.77$;
$R = 6.0 \times 10^6$.

NATIONAL ADVISORY
COMMITTEE FOR AERONAUTICS
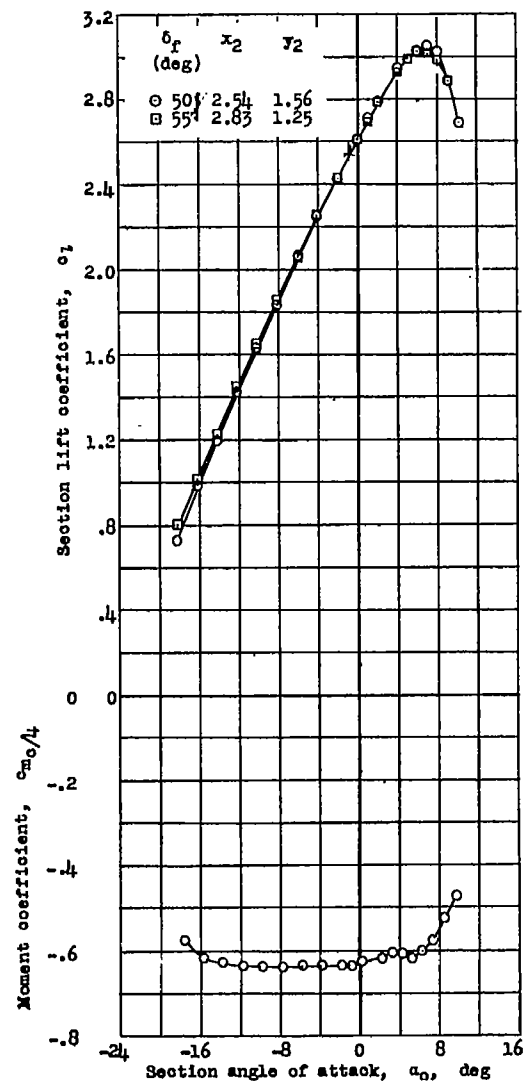
(c) $\delta_{ff} = 25°$; $x_1 = 1.18$; $y_1 = 1.86$; $R = 6.0 \times 10^6$.

Figure 30.- Section lift and pitching-moment characteristics of the NACA 1410 airfoil section with a double slotted flap;
0.075c fore flap; 0.25c flap.
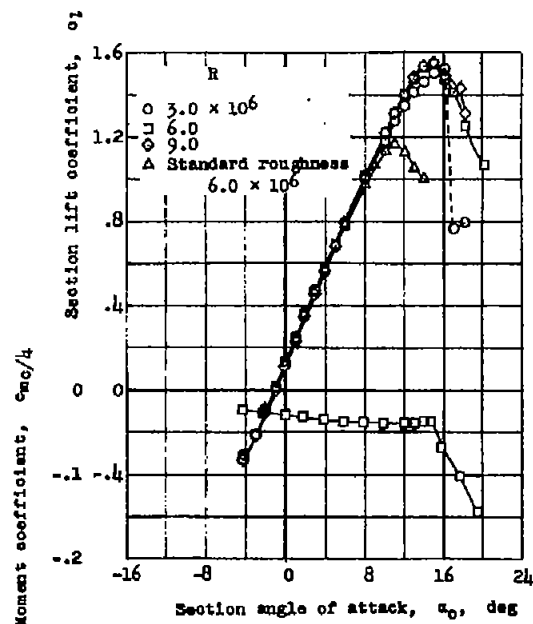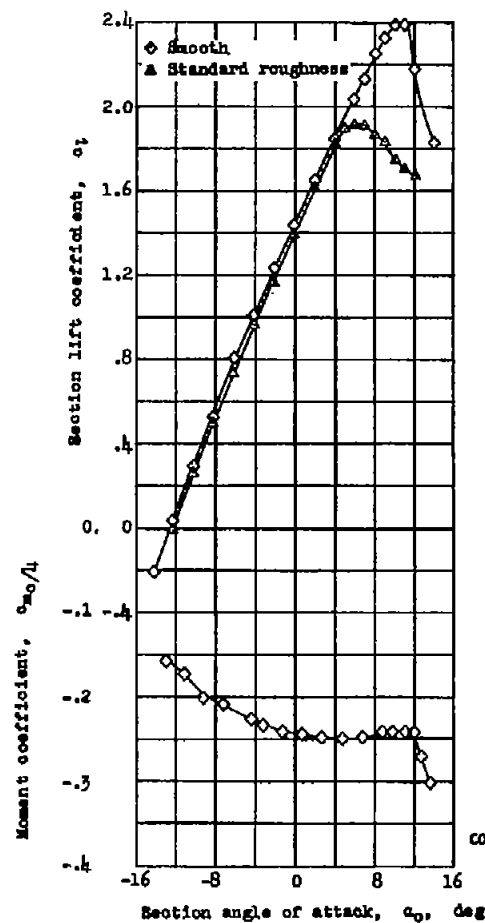
NACA 64₁-212

(a) Plain airfoil.

(b) Airfoil with split flap. $\delta_f = 60°$; $R = 6.0 \times 10^6$.

Figure 31.- Section lift and pitching-moment characteristics of the NACA 64₁-212 airfoil section with and without a 0.20c split flap.

NATIONAL ADVISORY
COMMITTEE FOR AERONAUTICS

⊗ Optimum position

2.60
2.70
2.80
2.90
⊗ $c_{l_{max}}$
2.96

NATIONAL ADVISORY
COMMITTEE FOR AERONAUTICS

x_2, percent c

z_2, percent c

0.93
2.01

(a) $\delta_f = 45°$; $\delta_{ff} = 25°$.
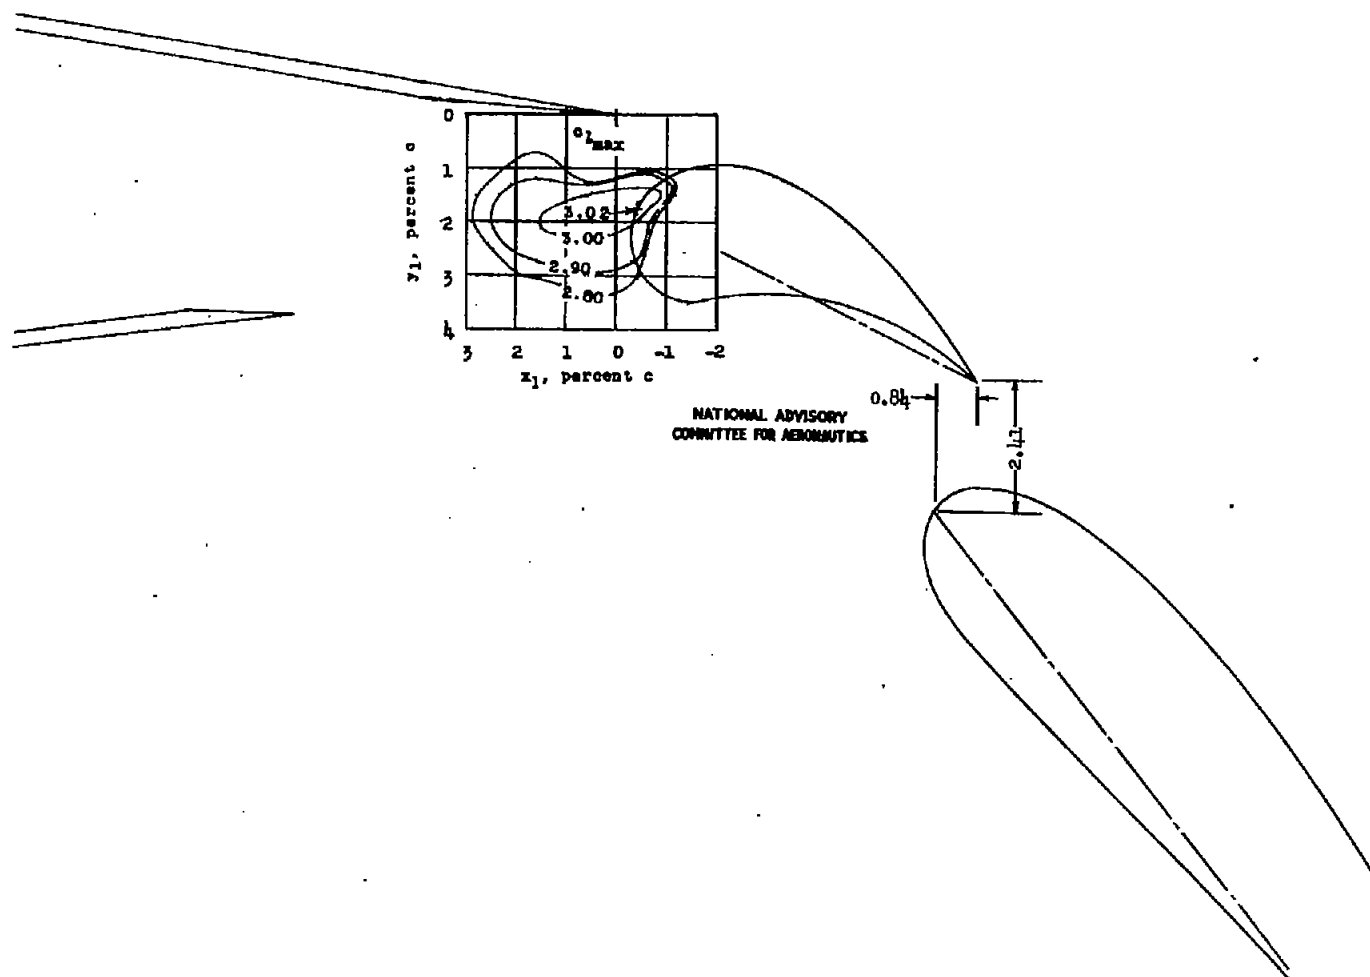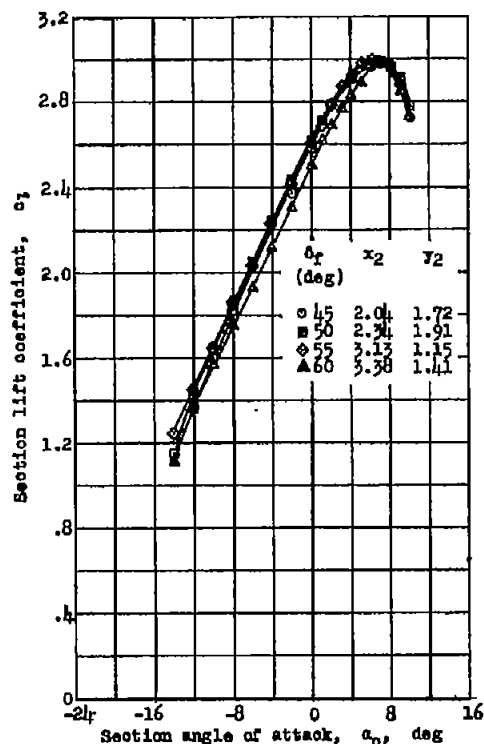
Figure 32.- Contours of flap position for maximum lift of the NACA 64_1-212 airfoil section with a double slotted flap; 0.075c fore flap; 0.250c flap.   R = 2.4 × 10⁶.

⊗ Optimum position

$c_{l_{max}}$

2.90

2.80

2.70

⊗ 3.01

2.70

NATIONAL ADVISORY
COMMITTEE FOR AERONAUTICS

y_2, percent c

x_2, percent c

(b) $\delta_f = 50°$; $\delta_{ff} = 25°$.

Figure 32.– Continued.

⊗ Optimum position

y_2, percent c

$c_{l_{max}}$

2.80   3.00   3.04

2.70   2.90

x_2, percent c

NATIONAL ADVISORY
COMMITTEE FOR AERONAUTICS

(c) $\delta_f = 55°$; $\delta_{ff} = 25°$.

Figure 32.- Continued.

⊗ Optimum position

(d) $\delta_f = 60°$; $\delta_{ff} = 25°$.
Figure 32.- Continued.

⊗ Optimum position

NATIONAL ADVISORY
COMMITTEE FOR AERONAUTICS

(e) $\delta_f = 50^\circ$; $\delta_{ff} = 30^\circ$.
Figure 32.- Continued.

0.98

1.92

-1

0

$c_{l_{max}}$

1

2.95

3.00

2.90

2.80

2

2.70

$\otimes$ Optimum position

3

y_2, percent c

4

7   6   5   4   3   2   1   0   -1   -2

x_2, percent c

NATIONAL ADVISORY
COMMITTEE FOR AERONAUTICS
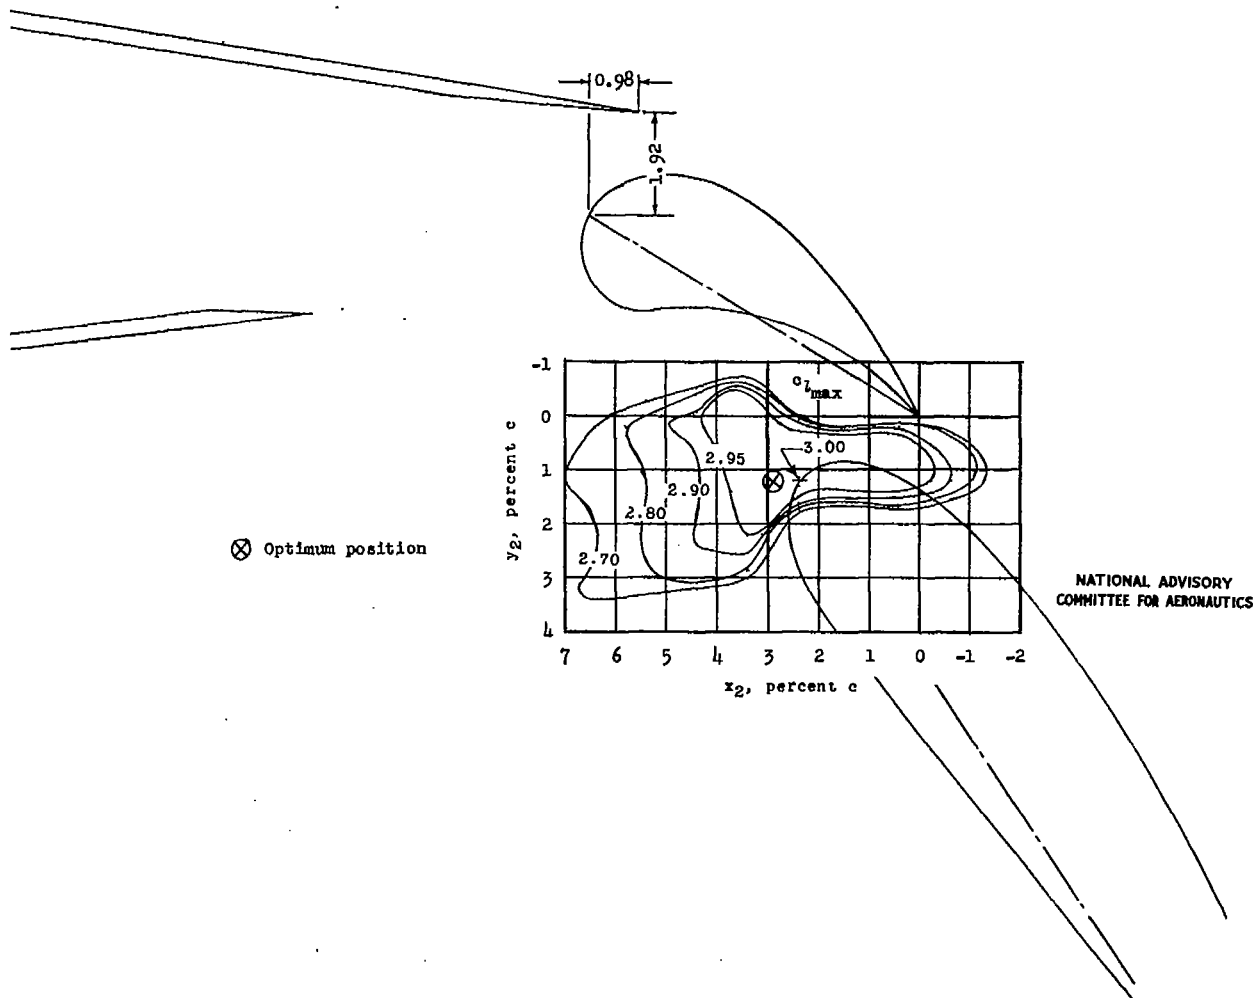
(f) $\delta_f = 55°$; $\delta_{ff} = 30°$.
Figure 32.- Continued.

NACA 64₁-212

⊗ Optimum position

|←0.98→|

1.92

-1

0

1

2

3

z_2, percent c

6   5   4   3   2   1   0   -1   -2

x_2, percent c

3.03
3.00
2.90
2.80
2.70

$c_{l_{max}}$

2.70
2.80
2.90
3.00

NATIONAL ADVISORY
COMMITTEE FOR AERONAUTICS

(g) $\delta_f = 60°$; $\delta_{ff} = 30°$.

Figure 32.- Concluded.

NATIONAL ADVISORY
COMMITTEE FOR AERONAUTICS

x_1, percent c

y_1, percent c

$c_{l_{max}}$

3.02
3.00
2.90
2.80

0.84

2.43
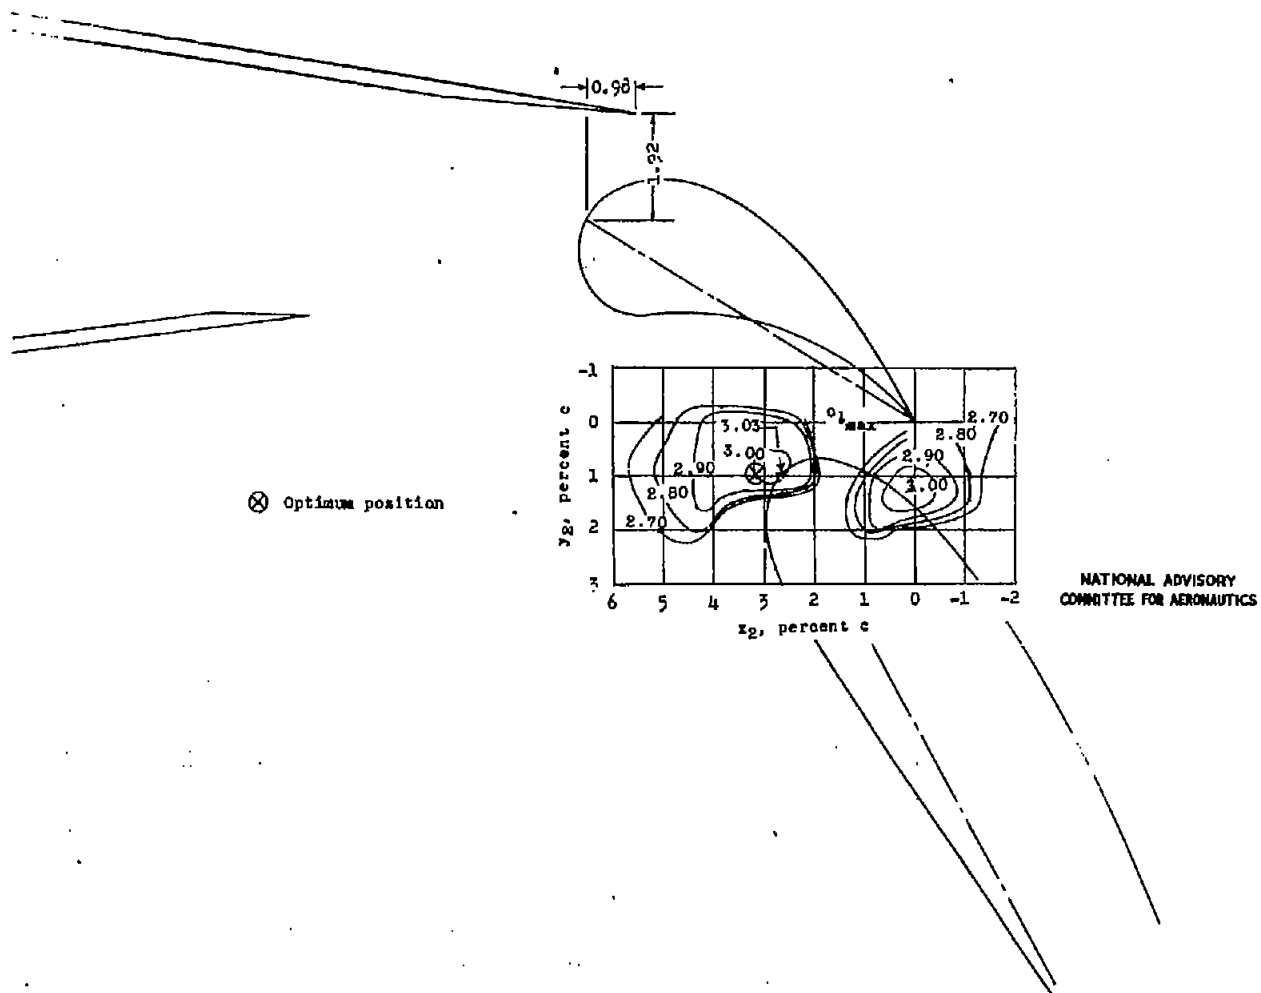
NACA TN No. 1545

NACA 64_1-212

Figure 33.- Contours of flap and fore-flap position for maximum lift of the NACA 64_1-212 airfoil section with a double slotted flap; 0.075c fore flap; 0.250c flap. $\delta_f = 50^\circ$; $\delta_{ff} = 25^\circ$;   R = 2.4 × 10^6.

(a) $\delta_{ff} = 25°$. $x_1 = 0.93$; $y_1 = 2.01$;
R = 6.0 × 10⁶.
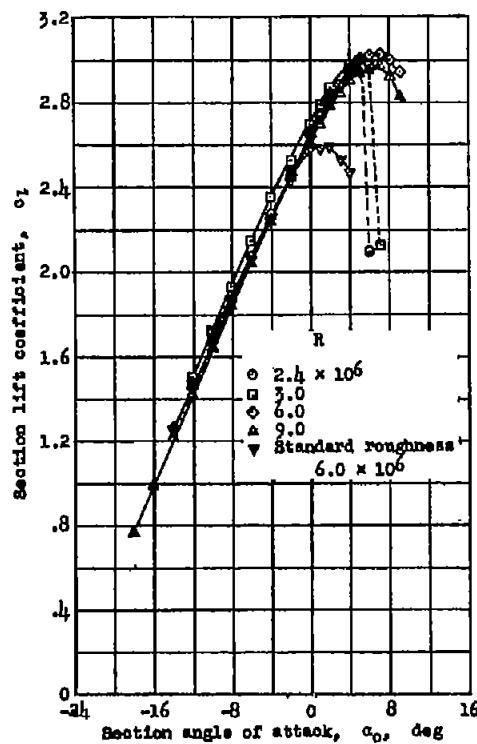
(b) $\delta_{ff} = 30°$; $\delta_f = 50°$. $x_1 = 0.98$; $y_1 = 1.92$;
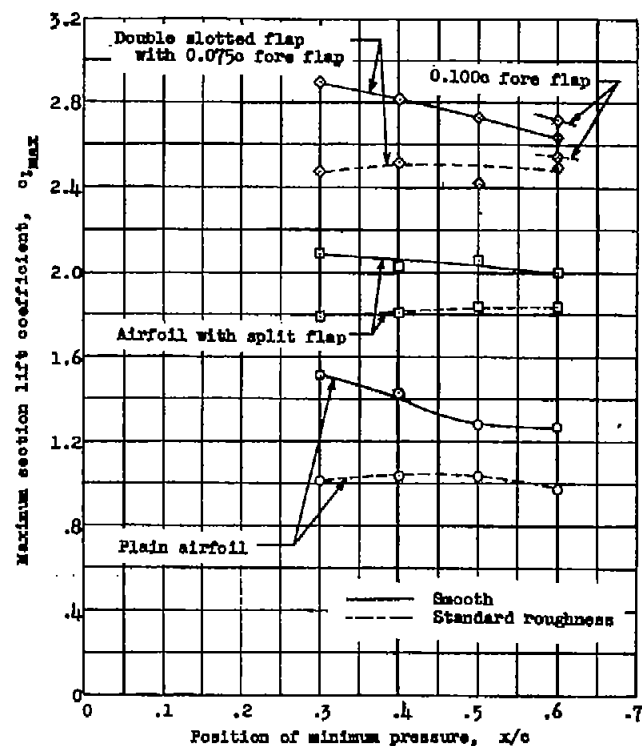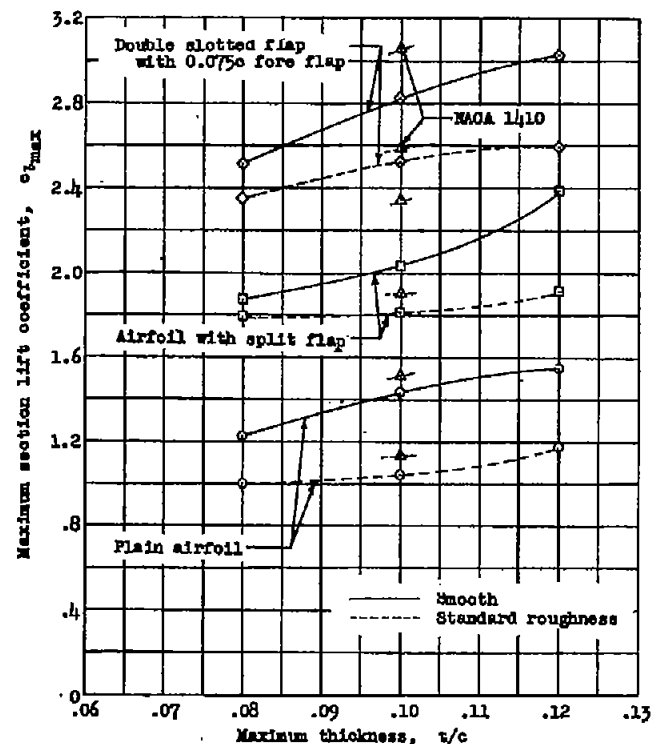$x_2 = 2.10$; $y_2 = 1.96$.

NATIONAL ADVISORY
COMMITTEE FOR AERONAUTICS
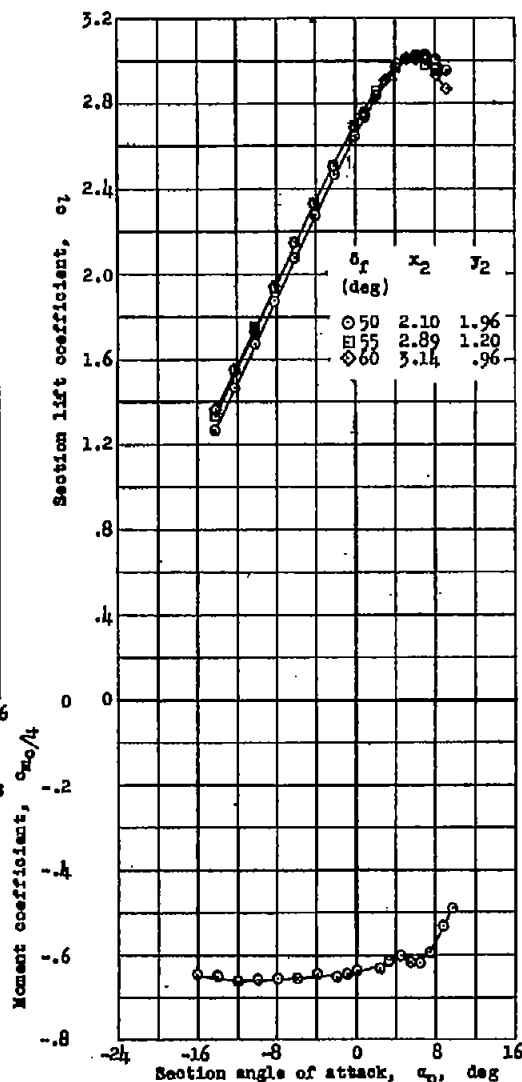
(c) $\delta_{ff} = 30°$; $x_1 = 0.98$; $y_1 = 1.92$; R = 6.0 × 10⁶.

NACA 64₁-212

Figure 34.- Section lift and pitching-moment characteristics of the NACA 64₁-212 airfoil section with a double slotted flap;
0.075c fore flap; 0.250c flap.

(a) Variation of $c_{l_{max}}$ with position of minimum pressure; $\frac{t}{c} = 0.10$.

(b) Variation of $c_{l_{max}}$ with t/c; minimum pressure at $\frac{x}{c} = 0.40$.

NATIONAL ADVISORY
COMMITTEE FOR AERONAUTICS

Figure 95.- Variation of maximum section lift coefficient with position of minimum pressure and maximum thickness for some NACA 6-series airfoil sections cambered for ideal lift coefficients of 0.2. $R = 6.0 \times 10^6$.
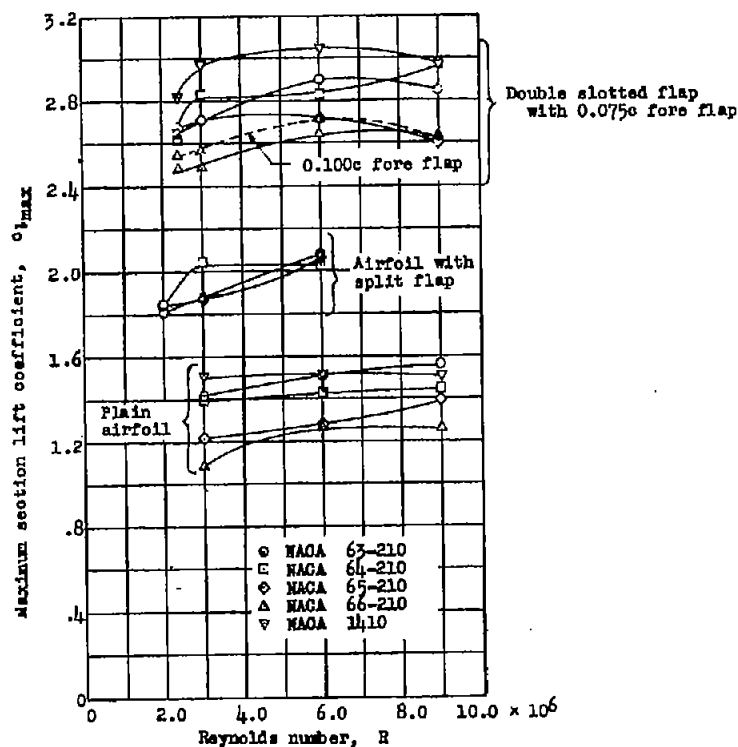
Figure 36.- Effect of Reynolds number on the maximum
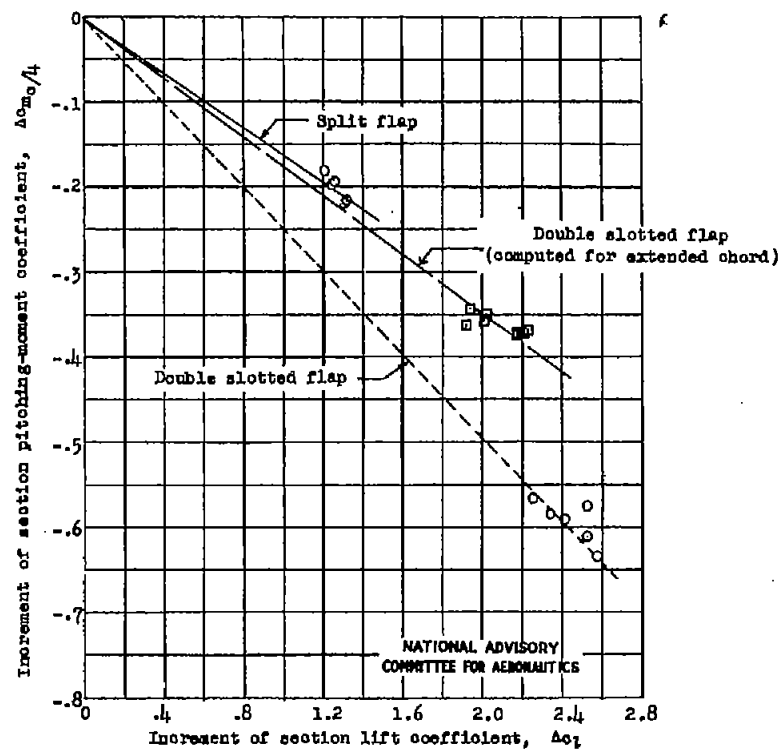section lift coefficient of some NACA airfoil sections.

Figure 37.- Variation of increment of section lift coefficient
with increment of section pitching-moment coefficient caused
by addition of flaps on some thin NACA 6-series airfoil
sections. $\alpha_o = 0°$.